Issue No. : Issue 1
Issue Date : May 2022

Project No. : 1825



MONTHLY ENVIRONMENTAL MONITORING & AUDIT REPORT (APRIL 2022)

**FOR** 

PORT SHELTER PHASE 3, PO TOI O SEWERAGE TREATMENT PLANT

Prepared by

Allied Environmental Consultants Limited

**COMMERCIAL-IN-CONFIDENCE** 

Issue No. : Issue 1 : May 2022 Issue Date

Project No.

: 1825



**MONTHLY ENVIRONMENTAL** MONITORING & **AUDIT REPORT (APRIL 2022)** 

**FOR** 

PORT SHELTER PHASE 3, PO TOI SEWERAGE TREATMENT **PLANT** 

Prepared by

Allied Environmental Consultants Limited

**COMMERCIAL-IN-CONFIDENCE** 

Certified by: Verified by:

Timmy WON6

**Environmental Team Leader** 

Independent Environmental Checker

沛然環境評估工程顧問有限公司

www.asecg.com T: +852 2815 7028 F: +852 2815 5399



Our Ref: PL-202205019

Drainage Services Department Special Duty Division 42/F, Revenue Tower, 5 Gloucester Road, Wan Chai, Hong Kong.

Attention: Ms. Janet YUEN

16 May 2022

Dear Janet,

Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Monthly EM&A Report for April 2022

Reference is made to your submission of the Monthly EM&A Report for April 2022 received by email on 11 May 2022 and the subsequent revision on 13 May 2022. We are pleased to inform you that we have no adverse comment on the captioned report.

Website: www.acuityhk.com
Unit E, 12/F., Ford Glory Plaza,
Nos. 37-39 Wing Hong Street,
Cheung Sha Wan, Kowloon, HK
Tel.: (852) 2698 6833
Fax.: (852) 2698 9383

Thank you for your attention. Please do not hesitate to contact the undersigned should you have any queries.

Yours faithfully,

Toay Fauldery

F.C. Tsang

Independent Environmental Checker

cc. ETL – Timmy WONG

## **Document Verification**

1



Grace Kwok

Project Title Port Shelter Phase 3, Po Toi O Project No.

Sewerage Treatment Plant 1825

Document Title Monthly Environmental Monitoring & Audit Report (April

2022)

Issue No. Issue Date Description Prepared by Checked by Approved by

May 2022 1st Submission Timmy Wong Joanne Ng

## **Table of Contents**

1.	Executive Summary	1
1.2.	Key Construction Works During the Reporting Period	1
1.3.	Summary of Exceedances, Investigation and Follow-up	2
1.4.	Complaint Handling, Prosecution and Public Engagement	2
1.5.	Reporting Change of EM&A Programme	2
1.6.	Future Key Issues	2
2.	Introduction	3
2.2.	Project Background	3
2.3.	Scope of Report	4
2.4.	Project Organisation	4
2.5.	Construction Programme and Activities	5
3.	Air Quality	6
3.1.	Monitoring Requirements	6
3.2.	Monitoring Equipment	6
3.3.	Monitoring Parameters, Frequency and Duration	8
3.4.	Monitoring Locations	8
3.5.	Monitoring Methodology	9
3.6.	Monitoring Results and Observations	12
3.7.	Other Influencing Factors of the Monitoring Results	13
4.	Noise	14
4.1.	Monitoring Requirements	14
4.2.	Monitoring Equipment	14
4.3.	Monitoring Locations	15
4.4.	Monitoring Parameters and Frequency	16
4.5.	Monitoring Methodology	16
4.6.	Monitoring Results and Observations	. 17

4.7.	Other Influencing Factors of the Monitoring Results
5.	Water Quality19
5.1.	Monitoring Requirements19
5.2.	Monitoring Parameters and Frequency20
5.3.	Monitoring Locations20
5.4.	Results and Observations21
6.	Environmental Site Inspection and Audit22
6.1.	Site Inspection
6.2.	Waste Management
6.3.	Status of Environmental Licenses, Notification and Permits
6.4.	Implementation Status on Environmental Protection Requirements28
6.5.	Summary of Complaints, Notification of Summons, Successful Prosecutions and Public
Enga	agement Activities
7.	Future Key Issues29
7.1.	Construction Programme for the Upcoming Reporting Month
7.2.	Reinstatement Works Key Issues for the Upcoming Reporting Month29
7.3.	Monitoring Schedule for the Coming Month
8.	Conclusion30
8.1.	General30
8.2.	Environmental Impact Monitoring30
8.3.	Environmental Site Inspections
8.4.	Complaint Log30
8.5.	Reporting Changes30
8.6.	Notifications of Summons and Successful Prosecutions

## **List of Tables**

Table 2-1	Contact Information of Key Personnel	4
Table 3-1	Action and Limit Levels for 1-hour TSP	6
Table 3-2	Action and Limit Levels for 24-hour TSP	6
Table 3-3	Equipment Used for Air Quality Monitoring	7
Table 3-4	Monitoring Parameters for Air Quality Monitoring	8
Table 3-5	Location of Air Quality Monitoring Stations	9
Table 3-6	1-hour Air Quality Monitoring Results in the Reporting Period	13
Table 3-7	24-hour Air Quality Monitoring Results in the Reporting Period	13
Table 4-1	Action and Limit Levels for Construction Noise	14
Table 4-2	Noise Monitoring Equipment	15
Table 4-3	Description of Proposed Noise Monitoring Locations	15
Table 4-4	Parameters for Noise Impact Monitoring	16
Table 4-5	Summary of Construction Noise Monitoring Results in the Reporting Period	17
Table 5-1	Parameters of Water Quality Monitoring	20
Table 5-2	Summary of Water Quality Impact Monitoring Stations	21
Table 6-1	Observations and Recommendations in the Reporting Month	22
Table 6-2	IEC Surprise Site inspection Observations and Recommendations in the Reporting Mont	h.26
Table 6-3	Summary of Waste Flow Table	27
Table 6-4	Status of Environmental License. Notification and Permit	28

# List of Figures

Figure 2-1	Layout Plan of the Captioned Project
Figure 3-1	Proposed Air Quality and Nosie Monitoring Stations Locations
Figure 5-1	Locations of Water Quality Impact Monitoring Stations

# **List of Appendices**

Appendix 2-1	Project Organization Chart
Appendix 2-2	Construction Works Programme
Appendix 3-1	Meteorlogical Data
Appendix 3-2	Air Quality Monitoring Equipment Calibration Certificates
Appendix 3-3	High-Volume Sampler Calibration Calculation Spreadsheet
Appendix 3-4	Methodology for Correlation Calculation between Potable Laser Dust Meter and High-
	Volume Sampler
Appendix 3-5	Correlation Calculation between Potable Laser Dust Meter and High-Volume Sampler
Appendix 3-6	Air Quality and Nosie Impact Monitoring Schedule
Appendix 3-7	1 hr and 24 hrs TSP Monitoring Result
Appendix 3-8	Event and Action Plan for Air Quality Impact Monitoring
Appendix 4-1	Noise Monitoring Equipment Calibration Certificates
Appendix 4-2	Noise Impact Monitoring Results
Appendix 4-3	Event and Action Plan for Noise Impact Monitoring
Appendix 6-1	Monthly Summary of Waste Flow
Appendix 6-2	Impletementation Schedule of Recommended Mitgation Measures
Appendix 6-3	Recommended Mitigation Measures and Proactive Environmental Protection Proforma
Appendix 6-4	Cumulative Statistics on Complaints, Notifications of Summons

## 1. Executive Summary

- 1.1.1. The proposed sewerage works in Po Toi O (hereafter as "the Project") is an environmental enhancement project that aims to improve environmental hygiene of the Po Toi O area. The Environmental Impact Assessment (EIA) Report for the Project (Register No: AEIAR-206/2017) was approved on 27 January 2017. The Environmental Permit (EP) (Permit No.: EP-516/2016) was issued on 27 January 2017 and is the current permit for the Project.
- 1.1.2. Allied Environmental Consultants (AEC) has been appointed by Drainage Services Department (DSD) as the Environmental Team (ET) to undertake the EM&A programme during construction phase of the Project in accordance to the approved EM&A Manual for the Project.
- 1.1.3. This is the 14<sup>th</sup> monthly Environmental Monitoring & Audit (EM&A) Report prepared by Allied Environmental Consultants Limited (AEC) for the Project. This report summarized the monitoring results and audits findings of the EM&A programme under the EP and the EM&A Manual of the Project during the reporting period of 1 April 2022 to 30 April 2022.

#### 1.2. Key Construction Works During the Reporting Period

1.2.1. The main works undertaken during the reporting period are as follows:

-Major activities in the reporting month:

- a) Construction of village sewer;
- b) Slope works.

## 1.3. Summary of Exceedances, Investigation and Follow-up

1.3.1. There was no action or limit level exceedance record of construction noise and air quality was recorded in the reporting month.

## 1.4. Complaint Handling, Prosecution and Public Engagement

- 1.4.1. No complaints, notification of summons and successful prosecution was received in the reporting period. No public engagement activity was conducted in the reporting month.
- 1.4.2. No notification of summons and successful prosecution was received in the reporting period. No public engagement activity was conducted in the reporting month.
- 1.4.3. No air quality, noise and water complaints during 0700 1900 hours on normal weekdays was received in the reporting month.

## 1.5. Reporting Change of EM&A Programme

1.5.1. No reporting change of the EM&A programme in this reporting month.

#### 1.6. Future Key Issues

1.6.1. The main works will be anticipated in the next reporting period are as follows:

#### -Major activities in the upcoming month:

- a) Construction of village sewer;
- b) Slope works.
- c) Construction of temporary working platform and installation of silt curtain for HDD.

## 2. Introduction

2.1.1. Allied Environmental Consultants (AEC) has been appointed by Drainage Services Department (DSD) as the Environmental Team (ET) to undertake the EM&A programme during construction phase of the Project in accordance to the approved EM&A Manual for the proposed sewerage works in Po Toi O (hereafter as "The Project"), an environmental enhancement project that aims to improve environmental hygiene of the Po Toi O area.

## 2.2. Project Background

- 2.2.1. Po Toi O is located in the southern part of Sai Kung District, next to Clear Water Bay. There is a small settlement called Po Toi O village around the bay. There is currently no public sewerage system for the village. Sewage and wastewater generated by local residents and local restaurants are treated by septic tanks/ soakaway system (STS).
- 2.2.2. Sewage works at Po Toi O comprise sewage collection, treatment and disposal facilities at Po Toi O under Port Shelter Sewerage, Stage 3 Sewerage Works at Po Toi O.
- 2.2.3. The Project in Po Toi O mainly comprises of the following items:
  - Provision of village sewerage to the unsewered areas of Po Toi O. The works involve construction of about 800m of gravity sewers and 400m of rising mains;
  - ii. Construction of a local sewage treatment plant (STP) with Average Dry Weather Flow (ADWF) of about 139m3/day; and
  - iii. Construction of a submarine outfall of about 385m in length.
- 2.2.4. The Project consists of the following works, which are classified as Designated Projects under Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO):
  - i. Item Q.1 A sewage treatment plant and portion of sewer alignments in a conservation area;
  - ii. Item C.12 (a) (v) and (vii) A dredging operation which is less than 500m from the nearest boundary of an existing fish culture zone and coastal protection area; and
  - iii. Item F.6 A submarine sewage outfall.
- 2.2.5. The Environmental Impact Assessment (EIA) Report "Port Shelter Sewerage, Stage 3 Sewerage Works at Po Toi O" (Register No: AEIAR-206/2017) was approved on 27 January 2017. A Variation of an Environmental Permit (VEP) (Permit No.: EP-516/2016) was issued on 27 January 2017 and is the current permit for the Project.

- 2.2.6. The EM&A programme of the Project shall be implemented in accordance with the requirements and procedures set out in the EM&A Manual and the Environmental Permit (EP) of the Project (Permit No.: EP-516/2016).
- 2.2.7. The air quality and noise baseline monitoring works were conducted from 23 December 2020 to 5 January 2021 and the water quality baseline monitoring work was conducted from 17 December 2020 to 12 January 2021. A Baseline Monitoring Report had been submitted to EPD on 10 February 2021.

#### 2.3. Scope of Report

2.3.1. This is the 14<sup>th</sup> EM&A Report prepared by AEC for the Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O. This report summarized the monitoring results and audits findings of the EM&A programme under the EP of the Project and in accordance with the EM&A Manual during the reporting period of 1 April 2022 to 30 April 2022.

## 2.4. Project Organisation

2.4.1. The project organization structure is shown in *Appendix 2-1*. The key personnel contact names and numbers are summarized in *Table 2-1*.

Table 2-1 Contact Information of Key Personnel

Position	Party	Name	Telephone	
Project Proponent	Drainage Services	Ms. Yuen Ho Yan	2594 7353	
Project Proponent	Department (DSD)	ivis. Tuen no fan	2394 7333	
Resident Engineer	Binnies Hong Kong Limited	Mr. Eugana Chan	6202 2800	
(RE)	(Binnies)	Mr. Eugene Chan	6392 3809	
Independent	A suite a Constaine a bilite a		2698 8060	
Environmental	Acuity Sustainability	Dr. F.C. Tsang		
Checker (IEC)	Consulting Limited (ASC)			
Environmental	Allied Environmental	Mr. Timorou Mono	2015 7100	
Team (ET)	Consultants Limited (AEC)	Mr. Timmy Wong	3915 7186	
Environmental	China Geo-engineering	Mr. Jacobar Tana	6007.5520	
Officer (EO)	Corporation (CGC)	Mr. Jasper Tang	6997 5530	

## 2.5. Construction Programme and Activities

2.5.1. The main works will be anticipated in the reporting period are as follows:

## Major activities in the reporting month:

- a) Construction of village sewer;
- b) Slope works.
- 2.5.2. The Construction Programme is shown in *Appendix 2-2*. The general layout plan of the Project is shown in *Figure 2-1*.

## 3. Air Quality

## 3.1. Monitoring Requirements

3.1.1. In accordance with the EM&A Manual, impact air quality monitoring shall be carried out throughout the construction period at all approved air quality monitoring locations (AMSs). 24-hours total suspended particles (TSP) monitoring shall be conducted at least once every 6 days. Meanwhile, 1-hour TSP monitoring shall be conducted at least 3 times every 6 days when the highest dust impact takes place. The Action and Limit levels for 1-hour and 24-hours TSP level are provided in *Table 3-1 and Table 3-2*.

Table 3-1 Action and Limit Levels for 1-hour TSP

Parameter	Air Quality Monitoring Station (AMSs)	Action Level (μg/m³)	Limit Level (µg/m³)
1-hr TSP	AMS1N	319	
(μg/m³)	AMS2N1	279	500µg/m³
	AMS3N	303	300μg/111
	AMS4N	278	

Table 3-2 Action and Limit Levels for 24-hour TSP

Parameter	Air Quality Monitoring	Action Level (μg/m³)	Limit Level (μg/m³)
	Station (AMSs)		
24-hr TSP	AMS1N	153	
(μg/m³)	AMS2N1	179	260μg/m³
	AMS3N	158	
	AMS4N	144	

## 3.2. Monitoring Equipment

3.2.1. The 24-hour TSP air quality monitoring was performed using High Volume Air Samplers (HVS) at each of the designated monitoring stations. The HVS are calibrated by a HVS calibrator. Meanwhile 1-hour TSP air quality monitoring was performed using portable TSP monitors. The equipment used for air quality monitoring are given in *Table 3-3*.

Table 3-3 Equipment Used for Air Quality Monitoring.

Air Quality Monitoring	Brand and Model of Equipment	Serial Number
		1180
	Connection CNAVALLISTS Make the Connection	1174
24-hour TSP*	Graseby GMW High Volume Sampler	9795
		2483
	Tisch TE-5025A High Volume Sampler Calibrator	3863
		014746
1 have TCD	Sibata LD-3B Portable TSP Monitors	155331
1-hour TSP		597340
		597227

#### Note:

- 3.2.2. Meteorological information (such as the humidity, rainfall, air pressure and temperature etc.) were collected from Hong Kong Observatory (HKO)'s Weather Stations.
- 3.2.3. According to the approved EM&A Manual, wind data monitoring equipment shall be provided and setup for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
  - a) The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
  - b) The wind data should be captured by a data logger. The data shall be downloaded for analysis at least once a month.
  - c) The wind data monitoring equipment should be re-calibrated at least once every six months.
  - d) Wind direction should be divided into 16 sectors of 22.5 degrees each.

<sup>\*</sup> If 24-hour TSP monitoring is significantly affected by power supply inconsistency at Po Toi O village, 24-hour TSP monitoring will be conducted by direct reading dust meter instead. The proposal for the use of direct reading dust meters for 24-hour TSP monitoring was approved by IEC and ER of the Project.

- 3.2.4. It is noted that after liaison with the Po Toi O resident's representative on 22 December 2020, the resident's representative has rejected the access to the space and power supply for ET to install the wind data monitoring stations. Therefore, ET had proposed the alternative method for wind data collection according to section 3.4.7 of EM&A Manual.
- 3.2.5. The alternative method for wind data collection was adopt the wind data information collected from the HKO's Waglan Island weather station as the representative wind data. Although there are other closer weather stations, Waglan Island Station was selected as it is the nearest weather station that measures wind data information mentioned above.
- 3.2.6. The meteorological data from HKO's Weather Station is given in Appendix 3-1.

## 3.3. Monitoring Parameters, Frequency and Duration

3.3.1. The parameters, duration and frequency for air quality impact monitoring is given in *Table 3-4*.

**Table 3-4 Monitoring Parameters for Air Quality Monitoring** 

Identification No.	Location	Parameters	Frequency
AMS1N*	Footpath above House		<u>1-hour TSP:</u>
AIVISTIN.	No. 28 Po Toi O Chuen Road		At least 3
A N 4 C 2 N 14 *	Open space Approx. 15 m from		times for 1-
AMS2N1*	Hung Shing Temple	1-hr TSP	hour with
A N 4 C 2 N 1 *	Vacant land near Temporary	24-hr TSP	every 6 days
AMS3N*	Structure (House) Rocky Shore		24-hour TSP:
AMS4N*	5   1 6		Once every 6
AIVIS4IN*	Resting shelter near Seacrest Villas		days

Notes

#### 3.4. Monitoring Locations

3.4.1. Monitoring stations AMS1N, AMS2N1, AMS3N and AMS4N were set up in accordance to the requirements for placement of equipment, as set out in section 3.5.3 of the EM&A manual of the Project. The location of the new representative AMSs and air quality monitoring equipment used are given in *Table 3-5*. Locations of the alternative AMSs are given in *Figure 3-1*.

<sup>\*-</sup> Due to a number of limitations identified at the air quality monitoring stations in the Approved EM&A Manual for the Project, the monitoring location AMS1 – AMS4 were replaced by alternative monitoring location AMS1N – AMS4N, which were approved by ER and IEC.

Table 3-5 Location of Air Quality Monitoring Stations

Identification No.	Location	Type of Monitoring	Duration	
AMS1N*	Footpath above House No. 28 Po Toi O	TSP	1 hr & 24 hrs	
AMSIN	Chuen Road	131	1111 & 241113	
AMS2N1*	Open space approximately 15 m from	TSP	1 hr & 24 hrs	
AIVISZIVI	Hung Shing Temple		1111 & 241113	
AMS3N*	Vacant land near Temporary Structure	TSP	1 hr & 24 hrs	
AIVISSIN	(House) Rocky Shore		1111 & 241113	
AMS4N* Resting shelter near Seacrest Villas		TSP	1 hr & 24 hrs	

#### Notes:

## 3.5. Monitoring Methodology

## **Monitoring Methodology for 24-hour TSP Monitoring**

- 3.5.1. The HVS was installed in the vicinity of the air quality monitoring stations. The following criteria were considered in the installation of the HVS:
  - i. A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
  - ii. The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
  - iii. A minimum of 2 meters separation from walls, parapets and penthouse for rooftop sampler.
  - iv. A minimum of 2 meters separation from any supporting structure, measured horizontally.
  - v. No furnace or incinerator flues nearby.
  - vi. Airflow around the sampler was unrestricted.
  - vii. Permission was obtained to set up the samplers and access to the monitoring stations.
  - viii. A secured supply of electricity was obtained to operate the samplers.
  - ix. The sampler was located more than 20 meters from any dripline.
  - x. Any wire fence and gate, required to protect the sampler, did not obstruct the monitoring process.
  - xi. Flow control accuracy was kept within ±2.5% deviation over 24-hour sampling period.

<sup>\*-</sup> Due to a number of limitations identified at the air quality monitoring stations in the Approved EM&A Manual for the Project, the monitoring location AMS1 – AMS4 were replaced by alternative monitoring location AMS1N – AMS4N, which were agreed by ER and IEC.

- 3.5.2. The following procedures to be followed for the preparation of filter papers of the HVS:
  - Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
  - ii. All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ±3 °C; the relative humidity (RH) was < 50% and not variable by more than ±5%. A convenient working RH was 40%.
  - iii. All filter papers were prepared and analysed by a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes.
- 3.5.3. The following procedures are followed throughout air quality monitoring works:
  - i. The power supply was checked to ensure the HVS works properly.
  - ii. The filter holder and the area surrounding the filter were cleaned.
  - iii. The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
  - iv. The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
  - v. The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied was sufficient to avoid air leakage at the edges.
  - vi. Then the shelter lid was closed and was secured with the aluminium strip.
  - vii. The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.
  - viii. A new flow rate record sheet was set into the flow recorder.
  - ix. On site temperature and atmospheric pressure readings were taken and the flow rate of the HVS was checked and adjusted at around 1.1 m³/min, and complied with the range specified in the updated EM&A Manual (i.e., 0.6-1.7 m³/min).
  - x. The programmable digital timer was set for a sampling period of 24 hrs, and the starting time, weather condition and the filter number were recorded.
  - xi. The initial elapsed time was recorded.
  - xii. At the end of sampling, on site temperature and atmospheric pressure readings were taken and the final flow rate of the HVS was checked and recorded.
  - xiii. The final elapsed time was recorded.
  - xiv. The sampled filter was removed carefully and folded in half-length so that only surfaces with collected particulate matter were in contact.

- xv. It was then placed in a clean plastic envelope and sealed.
- xvi. All monitoring information was recorded on a standard data sheet.
- 3.5.4. The following procedures are followed for the maintenance and calibration of HVS:
  - The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
  - ii. 5-point calibration of the HVS was conducted using TE-5025A Calibration Kit prior to the commencement of monitoring. Bi-monthly 5-point calibration of the HVS will be carried out during impact monitoring. The details for HVS calibration against the TE-5025A Calibration Kit is given in *Appendix 3-3*.

#### Monitoring Methodology for 24-hour TSP Monitoring by Direct Reading Dust Meters

- 3.5.5. Since power supply for HVS for 24-hour TSP monitoring at alternative monitoring locations (i.e., AMS1N to AMS4N) were rejected, the use of direct reading dust meters is adopted to measure both 1-hour and 24-hour average TSP levels for the reporting month.
- 3.5.6. In accordance to Condition 3.1 of the Project's EP and Section 3.3 of the Project's EM&A Manual, the proposal for alternative monitoring equipment (i.e., direct reading dust meter) for TSP monitoring was approved by IEC and ER.
- 3.5.7. The measuring procedures of the direct reading dust meters are given in **Section 3.5.10**.
- 3.5.8. 24 consecutive 1-hour TSP concentration measurement results is adopted for the evaluation of 24-hour TSP concentration. Results are manually logged daily, during daily maintenance of the dust meter. Calculation of the value of 24-hour TSP concentration is given by the average of 24 calculated 1-hour TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and HVS. Details for the correlation methodology and correlation record are given in *Appendix 3-4* and *Appendix 3-5*.
- 3.5.9. HVS for 24-hr TSP monitoring will be adopted once secured supply of electricity becomes available for any agreed TSP monitoring locations.

#### Monitoring Methodology for 1-Hour TSP Monitoring

3.5.10. The measuring procedures of the direct reading dust meters were in accordance with the Manufacturer's Instruction Manual as follows:

- i. Turn the power on.
- ii. Close the air collecting opening cover.
- iii. Push the "TIME SETTING" switch to [BG].
- iv. Push "START/STOP" switch to perform background measurement for 6 seconds.
- v. Turn the knob at SENSI ADJ position to insert the light scattering plate.
- vi. Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
- vii. Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- viii. Pull out the knob and return it to MEASURE position.
- ix. Push the "TIME SETTING" switch the time set in the display to 3 hours.
- x. Lower down the air collection opening cover.
- xi. Push "START/STOP" switch to start measurement.
- 3.5.11. The following procedures are followed for the maintenance and calibration of direct reading dust meters:
  - i. The 1-hour TSP meter was calibrated at 1-year intervals against with high volume sampler.
  - ii. Calibration certificates of the Laser Dust Monitors are provided in *Appendix 3-2*. 1-hour validation checking of the TSP meter against HVS is carried out yearly at the air quality monitoring locations.

#### 3.6. Monitoring Results and Observations

- 3.6.1. The schedule for environmental monitoring in the reporting period is provided in *Appendix 3-6*.
- 3.6.2. The air quality monitoring results for 1-hour and 24-hour air quality monitoring are summarised in *Table 3-6* and *Table 3-7*. Air quality monitoring data and graphical presentation of the data are provided in *Appendix 3-7*.

Table 3-61-hour Air Quality Monitoring Results in the Reporting Period

Parameter	Monitoring Station	Average (μg/m³)	Range (µg/ m³)
	AMS1N	32	10 - 100
1-hr TSP in	AMS2N1	36	8 - 120
μg/m³	AMS3N	31	12 - 63
	AMS4N	40	13 – 111

Table 3-724-hour Air Quality Monitoring Results in the Reporting Period

Parameter	<b>Monitoring Station</b>	Average (μg/m³)	Range (µg/ m³)
	AMS1N	32	11 - 76
24-hr TSP in	AMS2N1	36	13- 96
μg/m³	AMS3N	31	13 - 50
	AMS4N	40	14 - 90

- 3.6.3. No Action or Limit Level exceedances of air quality were recorded in the reporting month. No air quality complaints between 0700 1900 hours on normal weekdays (i.e., Mondays to Saturdays) were received in the reporting month.
- 3.6.4. The event and action plan for air quality monitoring are given in *Appendix 3-8*.

#### 3.7. Other Influencing Factors of the Monitoring Results

- 3.7.1. Major emission sources during air quality monitoring in the reporting period were mainly vehicle emission from Po Toi O Chuen Road and nearby residents' activities.
- 3.7.2. The event and action plan for air quality monitoring are given in Appendix 3-8.

#### 4. Noise

## 4.1. Monitoring Requirements

4.1.1. In accordance with the EM&A Manual, noise impact monitoring was conducted during daytime construction work on normal weekdays (0700-1900 hours between Monday to Saturday), 1 set of 30-min measurement shall be carried out at approved noise monitoring stations (NMSs) every week based on the measurement procedures under EPD's" Technical Memorandum for the Assessment of Noise from Places Other Than Domestic Premises, Public Places or Construction Sites". The Action and Limit levels for construction noise monitoring is provided in *Table 4-1*.

Table 4-1 Action and Limit Levels for Construction Noise

NMSs ID	Noise Sensitive Receivers	Description	Action Level	Limit Level
NMS1N	PTO N1	Footpath Above House No. 28	When one	
141415214	1.10_111	Po Toi O Chuen Road	documented	
NMS2N1	PTO_N2	Open Space Approx. 15 m	complaint is	
INIVISZINI	PTO_N2	from Hung Shing Temple	received	75 dB(A)*
NMS3N	PTO N3	Vacant Land Near Temporary	from any one of	73 UB(A)
INICCIVIN	PTO_NS	Structure (House) Rocky Shore	the noise sensitive	
NINASANI	CV/ NI1	Resting Shelter Near Seacrest	receivers	
NMS4N	SV_N1	Villas		

Note: \*75 dB(A) for residential premises.

## 4.2. Monitoring Equipment

4.2.1. Noise monitoring was completed using sound level meters at each NMSs. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to calibrate the sound level meters at a given sound pressure level. The equipment used for noise impact monitoring is given in *Table 4-2*.

Table 4-2 Noise Monitoring Equipment

Equipment	Brand and Model	Serial No. /Equipment
		ID
Integrated Sound Level Meter	Rion NL-31	00773032
Integrated Sound Level Meter	Rion NL-52	00998504
Acoustic Calibrator	Rion NC-73	10196943
Anemometer	AZ Instrument – AZ 8908	1064869

## 4.3. Monitoring Locations

4.3.1. Due to the limitation posed by the approved monitoring stations set out by the EM&A manual, alternative monitoring stations NMS1N, NMS2N1, NMS3N and NMS4N were proposed in accordance to Section 4.5.3 of the EM&A Manual of the Project, and approved from the ER and the IEC. The locations of the NMSs are given in *Figure 3-1*, and the details of the monitoring stations are illustrated in *Table 4-3*.

Table 4-3 Description of Proposed Noise Monitoring Locations

NMSs ID	Location	Type of	Type of	Duration
		measurement	Monitoring	
NMS1N*	Footpath above House No. 28 Po Toi O Chuen Road			30 mins
	Open space approximately 15			
NMS2N1*	m from Hung Shing Temple	Free-field	Noise	30 mins
NMS3N*	Vacant land near Temporary Structure (House) Rocky Shore	Free-Heid	Noise	30 mins
NMS4N*	Resting shelter near Seacrest Villas			30 mins

#### Notes:

<sup>\*</sup>For Free-field measurement, a correction of +3dB(A) should be made to the measured results.

<sup>\*</sup> Due to the limitation posed by the approved monitoring stations set out by the EM&A manual, four alternative representative Noise Quality Monitoring Stations (NMSs) are proposed. The alternative monitoring Locations were approved by ER and IEC.

#### 4.4. Monitoring Parameters and Frequency

4.4.1. The monitoring parameters, frequency and duration of impact noise monitoring are summarised in *Table 4-4*.

**Table 4-4 Parameters for Noise Impact Monitoring** 

Parameter and Duration	Frequency
30-mins measurement at each monitoring station between	
0700 and 1900 on normal weekdays.	At least once per week
$L_{eq}$ , $L_{10}$ and $L_{90}$ would be recorded.	

#### 4.5. Monitoring Methodology

- 4.5.1. The measuring procedures of the sound level meter were in accordance with the Manufacturer's Instruction Manual as follows:
  - i. Free-field measurement was made for the noise monitoring stations.
  - ii. The sound level meter was set on a tripod at a height of 1.2 m above the ground.
  - iii. The battery condition was checked to ensure the correct functioning of the meter.
  - iv. Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
    - a. frequency weighting: A
    - b. Time weighting: Fast
    - c. Time measurement: Leq(30-minutes) during non-restricted hours i.e., 07:00 1900 on normal weekdays; Leq(5-minutes) during restricted hours i.e., 19:00 23:00 and 23:00 07:00 of normal weekdays, whole day of Sundays and Public Holidays
  - v. Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator at a specified sound pressure level at a specified frequency. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
  - vi. During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.

- vii. Noise measurement was paused during periods of high intrusive noise (e.g., dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- viii. Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s.
- 4.5.2. The following procedures are followed for the maintenance and calibration of sound level meters:
  - i. The microphone head of the sound level meter was cleaned with soft cloth at regular intervals.
  - ii. The meter and calibrator were sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
  - iii. Calibration certificates of the sound level meters and acoustic calibrators are provided in *Appendix 4-1*.

#### 4.6. Monitoring Results and Observations

- 4.6.1. The schedule for environmental monitoring in the reporting period is provided in *Appendix 3-6*.
- 4.6.2. The monitoring results for construction noise are summarised in *Table 4-5*. The noise monitoring data graphical presentation of the data is provided in *Appendix 4-2*.

Table 4-5 Summary of Construction Noise Monitoring Results in the Reporting Period

NMSs ID	Construction Noise Level,  dB(A)*, Leq (30 min)	Baseline Level, dB(A)	Limit Level, dB(A)
NMS1N	58.4 dB(A)	62.7 dB(A)	75
NMS2N1	51.2 dB(A)	61.8 dB(A)	75
NMS3N	56.4 dB(A)	64.6 dB(A)	75
NMS4N	52.8 dB(A)	58.1 dB(A)	75

#### Note:

<sup>\*-</sup> A correction of +3 dB(A) was made to the free field measurements. Leq (30min) was measured at 0700-1900 hours on normal weekdays.

- 4.6.3. No Action or Limit Level exceedance of construction noise was recorded in the reporting month. No noise complaints from between 0700 1900 hours on normal weekdays was received in the reporting month.
- 4.6.4. The event and action plan are provided in *Appendix 4-3*.

## 4.7. Other Influencing Factors of the Monitoring Results

4.7.1. Major noise sources during noise monitoring in the reporting period were mainly road traffic noise.

## 5. Water Quality

## 5.1. Monitoring Requirements

- 5.1.1. With the recommendations of the Project's EIA report, water quality impact monitoring shall be carried out carried out 3 days per week, at mid-flood and mid-ebb tides (within ± 1.75 hour of the predicted time required) at all the approved Water Quality Monitoring Stations (WQMSs) during whole cofferdam installation/extraction work and during dredging works. The interval between two sets of monitoring shall not be less than 36 hours.
- 5.1.2. Replicate in-situ measurements of Suspended Solids (SS) and in-situ water quality data (temperature, pH, turbidity, water depth, salinity, dissolved oxygen and percentage of saturation) shall be collected.
- 5.1.3. Other relevant data should also be recorded, including monitoring location/position, time, tidal stages, weather conditions and any special observation or works that may affect the monitoring results in the vicinity.
- 5.1.4. To ensure sufficient data for robust analysis, duplicate in-situ data shall be collected. In case the difference in the duplicate in-situ measurement results is larger than 25%, the third set of in-situ measurement shall be carried out for result confirmation purpose.
- 5.1.5. Water samples shall be extracted at 1m below surface, 1m above seabed and the mid-depth level at where the water depth is at least 6m. However, if the water depth is less than 3m, water samples shall only be collected at the mid-depth level. For stations with depth less than 6m, the mid-depth sample can be omitted.
- 5.1.6. In addition, duplicated water samples for suspended solid analysis shall be collected at all the above stations and delivered to the HOKLAS accredited laboratory for analysis. Results for suspended solids shall be received back from the laboratory within 24-hour of the receipt of the samples.
- 5.1.7. Water quality impact monitoring shall also be conducted at the same frequency as monitoring throughout the whole cofferdam installation/extraction work and during dredging work. In case of exceedance of Action/Limit Level recorded, the frequency of water quality monitoring shall be increased as per the Event and Action Plan.
- 5.1.8. The water quality impact monitoring schedule shall be issued to IEC at least one month prior to the commencement of Impact Monitoring.

## 5.2. Monitoring Parameters and Frequency

5.2.1. The monitoring parameters, monitoring periods and frequencies of the water quality monitoring are summarised in *Table 5-1*.

**Table 5-1 Parameters of Water Quality Monitoring** 

Parameters	Duration	Frequency
Temperature (°C)	During Construction Phase:	3 days per week
pH (pH unit)	Throughout installation	(The interval between two
	and Extraction of	sets of monitoring shall not
Turbidity (NTU)		
Water Depth (m)	Cofferdam; and	be less than 36 hours.)
water beptir (iii)	During Dredging	
Salinity (ppt)	During Dreaging	
DO (mg/l and % of		
Saturation)		
SS (mg/l)		

#### 5.3. Monitoring Locations

5.3.1. According to section 5.2.6 of the EM&A manual of the project, 6 water quality monitoring stations (WMSs) are proposed at the Po Toi O FCZs, major amphioxus habitats and rocky shores where coral thrives. With reference to the tidal characteristics of Po Toi O Bay, 3 control stations are proposed where fresh marine water is not affected by the cofferdam installation/ extraction works, and 2 impact stations are proposed near the cofferdam under different tidal periods. All water quality monitoring stations show as Figure 5-1 and Table 5-2.

**Table 5-2 Summary of Water Quality Impact Monitoring Stations** 

Station	Monitoring Period	Description	Easting	Northing
*WMS1N	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848416	845209
*WMS2N	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848505	815375
WMS3	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848644	815391
WMS4	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848774	815602
WMS5	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848578	815591
WMS6	Mid-Ebb, Mid-Flood	Major Amphioxus Habitat	848639	815523
I1	Mid-Flood	Impact monitoring Station	848643	815692
12	Mid-Ebb	Impact monitoring Station	848722	815910
C1	Mid-Flood	Control station	848904	816052
C2	Mid-Ebb	Control station	848529	815373
С3	Mid-Ebb	Control station	848243	815710
WMS1	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848387	815201
WMS2	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848479	815378

Notes:

#### 5.4. Results and Observations

- 5.4.1. According to submission of construction works schedule and location plan under the EP of Project, the proposed period of commencement construction work with cofferdam installation / extraction work and during dredging works is August 2022.
- 5.4.2. Marine construction was not commenced within the reporting month; hence no water quality monitoring was conducted.
- 5.4.3. Refer to Sections 5.2.10 and 5.2.11 of approved EM&A Manual, construction phase site inspection for water quality mitigation measures and check the contractor's work practice on water pollution prevention during construction phase has been conducted during weekly site audit.
- 5.4.4. During the weekly site audit of this reporting month, no non- conformance water pollution was identified / observed in the commencement works area.

<sup>\*</sup>WMS1N, WMS2N are new proposed alterative monitoring location. As previous EIA proposed monitoring location WMS1, WMS2 are situated in fish barges within the Fish Culture Zone (FCZ), and accesses to WMS1 and WMS2 were subsequently denied by the tenants of the fish barges. The relocation of WMS1 and WMS2 were approved by IEC and the ER of the Project.

## 6. Environmental Site Inspection and Audit

## 6.1. Site Inspection

- 6.1.1. Site inspections were carried out by ET on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. Key observations were recorded in the site inspection checklist and passed to the Contractor together with the appropriate recommended mitigation measures where necessary.
- 6.1.2. In the reporting period, 4 site inspections were carried out on 8, 14, 21 and 28 April 2022. A joint site inspection with IEC was carried out on 21 April 2022. No non-compliance was recorded during the site inspection. Details of observations recorded during the site inspections are presented in **Table 6-1.**

Table 6-1 Observations and Recommendations in the Reporting Month

Darameters	Date	Observations and	Action taken by
Parameters		Recommendations	contractor
Water Quality	24 March 2022	Reminder	Follow up Observation
		It is observed during the	It is observed during site
		site inspection, temporary	inspection on 8 April
		exposed slope surface	2022, the contractor has
		was observed in the STP	prepared impermeable
		area. The contractor was	materials to cover
		reminded to cover	temporarily exposed
		temporary exposed slope	slope surfaces in the STP
		surfaces with	area.
		impermeable materials.	
			(Item Closed)

Parameters	Date	Observations and Recommendations	Action taken by contractor
Water Quality	8 April 2022	Reminder  It is observed during the site inspection, open cut excavation for laying of gravity sewers/rising mains was conducted in the Fairway vista works area. The contractor has been reminded that to place sandbag along the upstream section of the stream near Fairway Vista and along rocky shore during open cut excavation for laying of gravity sewers/rising mains nearby.	Follow up Observation It is observed during site inspection on 14 April 2022, the contractor was prepared sandbag for along the upstream section of the stream near Fairway Vista and along rocky shore during open cut excavation for laying of gravity sewers/rising mains nearby. This item will be reinspected in the next weekly site inspection.
Water Quality	14 April 2022	Observation It is observed during the site inspection that the open excavation works in the Fairway Vista have not been set up with an intercepting channel along the crest/edge of the excavation areas. The contractor has been reminded to along the crest/edge of the excavation area with intercepting channels. The follow-up action will be inspected in the next weekly inspection.	Follow up Observation It is observed during the site inspection on 21 April 2022, it is observed during the site inspection, the contractor has been along the crest/edge of the excavation area with sandbag for the open excavation works in the Fairway Vista.  (Item Closed)

Parameters	Date	Observations and Recommendations	Action taken by contractor
Air Quality	24 March 2022	Reminder It is observed during the site inspection, exposed surface was observed in the Fairway vista works area. The contractor has been reminded that to minimize excavation area as far as possible.	Follow up Observation It is observed during the site inspection on 8 April 2022, the contractor was minimizing excavation area as far as possible for the open cut excavation for laying of gravity sewers/rising mains in the Fairway vista works area.  (Item Closed)
Air Quality	14 April 2022	Reminder  It is observed during the site inspection, the housekeeping for storage area near the Fairway Vista works area should be maintaining. The contractor has been reminded to maintain and clean storage area regularly.	Follow up Observation It is observed during the site inspection on 21 April 2022, the contractor was minimizing excavation area as far as possible for the open cut excavation for laying of gravity sewers/rising mains in the Fairway vista works area.  (Item Closed)
Air Quality	28 April 2022	Reminder  It is observed during the site inspection, open stockpiles were storage in the PTO 031 works area. The Contractor has been reminded to cover open stockpiles of construction	Follow up reminder  This item will be inspection in next month weekly monitoring.

Parameters	Date	Observations and	Action taken by
- urumeters	Dute	Recommendations	contractor
		with impermeable	
		materials such as tarpaulin	
		during rainstorms.	
Noise impact	No adverse o	bservation was identified in	the reporting period.
Ecology	21 April 2022	Reminder	Follow up reminder
		It is observed during the	It is observed during the
		site inspection, building	site inspection on 28 April
		materials and equipment	2022, the contractor was
		was temporary storage in	placed the equipment
		the Fairway Vista. The	and building materials
		contractor has been	and waste away from the
		reminded to placed the	natural environment in
		equipment and building	the Fairway Vista storage
		materials and waste away	area.
		from the natural	
		environment.	(Item closed)
Fisheries	No adverse o	bbservation was identified in	the reporting period.
Built Heritage	No adverse o	bservation was identified in	the reporting period.
Landscape & Visual	No adverse c	bservation was identified in	the reporting period.
Miscellaneous	14 April 2022	Reminder	Follow up Reminder
		It is observed during the	It is observed during the
		site inspection, building	site inspection on 21 April
		materials and equipment	2022, the contractor has
		was temporary storage in	been maintained the
		the Fairway Vista. The	housekeeping for storage
		contractor has been	area near the Fairway
		reminded to place the	Vista works area.
		equipment and building	
		materials and waste away	(Item closed)
		from the natural	
		environment.	

Parameters	Date	Observations and Recommendations	Action taken by contractor

**6.1.3.** The surprise site inspection was carried out by IEC team on 26 April 2022, 2 numbers of the observations and 1 number of the reminders was recorded during the site inspection. The inspection record for rectification by contractor was provide by ET on 28 April 2022. Details of observations recorded during the site inspections are presented in **Table 6-2.** 

Table 6-2 IEC Surprise Site inspection Observations and Recommendations in the Reporting Month

iviontn				
Parameters	Date	Observations and	Action taken by	
		Recommendations	contractor	
Water Quality	26 April 2022	<u>Observations</u>	Follow up Observation	
		IEC team was observed	ET was observed during	
		during the surprise site	site inspection on 28 April	
		inspection on 26 April	2022, the contractor was	
		2022, the stone breaker	placed the stone breaker	
		placed without	on the impermeable	
		impermeable materials	materials (i.e., Tarpaulin)	
		(i.e., Tarpaulin) at PTO 031	at PTO 031 work front.	
		work front.		
			(Item Closed)	
		Reminder		
		IEC team was reminded		
		the drip tray should be		
		plugged when in use.		
Miscellaneous	26 April 2022	<u>Observation</u>	Follow up Observation	
		IEC team was observed	It is observed during site	
		during the site inspection	inspection on 28 April	
		on 26 April 2022, the	2022, the contractor was	
		permit copy at PTO031	posted the permit copy in	
		work front site entry was	the site entry of PTO031	
		missing.	work front.	
			(Item Closed)	

### 6.2. Waste Management

- 6.2.1. As advised by the Contractor, 10 m³ of inert C&D material was generated in the reporting month. For C&D wastes, 0 m³ of general refuse was disposed of at NENT landfill, 0 kg waste were collected by recycling contractors, and 0 kg of chemical wastes was collected by licensed Contractors in the reporting period.
- 6.2.2. The actual amounts of different types of waste generated by the activities of the Project in the reporting period are shown in *Table 6-3*, the detailed monthly summary of waste flow is detailed in *Appendix 6-1*.

Table 6-3 Summary of Waste Flow Table

Waste Type	Quantity	Disposal/ Reuse Locations	
Inert C&D Waste Disposed as	10 m <sup>3</sup>	Tseung Kwan O Area 137 Fill	
Public Fill	10 m	Bank (TKO137FB).	
C&D Wastes Disposed as General	0 m <sup>3</sup>	North East New Territories	
Refuse	O m	(NENT)	
Recycle Materials	0 kg	Recycling Facilities	
General Refuse	0 kg	North East New Territories	
	0 kg	(NENT)	
Chemical Waste	0 kg	Licensed Contractors	

6.2.3. During regular site auditing, the mitigation measures proposed in the Implementation Schedule of the Environmental Mitigation Measures (EMIS) in the approved EIA report of the Project has been effectively implemented in the commenced works area. No adverse waste impact was observed from the construction works in reporting month.

#### 6.3. Status of Environmental Licenses, Notification and Permits

6.3.1. The environmental licenses and permits for the Project and valid in the reporting period are summarized in *Table 6-4*.

Table 6-4 Status of Environmental License, Notification and Permit

License/ Notification/	Reference No.	Valid Period	
Permit	Reference No.	From	То
Environmental Permit	EP-516/2016	27 January 2017	End of Project
Construction Dust	458613	3 August 2020	N/A
Notification Under APCO			
Wastewater Discharge License	WT00038707-2021	3 November 2021	31 August 2026
Chemical Waste Producer	5213-820-C3510-	22 Cantambar 2020	NI/A
Registration	18	23 September 2020	N/A
Billing Account for Disposal	WFG22785	17 August 2020	N/A
of Construction Waste			

## 6.4. Implementation Status on Environmental Protection Requirements

6.4.1. The Implementation Schedule of the Environmental Mitigation Measures (EMIS) of the reporting period is summarized in *Appendix 6-2*. The implementation of the key mitigation measures during the reporting period is presented in *Appendix 6-3*.

## 6.5. Summary of Complaints, Notification of Summons, Successful Prosecutions and Public Engagement Activities

- 6.5.1. No complaints, notification of summons and successful prosecution was received in the reporting period. No public engagement activities were conducted in the reporting period.
- 6.5.2. Statistics on complaints, notifications of summons, successful prosecutions and public engagement activities are summarized in *Appendix 6-4*.

### 7. Future Key Issues

#### 7.1. Construction Programme for the Upcoming Reporting Month

-Major activities in the upcoming month:

- a) Construction of village sewer;
- b) Slope works.
- c) Construction of temporary working platform and installation of silt curtain for HDD.

#### 7.2. Reinstatement Works Key Issues for the Upcoming Reporting Month

- 7.2.1. Potential environmental impacts due to the construction activities, including air quality, noise, water quality, waste, landscape and visual, will be monitored or reviewed. The ET will continue to implement the environmental monitoring & audit programme in accordance with the EM&A Manual and Environmental Permit requirement. The recommended environmental mitigation measures shall be implemented on site and regular inspections as required will be carried out to ensure that the environmental conditions are acceptable.
- 7.2.2. The anticipated impact of major work activities within the site and the recommended mitigation measures are shown in *Appendix 6-4*.

#### 7.3. Monitoring Schedule for the Coming Month

7.3.1. The tentative schedule for environmental monitoring in May2022 is provided in Appendix 3-6.

### 8. Conclusion

#### 8.1. General

8.1.1. This report summarized the monitoring results and audits findings of the EM&A programme under the EP of the Project and in accordance with the EM&A Manual during the reporting period of 1 April 2022 to 30 April 2022.

#### 8.2. Environmental Impact Monitoring

8.2.1. No Action or Limit Level exceedance of construction air quality, noise was recorded in the reporting month. No air quality complaints and noise complaints during 0700 – 1900 hours on normal weekdays was received in the reporting month.

#### 8.3. Environmental Site Inspections

8.3.1. For the environmental site inspections carried out in the reporting month. Recommendations on remedial actions were given to the contractors for the deficiencies identified during the site audits. The contractor had been follow-up the recommendations on the remedial action accordingly.

#### 8.4. Complaint Log


8.4.1. There was no complaint received in relation to the environmental impact during the reporting period.


#### 8.5. Reporting Changes


8.5.1. No report changes in this reporting period.


#### 8.6. Notifications of Summons and Successful Prosecutions


8.6.1. There was no notification of summons and successful prosecution was received in the reporting period

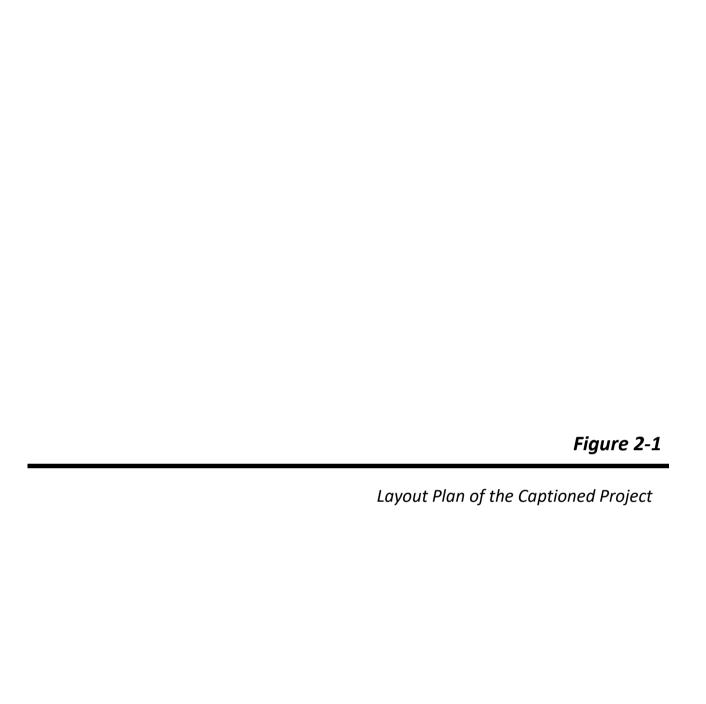

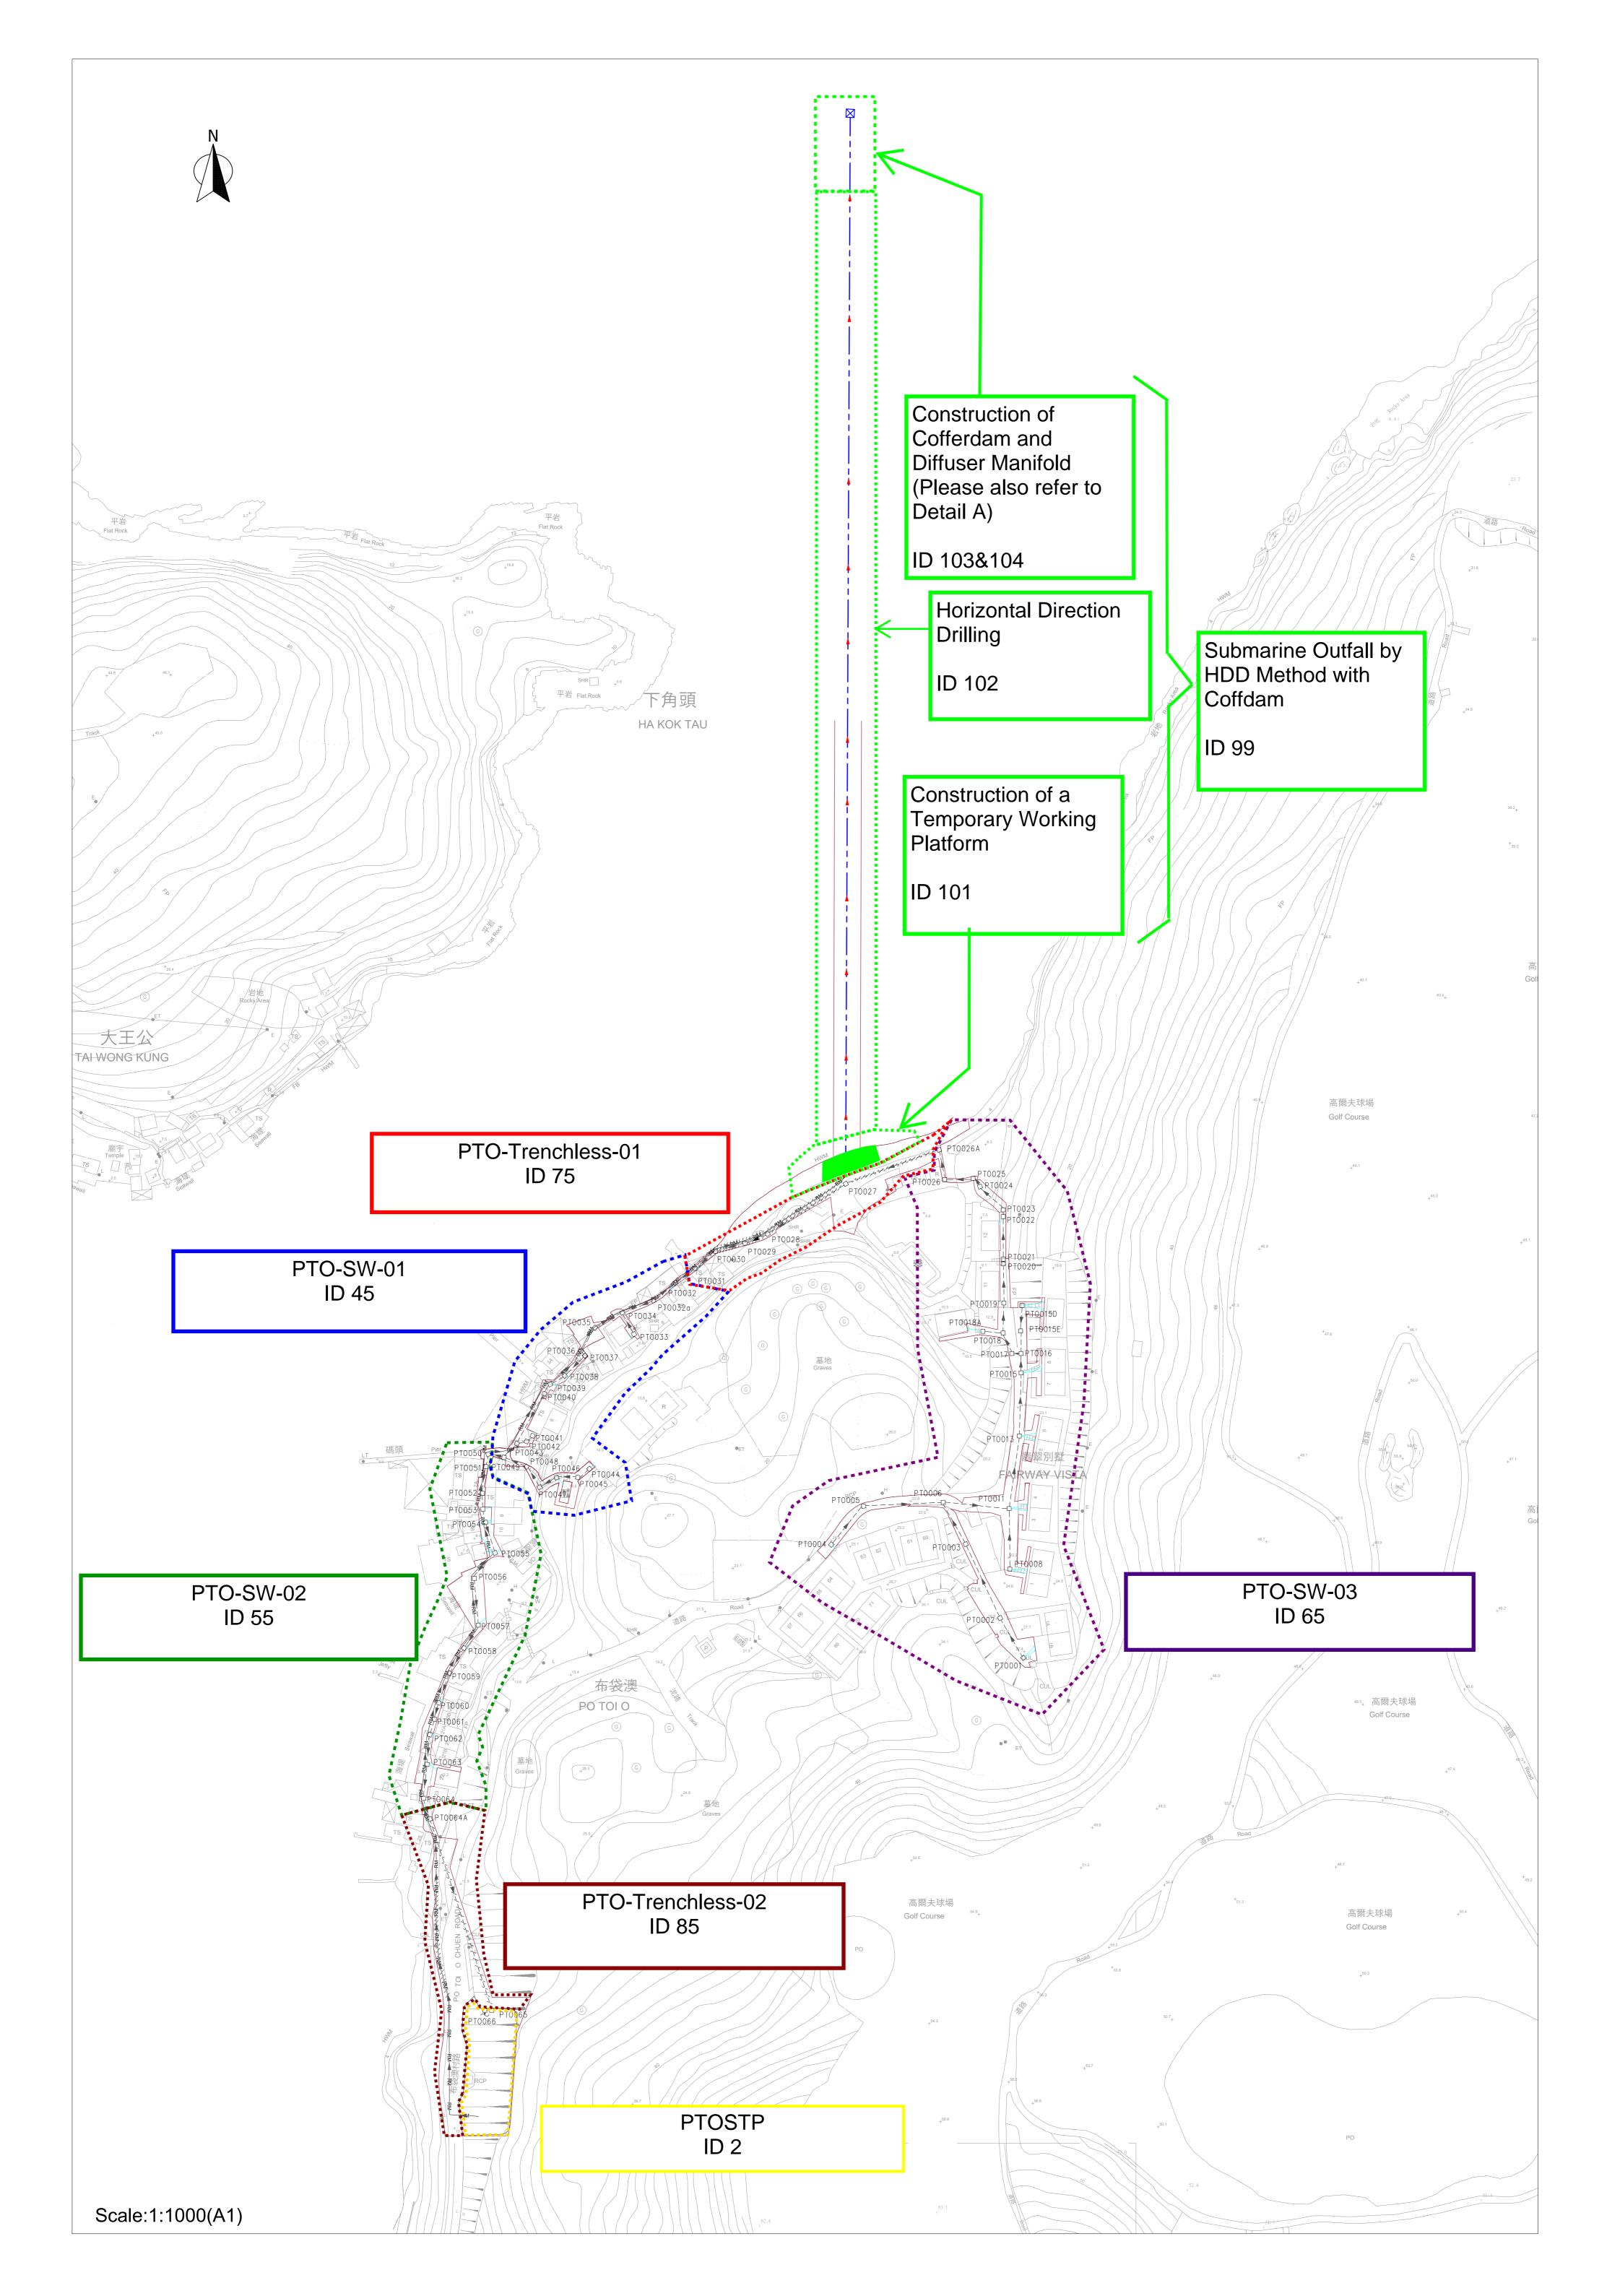

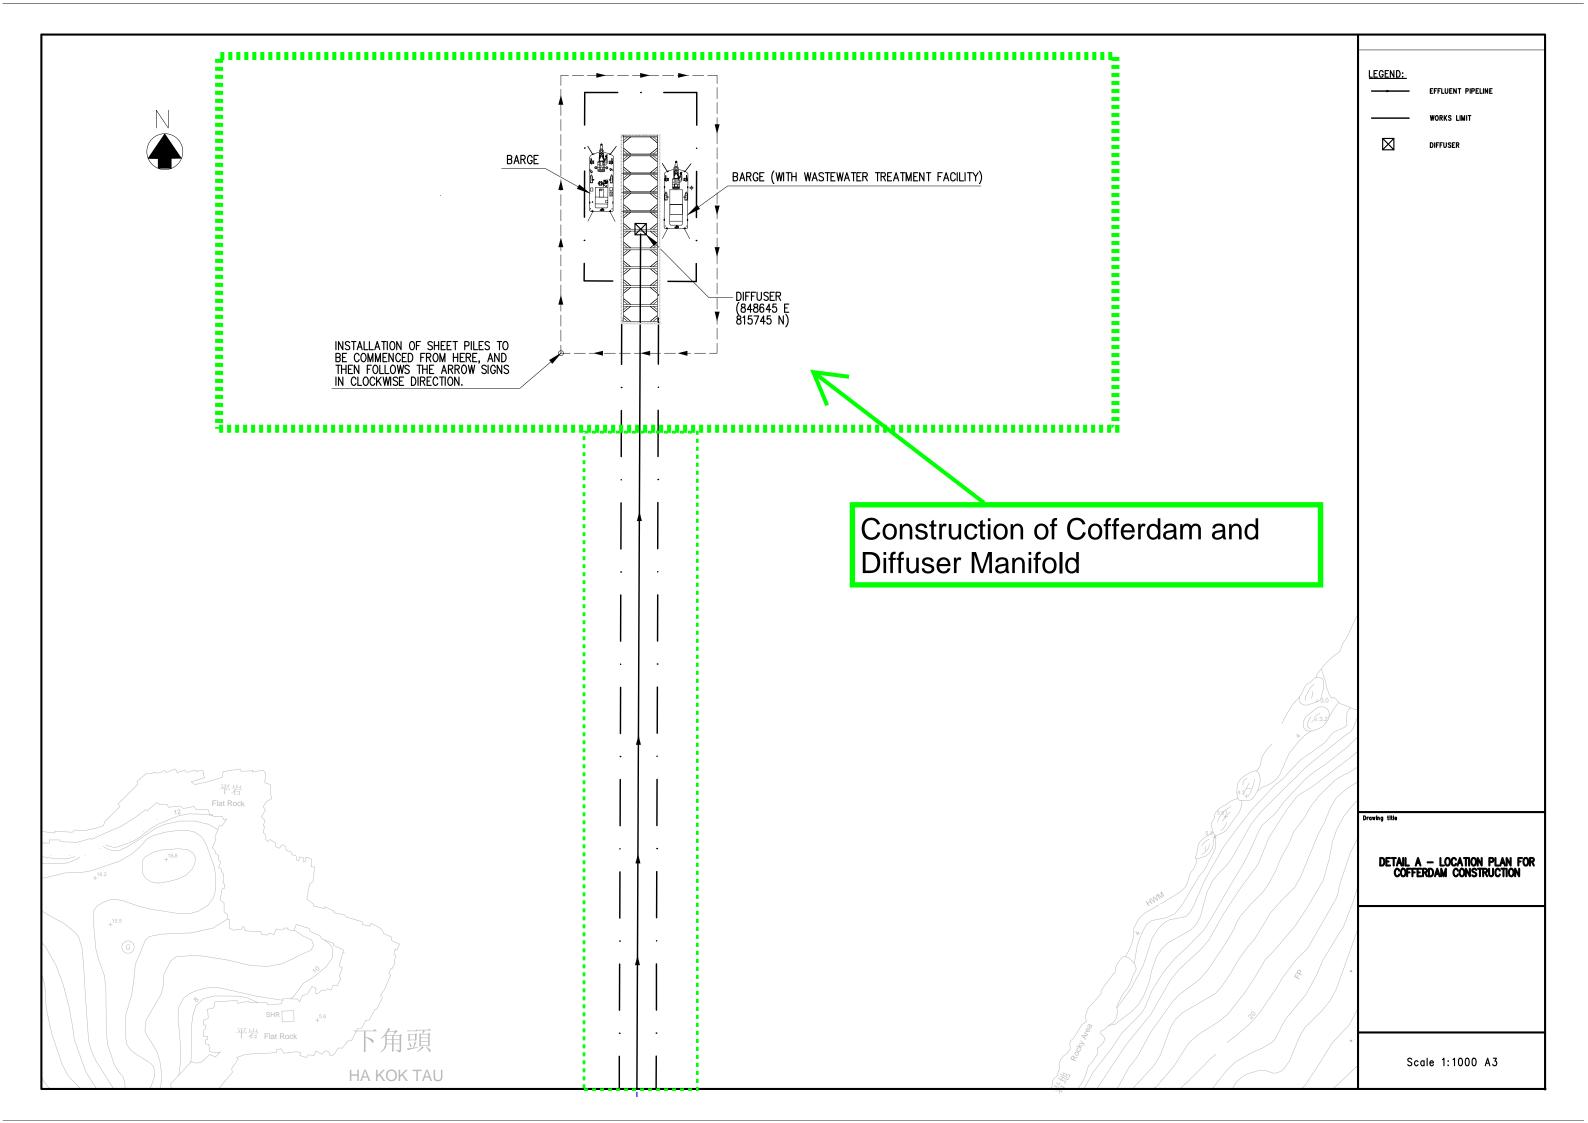


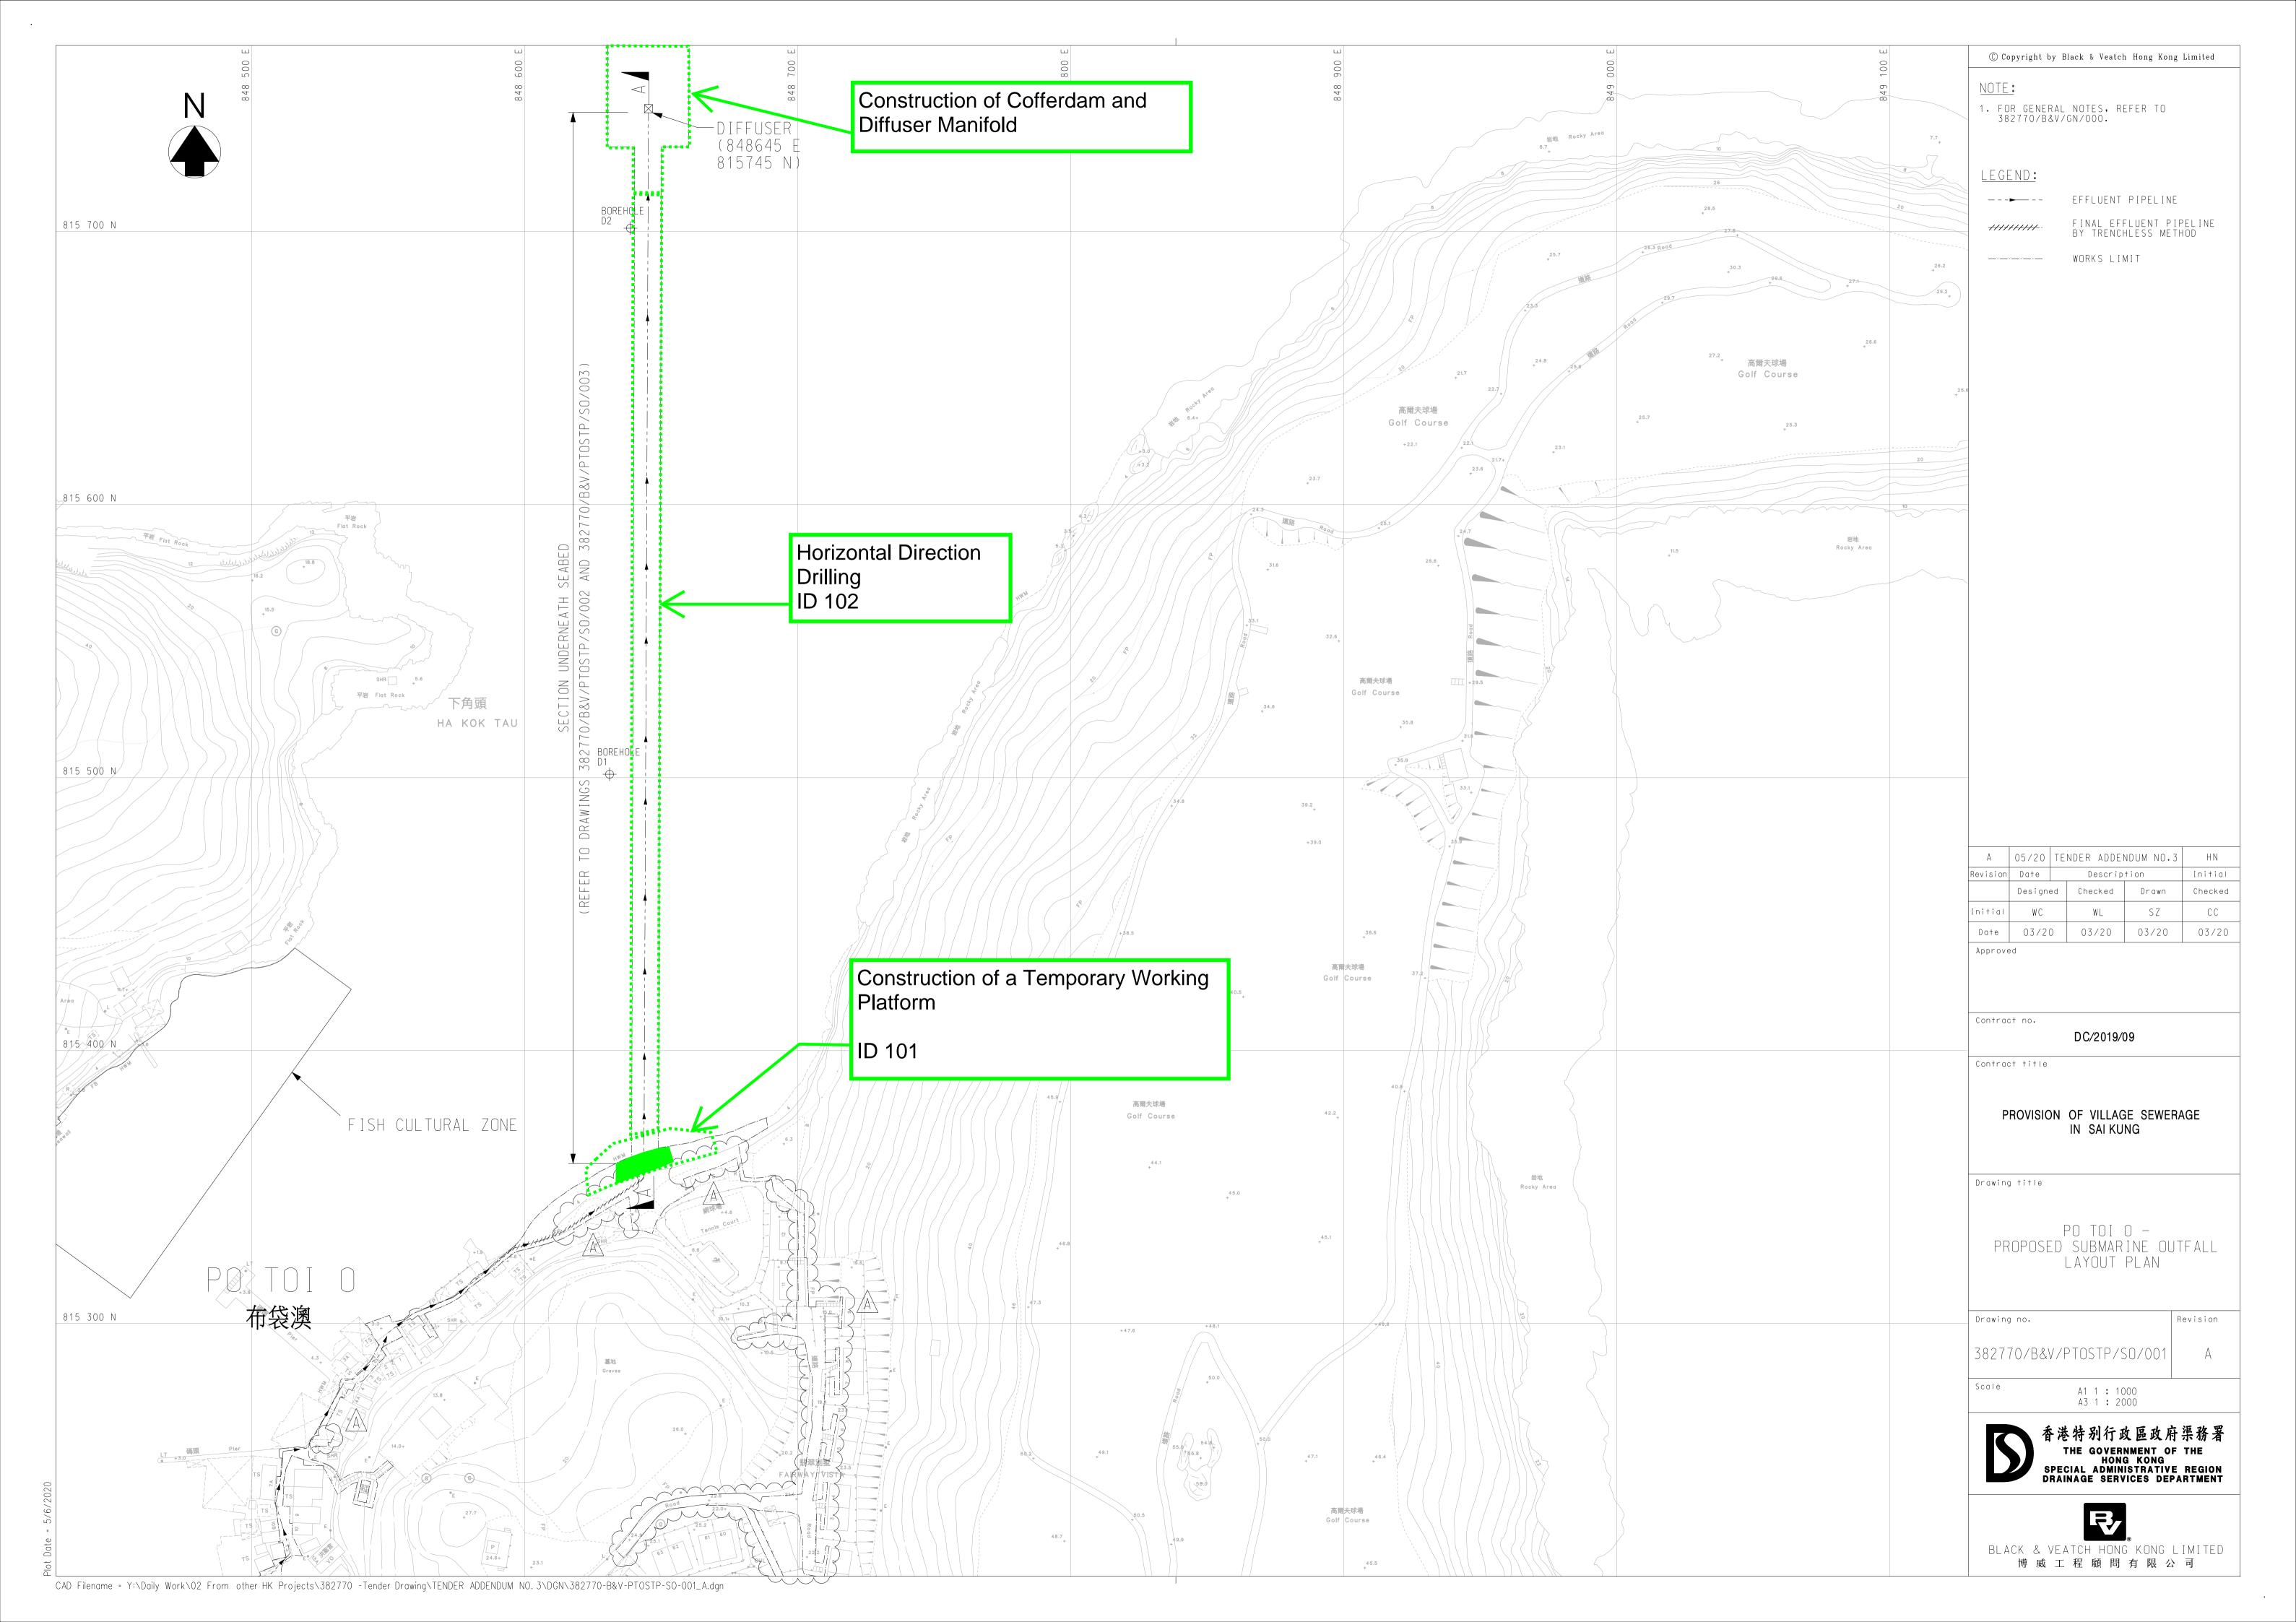

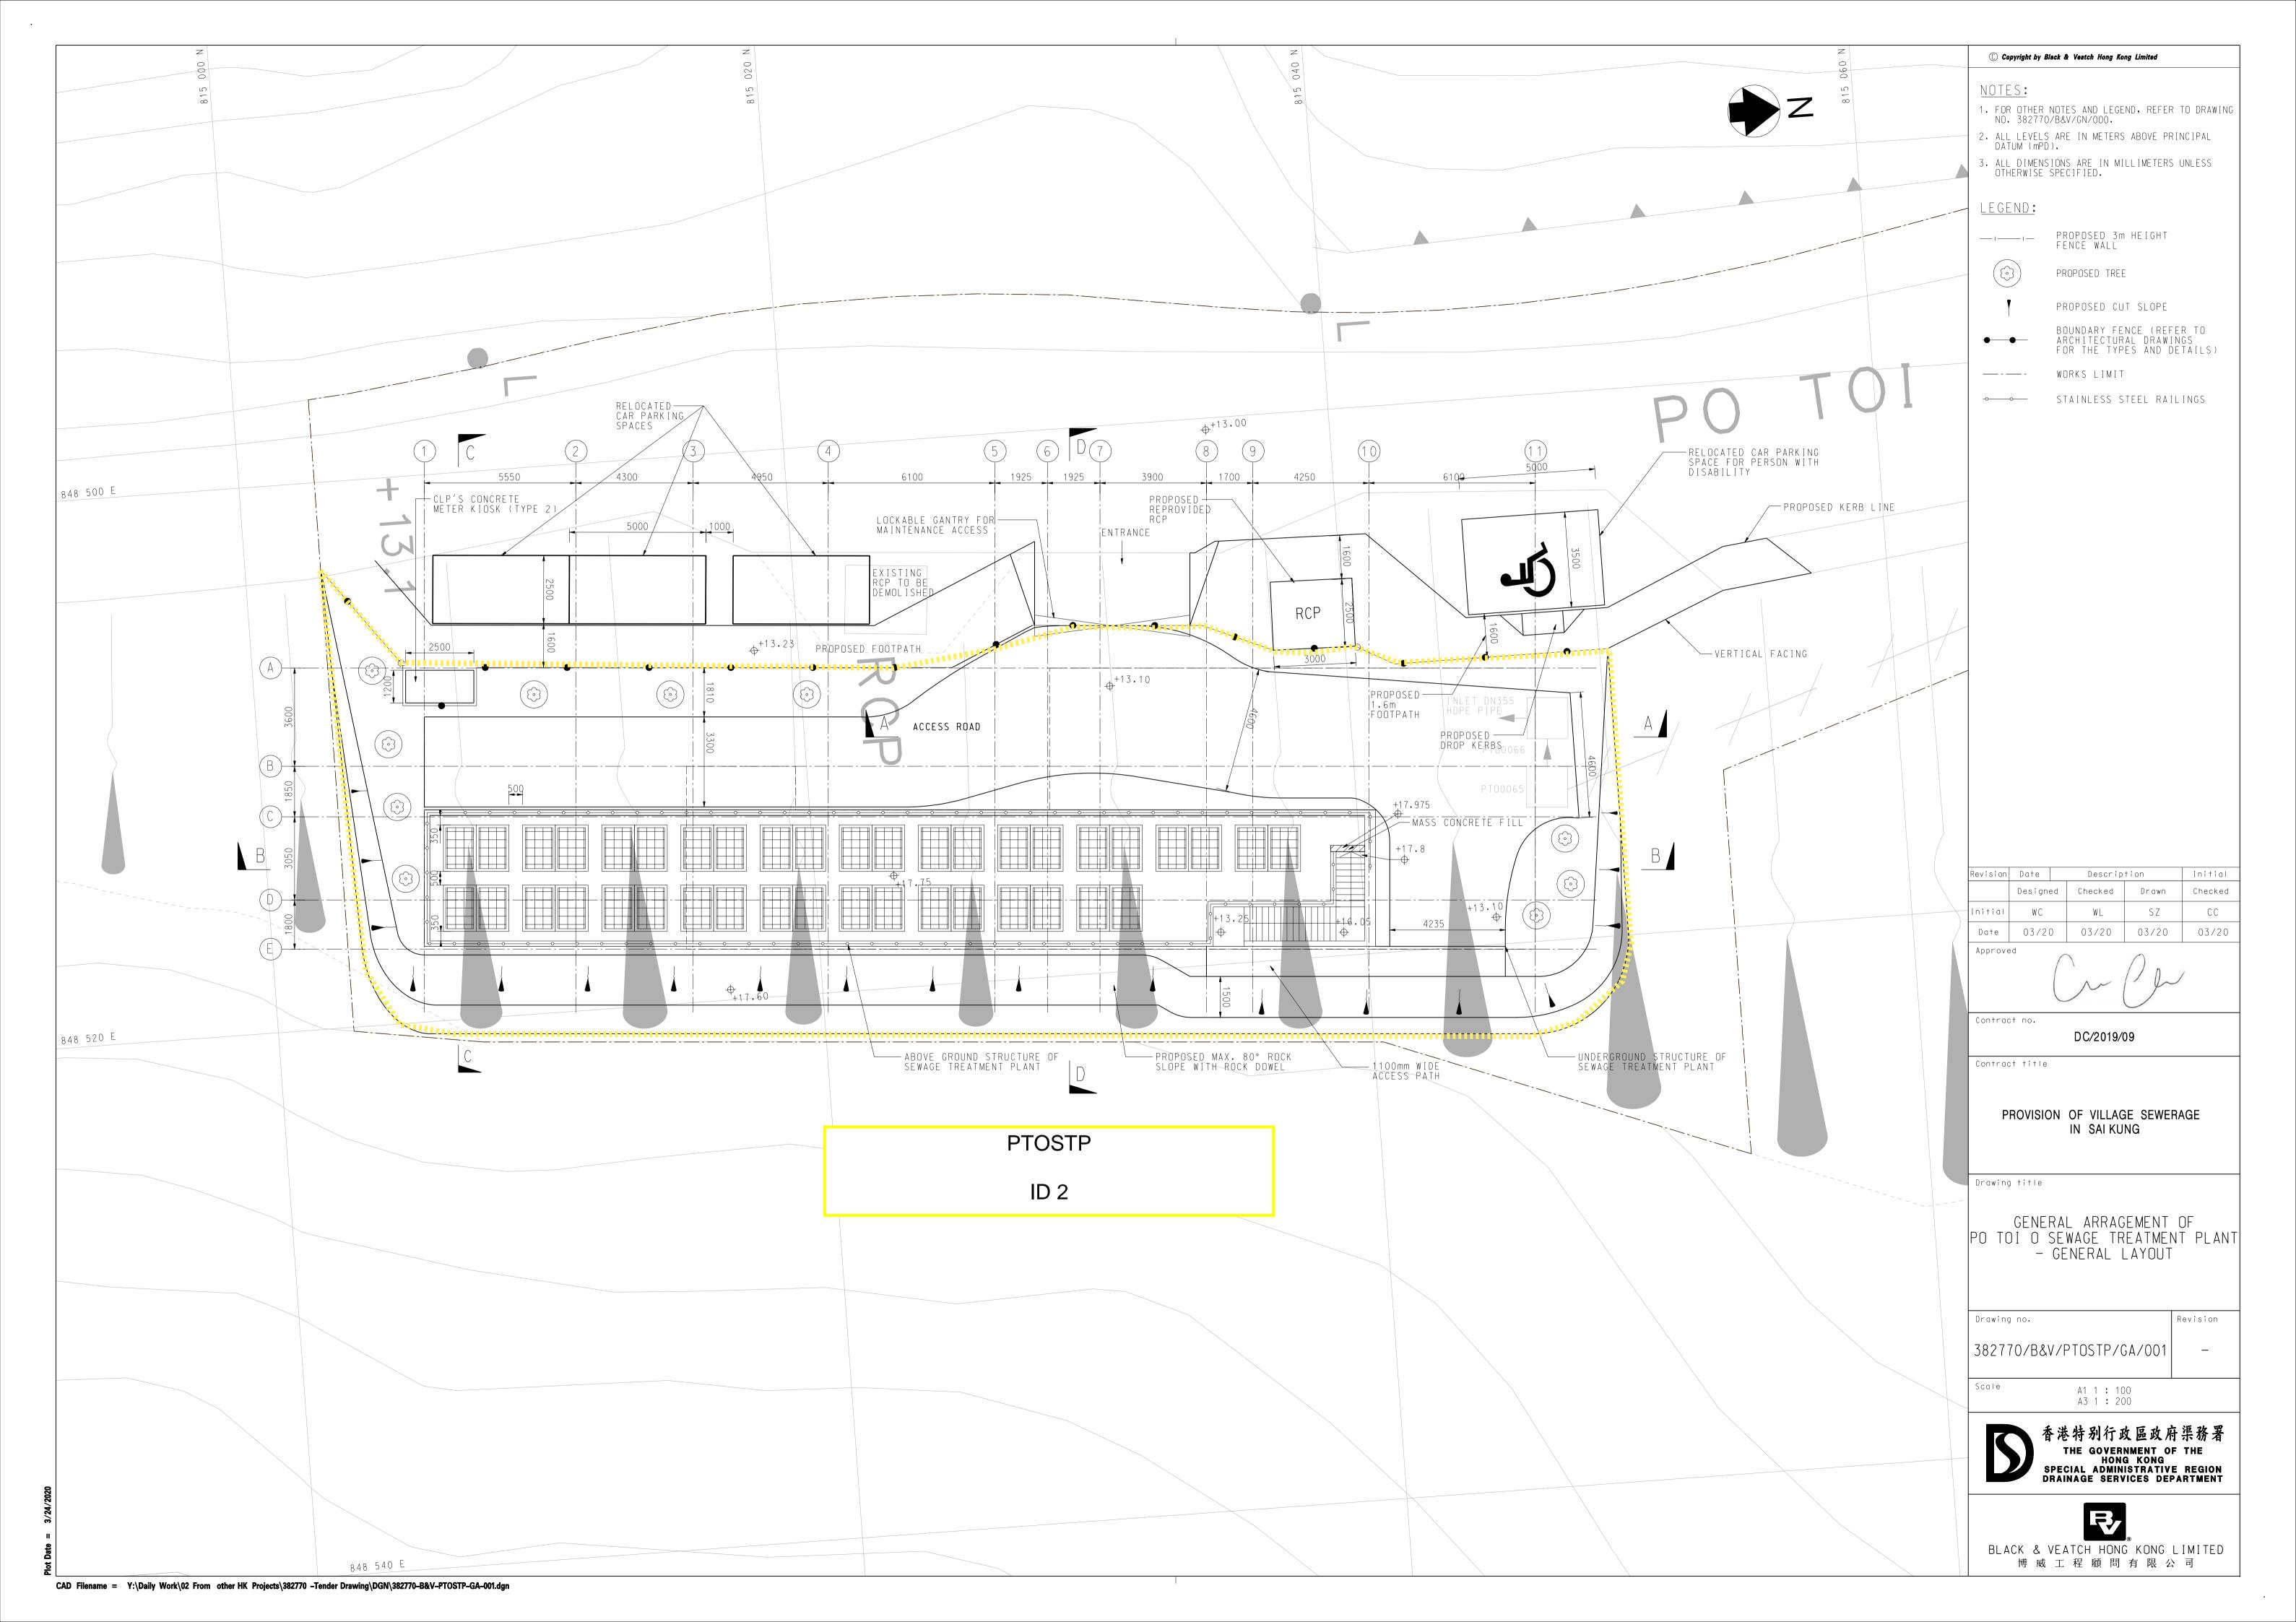





Proposed Air Quality and Nosie Monitoring Stations Locations

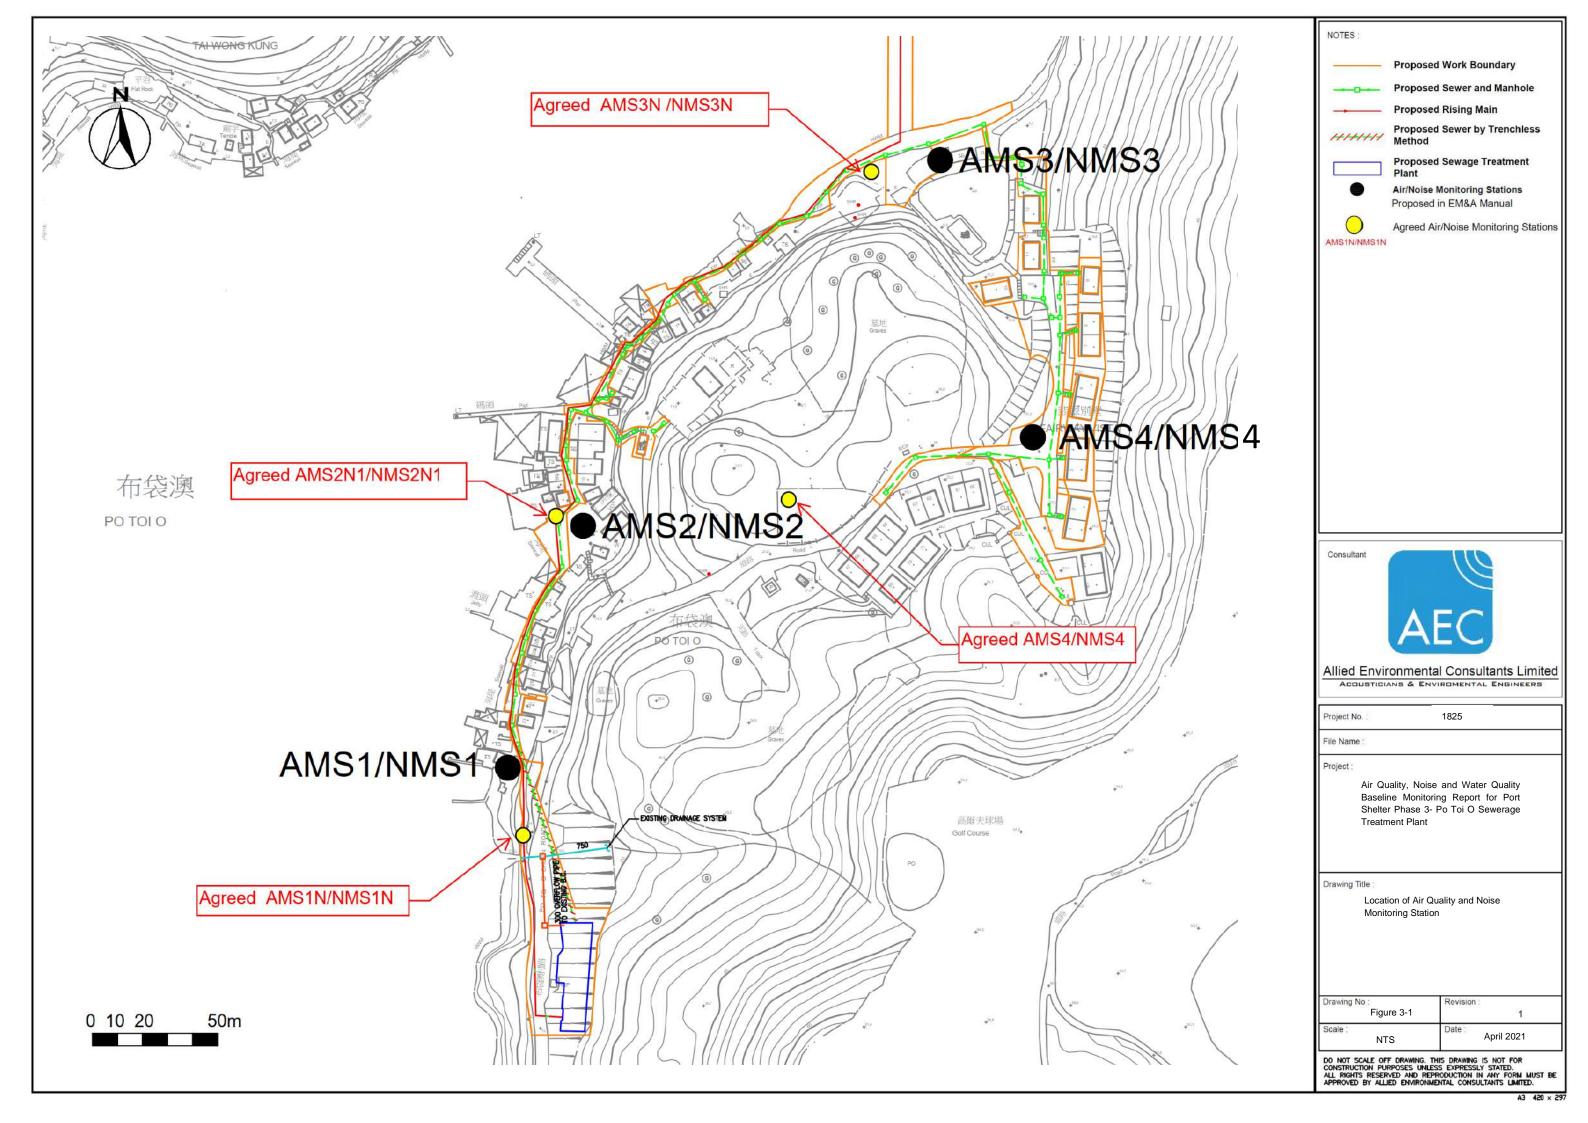






Locations of Water Quality Impact Monitoring Stations

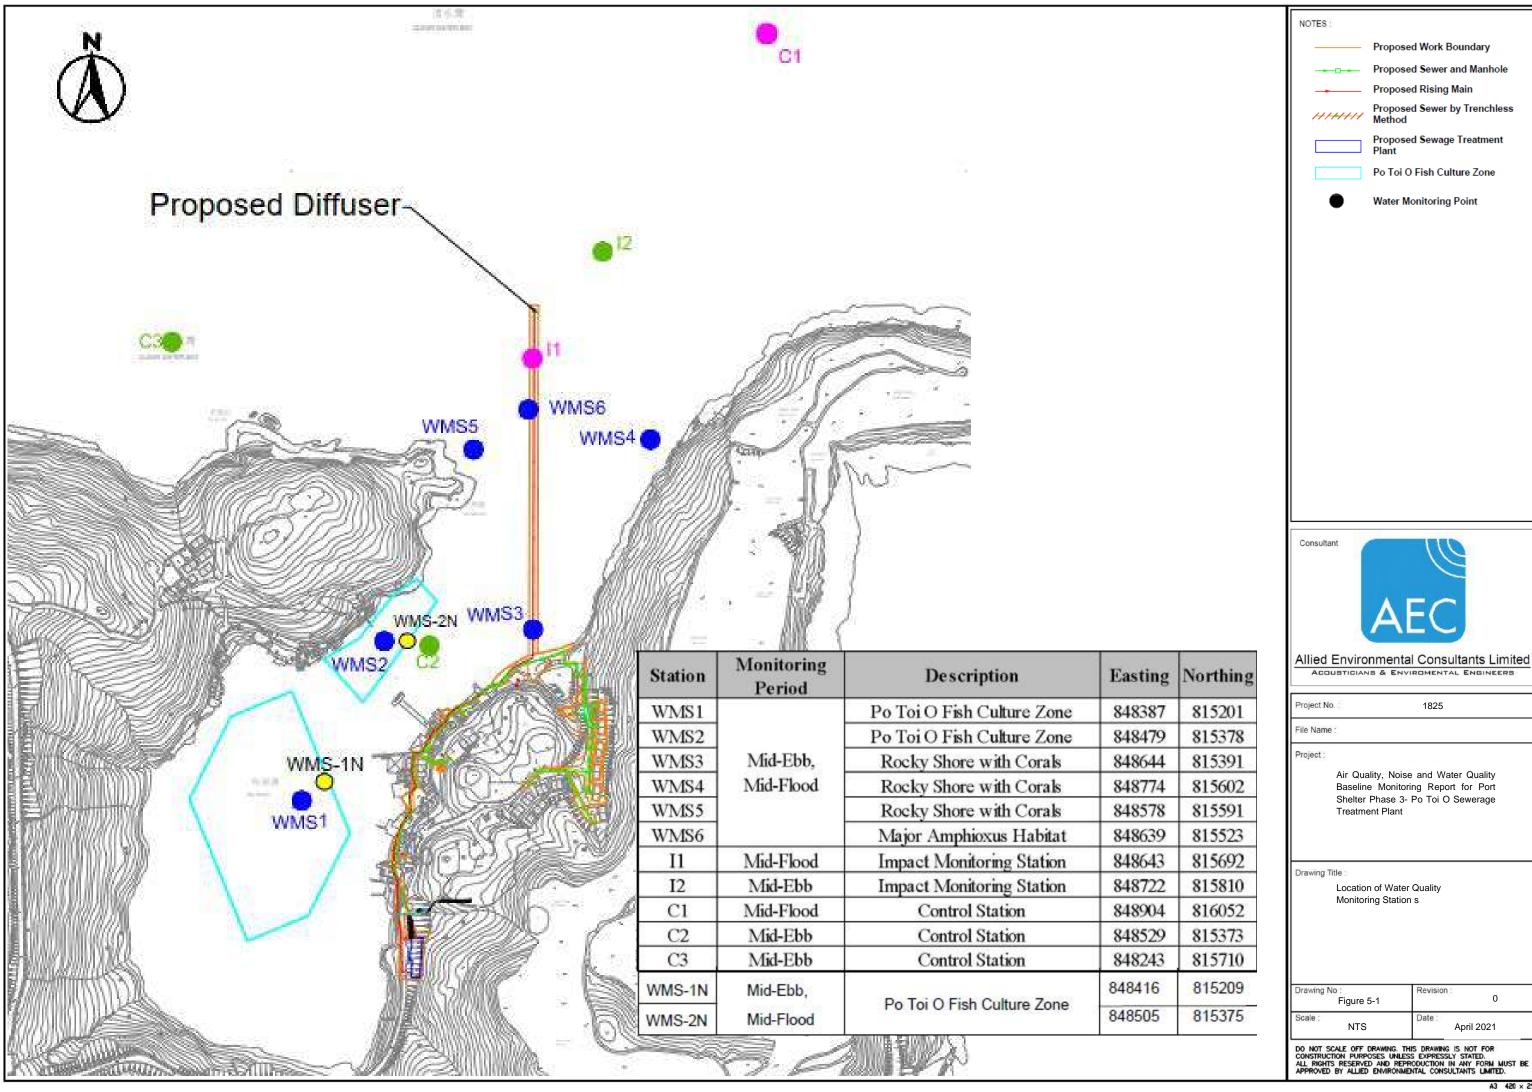

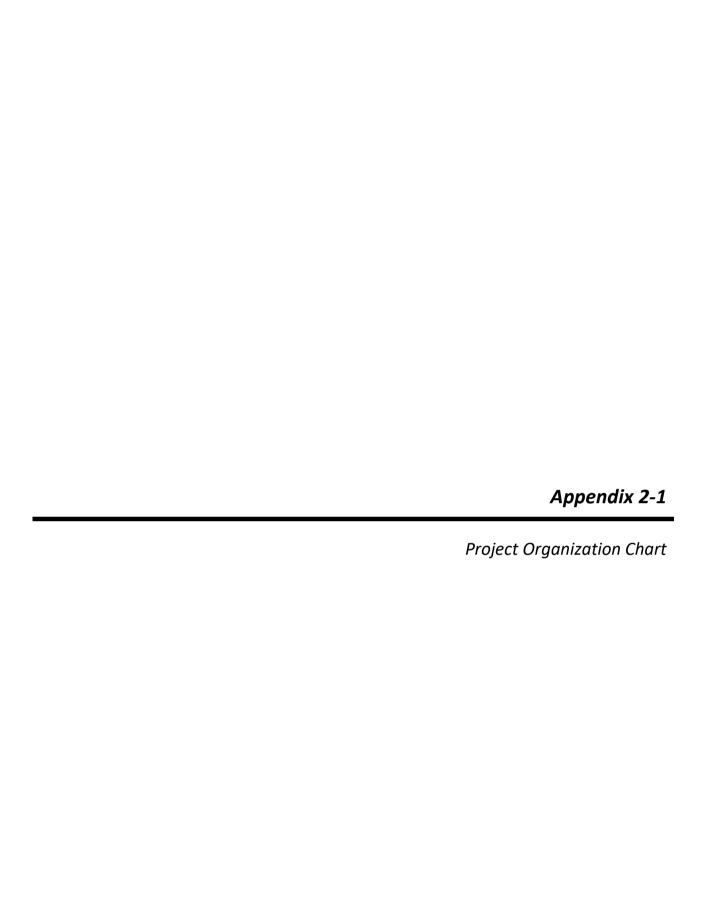


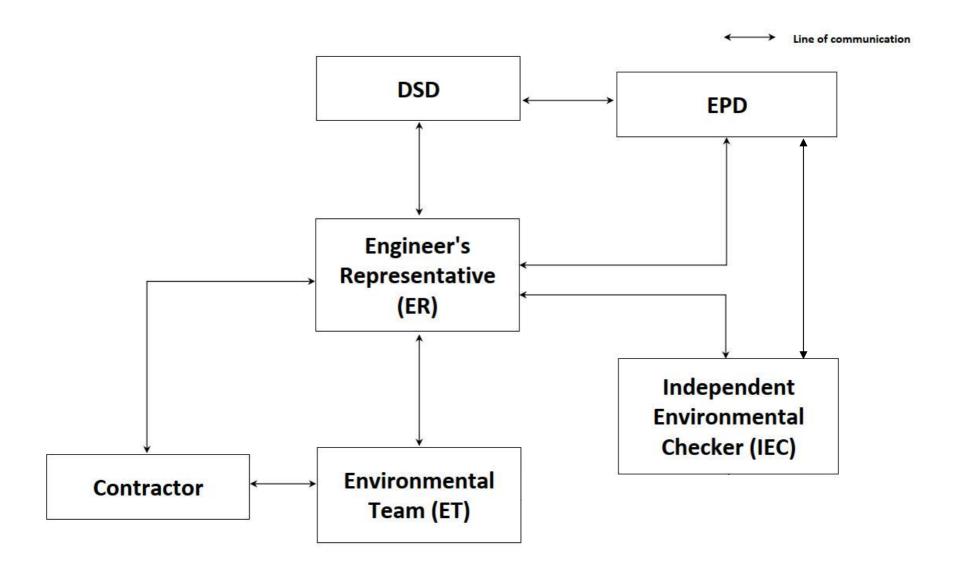



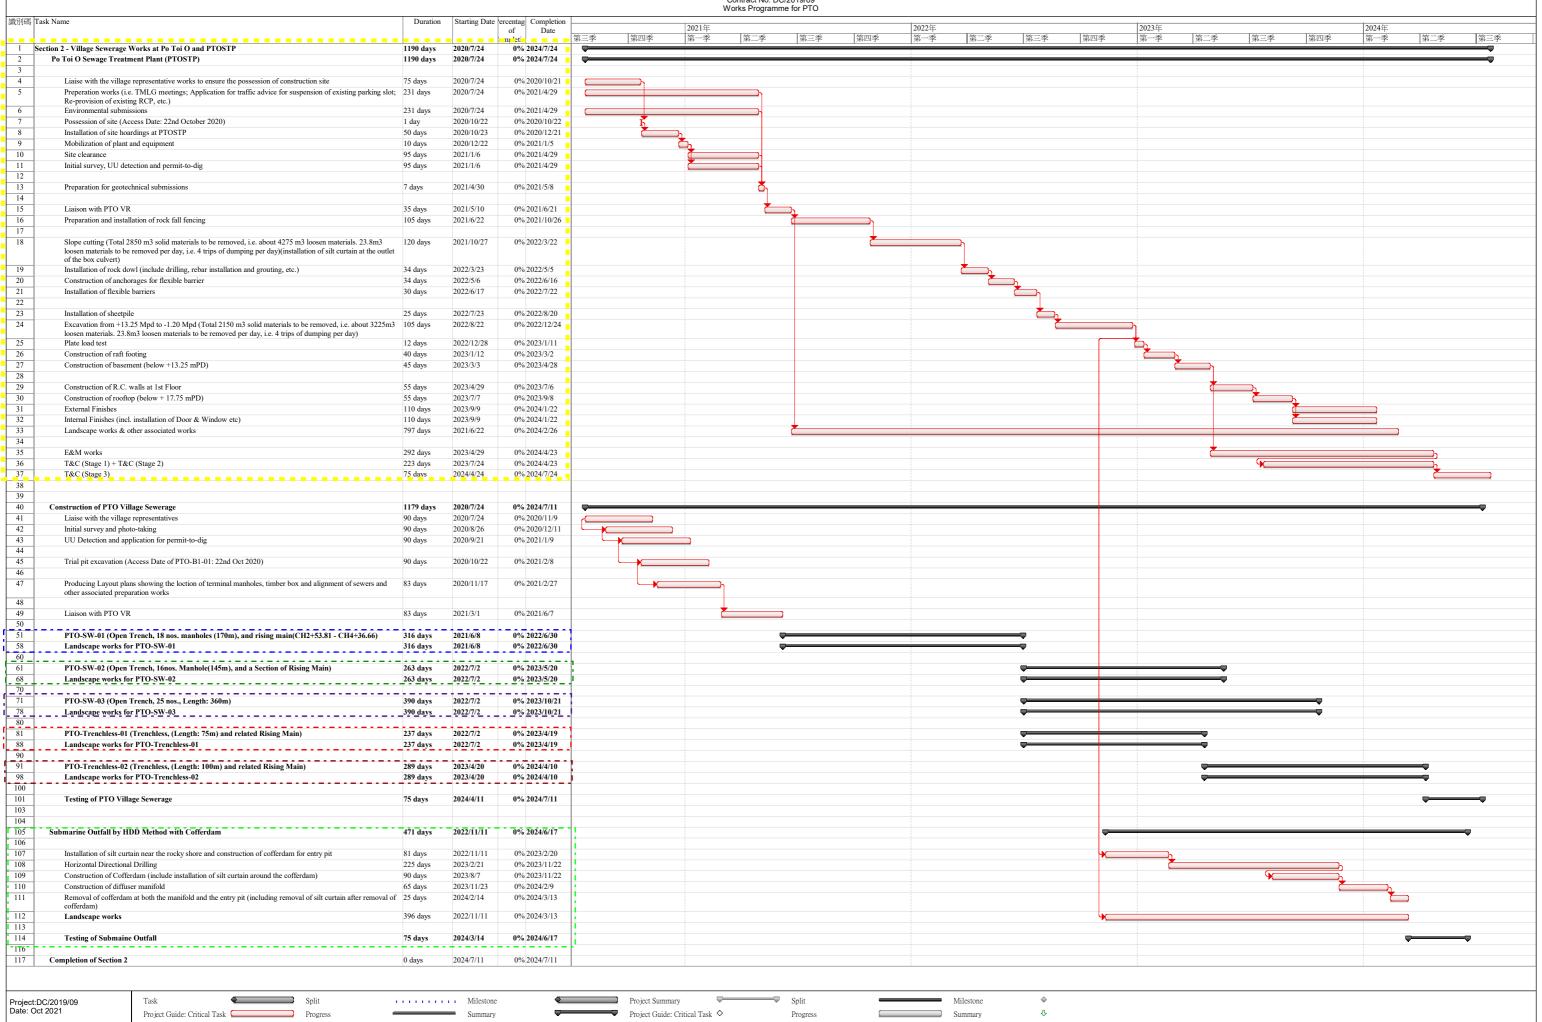

Page 1



Appendix 3-1 Daily Extract of Meteorological Observations, April 2022

				Hong Kong (	Observatory				King's Park	Waglan Isla	and^
Day	Mean Pressure (hPa)	Absolute Daily		ture Absolute Daily Min (deg. C)	Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Mean Amount of Cloud (%)	Total Rainfall (mm)	Total Bright Sunshine (hours)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
1	1020.5	22.0	19.0	15.7	16.0	83	90	0.5	-	070	43.1
2	1023.2	16.1	15.0	13.7	10.7	76	88	1.3	-	010	40.3
3	1022.1	23.9	18.7	15.2	8.8	54	32	-	9.5	010	29.4
4	1022.2	25.6	20.1	16.8	9.9	53	5	-	11.1	070	35.6
5	1020.0	26.9	21.3	18.1	14.1	64	17	-	11.0	070	17.3
6	1017.6	26.2	22.3	19.4	16.3	70	15	-	10.9	030	12.9
7	1016.8	26.7	22.8	20.0	16.4	68	19	-	10.7	040	15.9
8	1015.7	29.1	23.6	20.5	11.9	50	8	-	10.9	060	16.1
9	1013.8	27.6	23.1	20.3	15.9	65	7	-	11.0	050	16.7
10	1012.4	28.5	23.8	20.5	17.0	67	13	-	11.1	050	13.5
11	1011.0	30.3	25.5	22.6	20.4	74	49	-	6.2	360	5.3
12	1008.9	30.2	25.7	23.0	21.2	77	31	-	9.6	130	8.9
13	1006.8	28.1	25.3	23.9	21.9	81	70	Trace	4.5	230	10.0
14	1008.4	27.8	25.5	23.0	19.4	69	36	-	10.1	160	9.9
15	1012.1	27.6	24.3	22.8	18.1	69	52	Trace	10.6	080	37.9
16	1013.7	22.9	21.8	21.2	16.8	73	87	Trace	1.1	080	45.6
17	1015.6	24.9	21.4	19.2	16.1	72	85	0.4	2.9	080	37.1


Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

				Hong Kong (	Observatory				King's Park	King's Park Waglan Island^	
Day	Mean Pressure (hPa)	Absolute Daily	Tempera Mean (deg. C)	Absolute Daily	Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Mean Amount of Cloud (%)	Total Rainfall (mm)	Total Bright Sunshine (hours)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
18	1016.7	23.2	21.7	20.9	17.2	76	88	Trace	0.1	060	24.3
19	1017.3	21.1	20.1	19.1	17.1	83	88	0.8	-	010	17.3
20	1015.4	25.6	21.9	19.8	17.2	75	86	-	4.9	070	15.6
21	1013.3	28.4	23.9	21.4	19.7	78	83	-	8.6	080	11.5
22	1012.3	27.2	24.8	23.4	22.0	84	87	-	2.5	050	9.8
23	1010.9	30.3	26.4	24.1	22.8	81	76	Trace	8.6	080	4.5
24	1009.3	30.9	27.2	24.9	23.2	79	80	-	6.0	140	8.1
25	1008.6	31.4	27.9	26.3	23.7	79	79	-	3.9	160	13.7
26	1008.3	29.8	27.7	26.2	23.8	80	88	-	2.1	170	10.8
27	1009.4	31.6	28.4	26.1	24.0	78	61	-	7.7	150	8.5
28	1010.8	31.6	28.4	26.8	24.4	79	60	-	6.1	090	10.9
29	1011.0	32.0	28.2	26.2	24.2	79	71	-	9.4	060	9.7
30	1012.3	26.8	25.4	24.3	22.7	85	83	0.5	-	080	28.3
Iean/Total	1013.9	27.1	23.7	21.5	18.4	73	58	3.5	191.1	080	18.9

<sup>^</sup>The prevailing wind direction is the wind direction most frequently observed during the period.

All data were recorded at the Hong Kong Observatory except sunshine duration which was recorded at King's Park and winds at Waglan Island. \*\*\* unavailable

Source: https://www.weather.gov.hk/wxinfo/pastwx/metob202204.htm

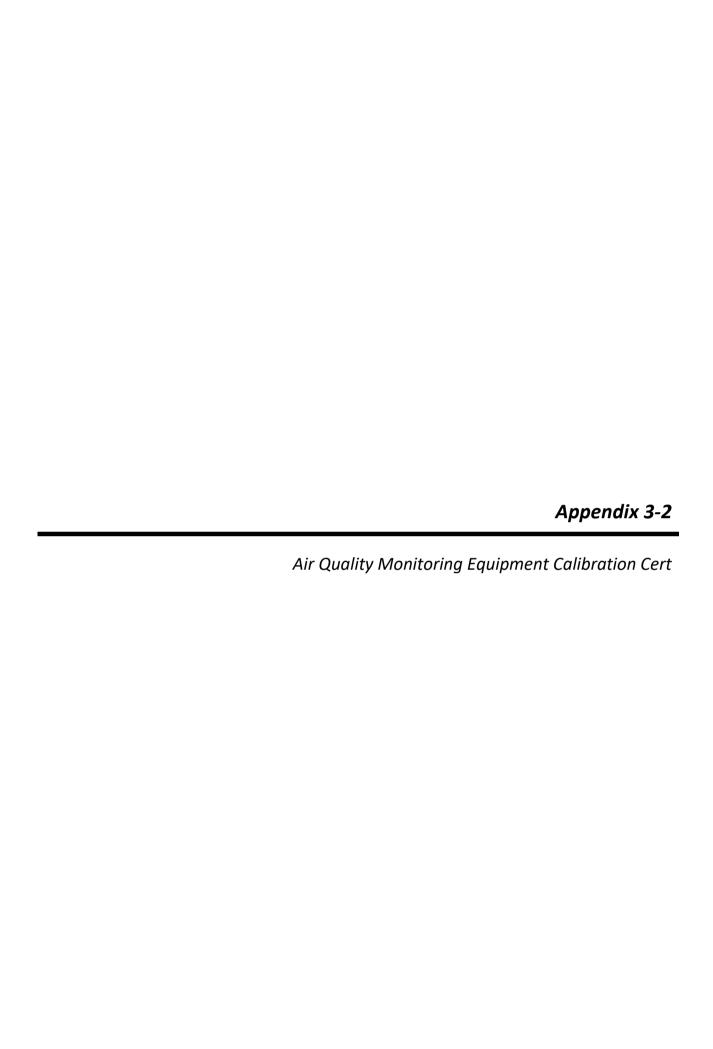



istrong Industrial Centre, I-36 Au Pui Wan Street, Fo Tan, Hong Kong

+852 2695 8318 +852 2695 3944

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 February 2022

Serial No.

014746 (ET/EA/001/06)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	28	<b>5</b> 5	81	148	196				
TSP (ug/m <sup>3</sup> )	42	88	131	232	330				
High Volume Air Sampler Serial No.: 1180	olume Air Sampler Serial No.: 1180 Calibration Due Date: 10 March 2022								

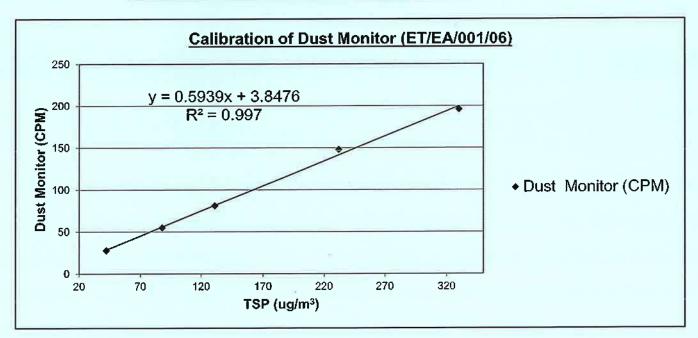

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after

five-point calibration.

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

Ē

Ll, Lok Yin

(Senior Technician)

Checked by 3

(Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +652 2695 8318 E: ett@ets-testconsult.com W: www.els-testconsult.com

#### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

: 25 February 2022

Serial No.

155331 (ET/EA/001/09)

Calibration Due Date

: 24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	55	104	162	215	286			
TSP (ug/m <sup>3</sup> )	60	108	186	241	323			
High Volume Air Sampler Serial No.: 9795	Calibrati	Calibration Due Date: 09 March 2022						

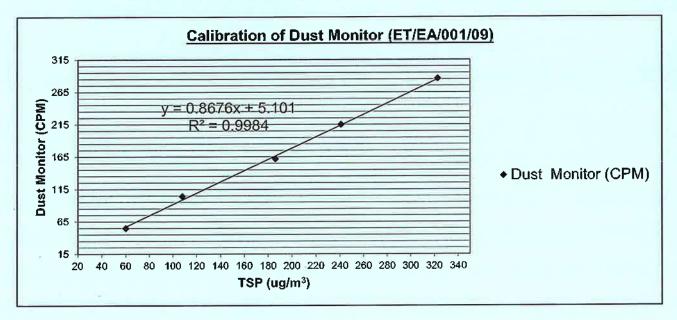

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

n

LI, Lok Yin

(Senior Technician)

Checked by

Guy, Keng Ping Ki Laboratory Manager)



34-36 Au Pui Wan Stre Fo Tan. Hong Kong

T: +852 2695 8318 E: eti@ets-testconsult.com www.ets-testconsuit.com

### **Internal Calibration Report**

of **Dust Monitor** 

Manufacturer: SIBATA (LD-3B)

Date of Calibration

25 February 2022

Serial No.

597340 (ET/EA/001/14)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	23	54	88	132	177			
TSP (ug/m³)	31	70	117	193	252			
High Volume Air Sampler, Serial No.: 1174	Calibration Due Date: 10 March 2022							

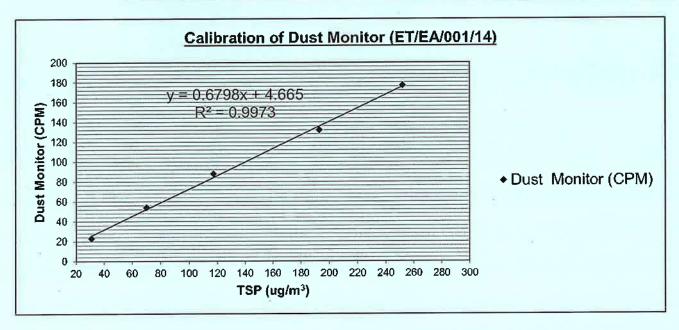

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by ;

12

LI, Lok Yin

(Senior Technician)

Checked by :

Guy Kong Ping (Laboratory Manager)



Veristrong Industrial Centre, 34-36 Au Pui Wan Street,

F: +852 2695 3944

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

25 February 2022

Serial No.

597227 (ET/EA/001/15)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	27	44	77	110	155		
TSP (ug/m <sup>3</sup> )	40	74	135	203	272		
High Volume Air Sampler Serial No : 2483	Calibration Due Date: 10 March 2022						

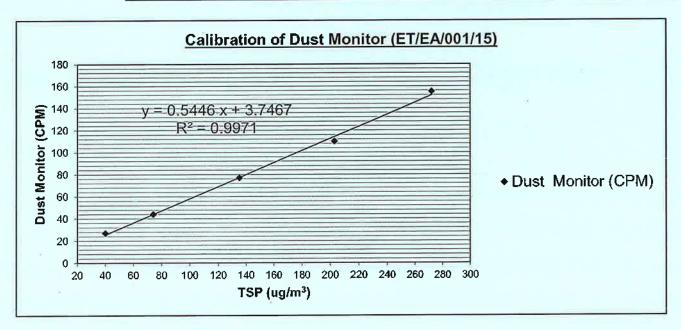

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by

20

Checked by

(Laboratory Manager)

LI, Lok Yin (Senior Technician)



istrong Industrial Centre, I-36 Au Pui Wan Street, Fo Tan, Hong Kong

+852 2695 8318 +852 2695 3944

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 February 2022

Serial No.

014746 (ET/EA/001/06)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	28	55	81	148	196				
TSP (ug/m <sup>3</sup> )	42	88	131	232	330				
High Volume Air Sampler Serial No.: 1180	olume Air Sampler Serial No.: 1180 Calibration Due Date: 10 March 2022								

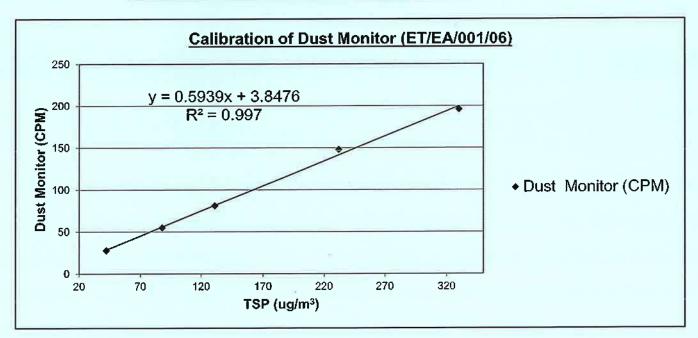

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after

five-point calibration.

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

Ē

Ll, Lok Yin

(Senior Technician)

Checked by 3

(Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +652 2695 8318 E: ett@ets-testconsult.com W: www.els-testconsult.com

#### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

: 25 February 2022

Serial No.

155331 (ET/EA/001/09)

Calibration Due Date

: 24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	55	104	162	215	286			
TSP (ug/m <sup>3</sup> )	60	108	186	241	323			
High Volume Air Sampler Serial No.: 9795	Calibrati	Calibration Due Date: 09 March 2022						

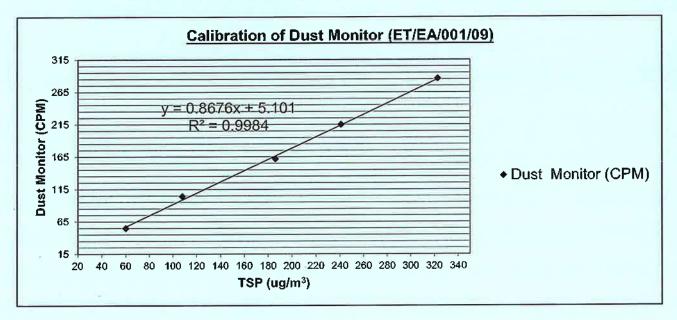

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

n

LI, Lok Yin

(Senior Technician)

Checked by

Guy, Keng Ping Ki Laboratory Manager)



34-36 Au Pui Wan Stre Fo Tan. Hong Kong

T: +852 2695 8318 E: eti@ets-testconsult.com www.ets-testconsuit.com

### **Internal Calibration Report**

of **Dust Monitor** 

Manufacturer: SIBATA (LD-3B)

Date of Calibration

25 February 2022

Serial No.

597340 (ET/EA/001/14)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	23	54	88	132	177			
TSP (ug/m³)	31	70	117	193	252			
High Volume Air Sampler, Serial No.: 1174	Calibration Due Date: 10 March 2022							

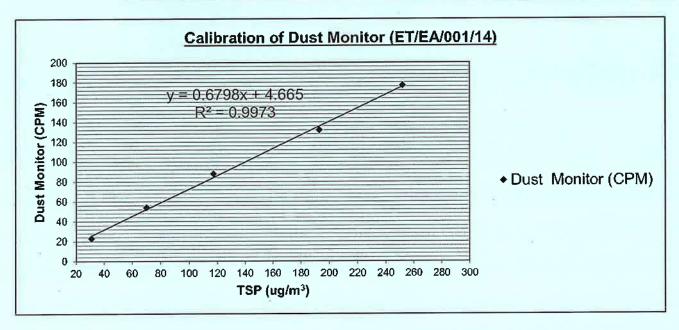

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by ;

12

LI, Lok Yin

(Senior Technician)

Checked by :

Guy Kong Ping (Laboratory Manager)



Veristrong Industrial Centre, 34-36 Au Pui Wan Street,

F: +852 2695 3944

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

25 February 2022

Serial No.

597227 (ET/EA/001/15)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	27	44	77	110	155		
TSP (ug/m <sup>3</sup> )	40	74	135	203	272		
High Volume Air Sampler Serial No : 2483	Calibration Due Date: 10 March 2022						

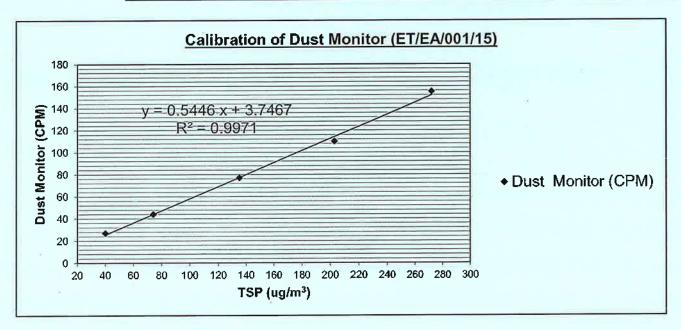

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by

20

Checked by

(Laboratory Manager)

LI, Lok Yin (Senior Technician)



8/F Block B Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 ell@ets-testconsult.com www.ets-testconsult.com

### **Internal Calibration Report** of

### **Dust Monitor**

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

014746 (ET/EA/001/06)

Calibration Due Date:

24 June 2022


Method

: Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	25	50	77	134	178			
TSP (ug/m <sup>3</sup> )	46	92	139	227	315			
High Volume Air Sampler, Serial No.: 1180	Calibration Due Date: 07 May 2022							

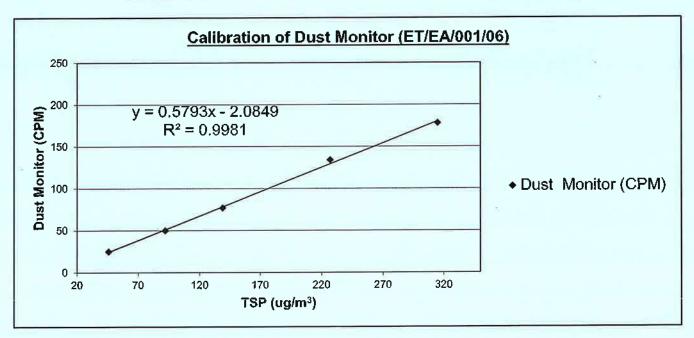

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after

five-point calibration.

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by :

20

Ll. Lok Yin

(Senior Technician)

Checked by :

Guy, Kong Ping. (Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan. Hong Kong

T: +652 2695 8316 E: eti@ets-testconsult.com ww.ets-testconsult.com

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

155331 (ET/EA/001/09)

Calibration Due Date

: 24 June 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

•	Dust Monitor (CPM)	50	102	159	206	271		
	TSP (ug/m <sup>3</sup> )	64	113	182	247	315		
	High Volume Air Sampler Serial No.: 9795	Calibration Due Date: 08 May 2022						

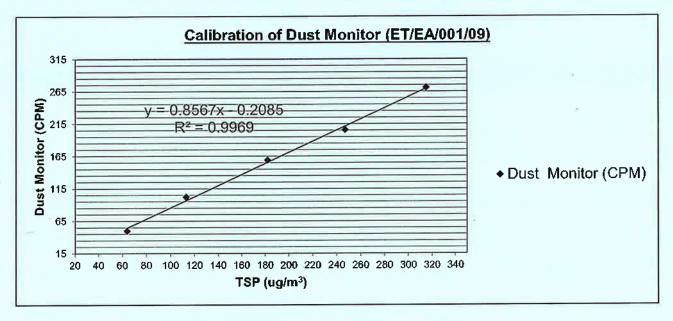

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

20

Ll, Lok Yin

(Senior Technician)

Checked by

(Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 E: etl@ets-testconsuft.com W: www.ets-testconsult.com

#### Internal Calibration Report

of

### **Dust Monitor**

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

597340 (ET/EA/001/14)

Calibration Due Date:

24 June 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

	Dust Monitor (CPM)		57	93	142	189
ĺ	TSP (ug/m³)	37	75	128	188	263
	High Volume Air Sampler Serial No.: 1174	Calibratio	n Due Da	ite: 07 M	ay 2022	

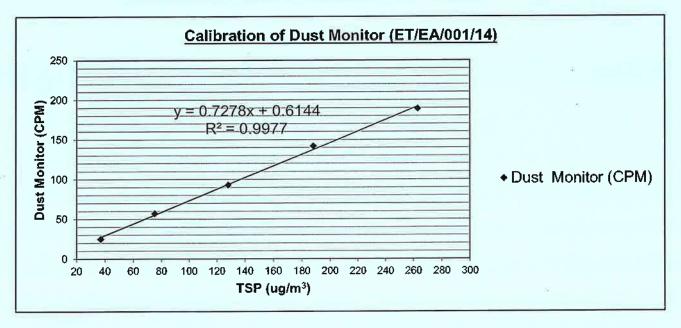

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by :

12

LI, Lok Yin

(Senior Technician)

Checked by

Guy, Kong Ping Ki (Laboratory Manager)



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street,

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

597227 (ET/EA/001/15)

Calibration Due Date:

24 June 2022


Method

: Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	22	45	75	103	144
TSP (ug/m³)	43	79	130	189	261
High Volume Air Sampler Serial No.: 2483 Calibration Due Date: 07 May 2022					

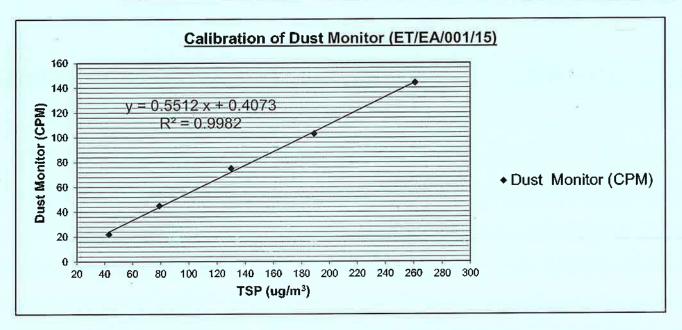

Acceptance Criteria :

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.


Checked by :

(Laboratory Manager)

Calibrated by

LI, Lok Yin

(Senior Technician)

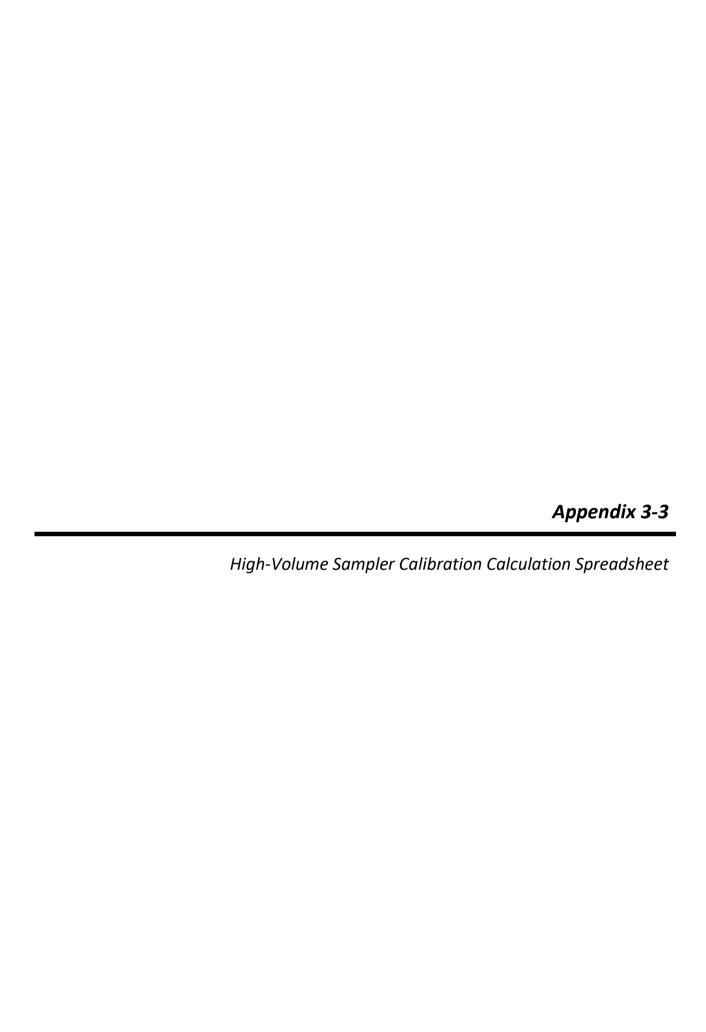



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

#### **TEST REPORT**

### **Calibration Report** of High Volume Air Sampler

Manufacturer

Graseby GMW

**Date of Calibration** 

11 January 2022

Serial No.

1180 (ET/EA/003/04)

Calibration Due Date

10 March 2022

Method


Based on Operations Manual for the 5-point calibration using standard calibration kit

manufactured by Tisch TE-5025 A

Results

Flow recorder reading (cfm)			56	50	43	36	26
Qstd (Actual flow	rate, m³/min)		1.69	1.54	1.35	1.09	0.84
Pressure:	765.06	mm Hg		Temp.:	289	K	

### Sampler 1180 Calibration Curve Site: Tuen Mun (TM-RA2)

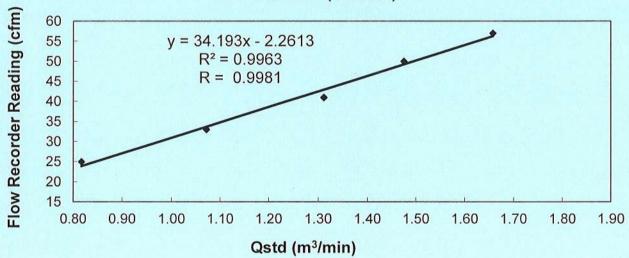

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable \* for use.

Calibrated by:

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com www.ets-testconsult.com

### TEST REPORT

### **Calibration Report High Volume Air Sampler**

Manufacturer

Graseby GMW

Date of Calibration

11 January 2022

Serial No.

1174 (ET / EA / 003 / 08)

Calibration Due Date

10 March 2022

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm)	57	47	42	33	27
Qstd (Actual flow rate, m³/min)	1.58	1.35	1.19	0.98	0.79
Pressure:	765.06 mm Hg	Temp.:	289	K	

### Sampler 1174 Calibration Curve Site: Tuen Mun CWSF (TM1a)

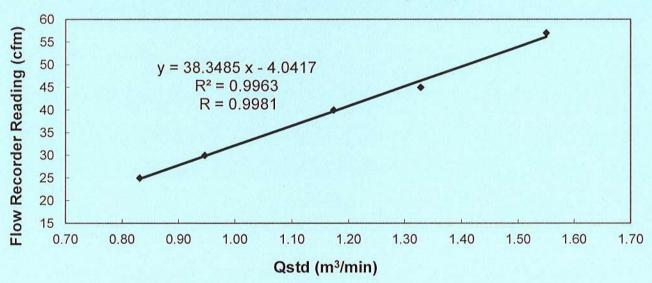

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by:

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

### TEST REPORT

### Calibration Report of **High Volume Air Sampler**

Manufacturer

Graseby 105

Date of Calibration

10 January 2022

Serial No.

9795 (ET/EA/003/18)

Calibration Due Date

09 March 2022

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the

**Operations Manual** 

Results

Flow recorder reading (cfm)		50	47	36	31	25
Qstd (Actual flow r	rate, m³/min)	1.70	1.54	1.28	1.04	0.82
Pressure: 763.56 mm Hg			Temp.:	291	K	

### Sampler 9795 Calibration Curve Site: Tseung Kwan O 137 (TKO-A1)

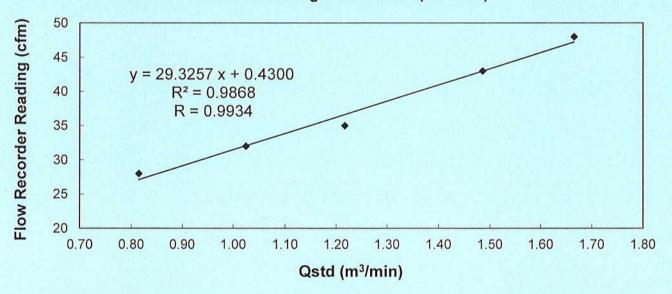

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by:

LIAO, Yun Chao (Technician)

Checked by :

LAU, Chi Leung

(Environmental Team Leader)



**ETS-TESTCONSULT LTD.** 

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

### TEST REPORT

### Calibration Report High Volume Air Sampler

Manufacturer

Graseby GMW

Date of Calibration

11 January 2022

Serial No.

2483 (ET / EA / 003 / 26)

Calibration Due Date :

10 March 2022

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm)  Qstd (Actual flow rate, m³/min)		54	46	43	35	31
		1.59	1.34	1.17	0.92	0.79
Pressure: 765.06 mm Hg			Temp.:	289	K	

### Sampler 2483 Calibration Curve Site: Tuen Mun CWSF (TM2)

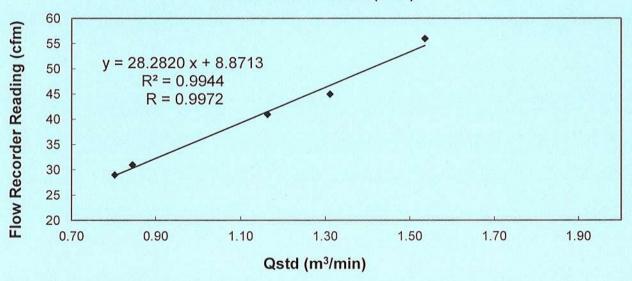

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by:

MAK, Kei Wai

(Assistant Supervisor)

Checked by :

LAU, Chi Leung

(Environmental Team Leader)



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

#### TEST REPORT

### Calibration Report **High Volume Air Sampler**

Manufacturer

Graseby GMW

Date of Calibration

08 March 2022

Serial No.

1180 (ET/EA/003/04)

Calibration Due Date

07 May 2022

Method


Based on Operations Manual for the 5-point calibration using standard calibration kit

manufactured by Tisch TE-5025 A

Results

Flow recorder reading (cfm)  Qstd (Actual flow rate, m³/min)		55	51	44	35	27	
		1.67	1.52	1.34	1.09	0.85	
Pressure:	763.56	mm Hg		Temp.:	294	K	

### Sampler 1180 Calibration Curve Site: Tuen Mun (TM-RA2)

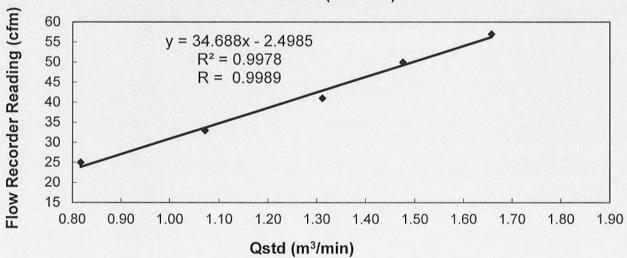

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable \* for use.

Calibrated by:

Chan Ching-Fung (Technician)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

#### TEST REPORT

# Calibration Report of High Volume Air Sampler

Manufacturer

Graseby GMW

Date of Calibration

08 March 2022

Serial No.

1174 (ET / EA / 003 / 08)

Calibration Due Date

07 May 2022

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm)	58	48	41	32	26
Qstd (Actual flow rate, m³/min)	1.57	1.35	1.17	0.99	0.80
Pressure :	763.56 mm Hg	Temp. :	294	K	

### Sampler 1174 Calibration Curve Site: Tuen Mun CWSF (TM1a)

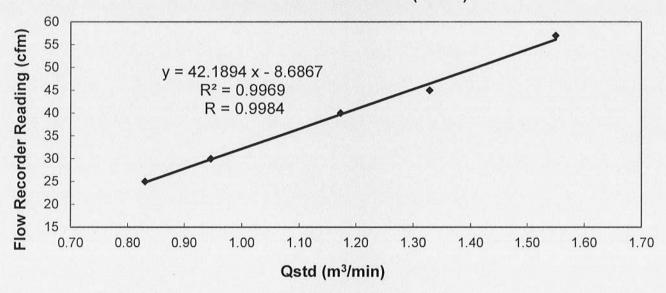

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by:

Chan Ching-Fung (Technician) Checked by :

LAU, Chi Leung

(Environmental Team Leader)



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 W: www.ets-testconsult.com

### TEST REPORT

### Calibration Report of High Volume Air Sampler

Manufacturer

Graseby 105

Date of Calibration

09 March 2022

Serial No.

9795 (ET/EA/003/18)

Calibration Due Date

08 May 2022

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the

**Operations Manual** 

Results

Flow recorder reading (cfm)  Qstd (Actual flow rate, m³/min)		51 1.70	46	37	32	0.83
			1.52	1.28	1.04	
Pressure: 762.81 mm Hg			Temp. :	295	К	

### Sampler 9795 Calibration Curve Site: Tseung Kwan O 137 (TKO-A1)

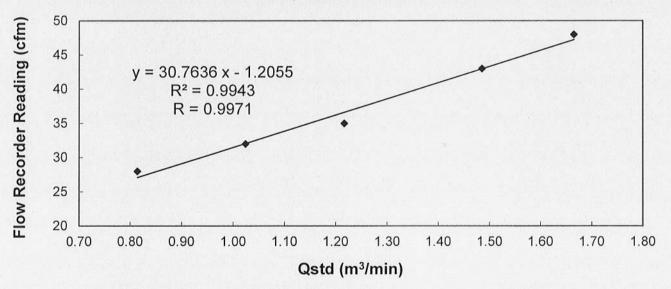

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by:

Chan Ching-Fung (Technician)

Checked by :

LAU, Chi Leung

(Environmental Team Leader)



### **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

### TEST REPORT

## Calibration Report of High Volume Air Sampler

Manufacturer

Graseby GMW

Date of Calibration

08 March 2022

Serial No.

2483 (ET / EA / 003 / 26)

Calibration Due Date :

07 May 2022

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm)		55	47	41	34	30
Qstd (Actual flow rate, m³/min)		1.59	1.33	1.17	0.93	0.77
Pressure :	763.56 mm	n Hg	Temp. :	294	K	

### Sampler 2483 Calibration Curve Site: Tuen Mun CWSF (TM2)

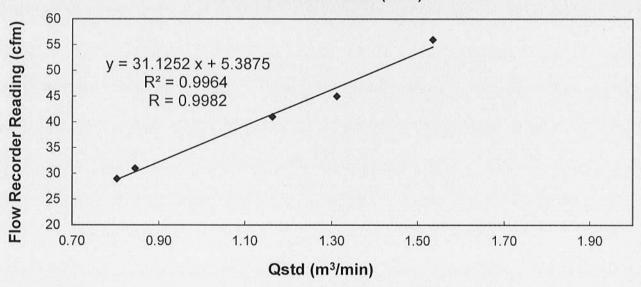

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by :

Chan Ching-Fung (Technician)

Checked by:

LAU, Chi Leung

(Environmental Team Leader)



RECALIBRATION
DUE DATE:

January 11, 2022

# Certificate of Calibration

**Calibration Certification Information** 

Cal. Date: January 11, 2021

Rootsmeter S/N: 438320

Ta: 297

°К

Operator: Jim Tisch

Pa: 750.1

mm Hg

Calibration Model #:

TE-5025A

Calibrator S/N: 3863

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4540	3.2	2.00
2	3	4	1	1.0210	6.4	4.00
3	5,	6	1	0.9090	8.0	5.00
4	7	8	1	0.8700	8.8	5.50
5	9	10	1	0.7190	12.8	8.00

	Data Tabulation								
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{fa}\right)}$		Qa	$\sqrt{\Delta H \left( Ta/Pa  ight)}$				
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)				
0.9860	0.6781	1.4073	0.9957	0.6848	0.8899				
0.9818	0.9616	1.9902	0.9915	0.9711	1.2585				
0.9797	1.0778	2.2251	0.9893	1.0884	1.4071				
0.9786	1.1249	2.3337	0.9883	1.1359	1.4757				
0.9733	1.3538	2.8146	0.9829	1,3671	1.7798				
	m= 2.08168			m=	1.30351				
QSTD[	b=	-0.00913	QA	b=	-0.00577				
	r=	0.99993	. 🚅	r=	0.99993				

Calculations						
$Vstd = \Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta) Va = \Delta Vol((Pa-\Delta P)/Pa)$						
Qstd=	Vstd/∆Time	Qa=	<b>Qa=</b> Va/ΔTime			
For subsequent flow rate calculations:						
Qstd= $1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$ Qa= $1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$						

Standard Conditions							
Tstd:	298.15 °K						
Pstd:	760 mm Hg						
	Кеу						
	r manometer reading (in H2O)						
	ter manometer reading (mm Hg)						
	solute temperature (°K)						
	rometric pressure (mm Hg)						
b: intercept							
m: slope							

#### RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

sch Environmental, Inc.


15 South Miami Avenue

llage of Cleves, OH 45002

www.tisch-env.com

TOLL FREE: (877)263-7610

FAX: (513)467-9009

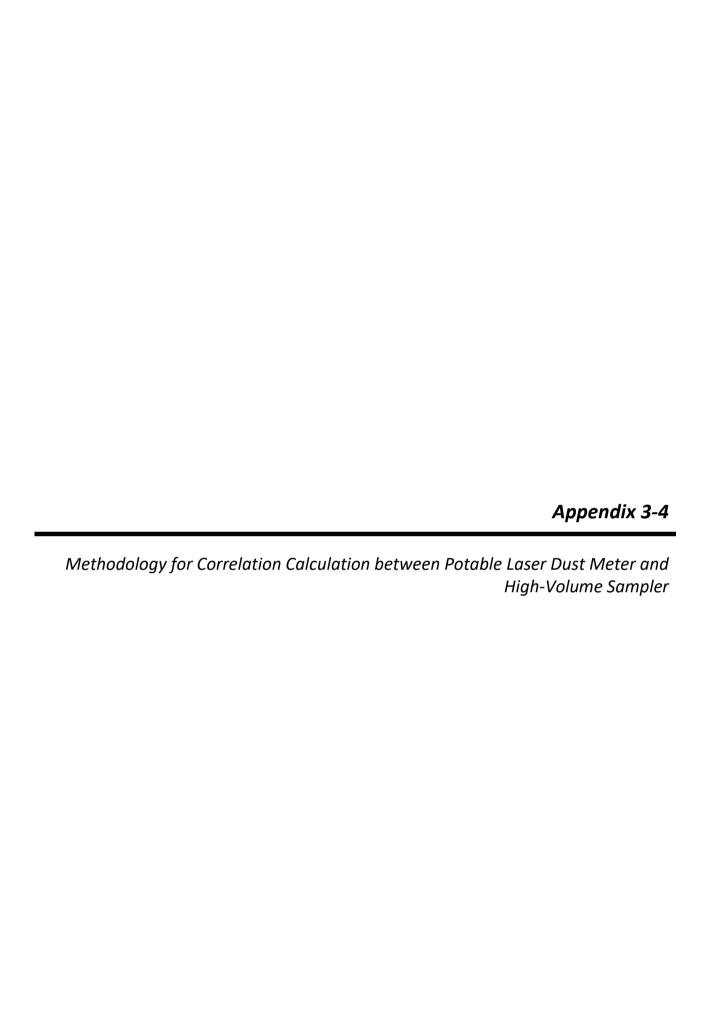

### Correlation between Portable laser dusty meter and Highvolume Sampler Methodology

#### 1.1. Correlation results between the direct reading meter and High-Volume Sampler

High - Volume Sampler Calibration

- 1.1.1. The specification, a sample of calibration certificate and certificate of comparison check with High volume sampler of the proposed air quality monitoring equipment listed in Table 2.1 are attached in appendix.
- 1.1.2. The High-Volume air sampler calibration procedure based on the requirement of manufacturer are shown below.
- (a) Disconnect the sampler motor from the mass flow controller and connect the motor to a stable AC power source.
- (b) Mount the calibrator orifice and top loading adapter plate to the sampler. A sampling filter is generally not used during this procedure. Tighten the top loading adapter hold down nuts securely to ensure that no air leaks are present.
- (c) Allow the sampler motor to warm up to its normal operating temperature
- (d) (approximately 10-15 minutes).
- (e) Conduct a leak test by covering the hole(s) on top of the orifice and pressure tap on the orifice with your hands. Listen for a high-pitched squealing sound made by escaping air. If this sound is heard, a leak is present and the top loading adapter hold-down nuts need to be re-tightened. If the sound is lower, the leak is near one of the other gaskets in the system. Avoid running the sampler for longer than 30 seconds at a time with the orifice blocked to avoid overheating the motor. Do not perform this leak test procedure with a manometer connected to the side tap on the calibration orifice or the blower motor. Liquid from the manometer could be drawn into the system and cause motor damage.
- (f) Connect one side of a water manometer to the pressure tap on the side of the orifice with a rubber vacuum tube. Leave the opposite side of the manometer open to the atmosphere. Note: Both valves on the manometer have to be open for the liquid to flow

freely. One side of the 'U' tube goes up the other goes down; add together for the "H2O reading.

- (g) A manometer must be held vertically to ensure accurate readings. Tapping the backside of the continuous flow recorder will help to center the pen and provide accurate readings. When using a variable orifice , five flow rates are achieved in this step by adjusting the knob on the variable orifice to five different positions and taking five different readings.
- (h) Record the ambient air temperature, the ambient barometric pressure, the sampler serial number, the orifice s/n, the orifice slope and intercept with date last certified, todays date, site location and the operators initials on the attached blank calibration sheet.
- (i) An example of a Lead (or TSP) Sampler Calibration Data Sheet has been attached with data filled in from a typical calibration. This includes the transfer standard orifice calibration relationship which was taken from the Orifice Calibration Worksheet that accompanies the calibrator orifice.

Disconnect the sampler motor from its power source and remove the orifice and top loading adapter plate. Re-connect the sampler motor to the electronic mass flow controller.

- 1.1.3. Since this calibration is for a TSP sampler, the slope and intercept for this orifice uses standard flows rather than actual flows and is taken from the Q standard section of the Orifice Calibration Worksheet. The Q actual flows are only used when calibrating a PM-10 sampler.
- 2.3.4 The five orifice manometer readings taken during the calibration have been recorded in the column on the data worksheet titled Orifice "H2O. The five continuous flow recorder readings taken during the calibration have been recorded under the column titled I chart.

2.3.5 The orifice manometer readings need to be converted to the standard air flows they represent using the following equation:

$$Qstd = 1/m[Sqrt((H_20)(Pa/760)(298/Ta))-b]$$

#### where:

Qstd = actual flow rate as indicated by the calibrator orifice, m3/min

H<sub>2</sub>O = orifice manometer reading during calibration, "H<sub>2</sub>O

Ta = ambient temperature during calibration, K ( $K = 273 + {}^{\circ}C$ )

298 = standard temperature, a constant that never changes, K

Pa = ambient barometric pressure during calibration, mm Hg

760 = standard barometric pressure, a constant that never changes, mm Hg

m = *Qstandard slope of orifice* calibration relationship

b = *Qstandard intercept of orifice* calibration relationship.

- 2.3.6 Once these standard flow rates have been determined for each of the five run points, they are recorded in the column titled Qstd, and are represented in cubic meters per minute.
- 2.3.7 Once these standard flow rates have been determined for each of the five run points, they are recorded in the column titled Qstd, and are represented in cubic meters per minute

2.3.8 The continuous flow recorder readings taken during the calibration need to be corrected to the current meteorological conditions using the following equation:

$$IC = I[Sqrt((Pa/760)(298/Ta))]$$

where:

IC = continuous flow recorder readings corrected to current Ta and Pa

I = continuous flow recorder readings during calibration

Pa = ambient barometric pressure during calibration, mm Hg.

760 = standard barometric pressure, a constant that never changes, mm Hg

Ta = ambient temperature during calibration, K ( $K = 273 + ^{\circ}C$ )

298 = standard temperature, a constant that never changes, K

- 2.3.9 After each of the continuous flow recorder readings have been corrected, they are recorded in the column titled IC (corrected).
- 2.3.10 Using Qstd and IC (or FLOW (corrected)) as the x and y axis respectively, a slope, intercept, and correlation coefficient can be calculated using the least squares regression method. The correlation coefficient should never be less than 0.990 after a five-point calibration. A coefficient below .990 indicates a calibration that is not linear and the calibration should be performed again. If this occurs, it is most likely the result of an air leak during the calibration or high wind speed during the calibration procedure.
- 2.3.11 The equations for determining the slope (m) and intercept (b) are as follows:

m=
$$\frac{(\sum x)(\sum y)}{\sum xy - n}$$

$$\frac{(\sum x)^2}{\sum x^2 - n} ; \quad b = y - mx$$

The equation for the coefficient of correlation (r) is as follows:

$$\mathbf{r} = \sum xy - \frac{(\sum x)(\sum y)}{n}$$

$$\sqrt{\sum x^2 - \frac{(\sum x)^2}{n}} \left[\sum y^2 - \frac{(\sum y)^2}{n}\right]$$

where: 
$$n = number of observations$$
  
 $\sum = sum of$ 

- 2.3.12 The acceptable operating flow range of a TSP sampler is 1.1 to 1.7 m3/min (39 to 60 CFM). Looking at the worksheet column Qstd(see page 38), the flow rates that are within this range can be identified along with the chart reading (I) that represents them. For instance, if you wanted to set this sampler at 1.265 m3/min (44.67 CFM) (Make sure the mass flow controller is plugged in and a filter is in place) you would turn the Flow Adjustment screw until the continuous flow recorder read 37 on the chart. By making sure that the sampler is operating at a chart reading (or manometer reading) that is within the acceptable range, it can be assumed that valid TSP data is being collected.
- 2.3.13 A calibration that has a correlation coefficient of less than .990 is not considered linear and should be re-calibrated. Therefore, if r < 0.990, return all the points or only the point with the greatest deviation and the recalculate.
- 2.3.14 The 24-hour TSP levels to be measured by direct reading methods, utilising portable Laser Particle Photometer Monitors (Sibata Model LD-3B), in place of High-Volume Sampler (HVS) if HVS experience difficulties in operation during monitoring. It is demonstrated by the previous project experiences, that 24-hour TSP monitoring results collected by direct reading method are comparable to those produced by the high-volume sampling method, to indicate short event impacts. The projects utilising the collection of 24-hour TSP levels data by direct reading methods are shown below.


#### Project Reference for utilising the collection of 24-hour TSP levels data by direct reading methods

Project Contract Number	Location	Status
NDO 03/2018	Road Widening and Retrofitting Noise Barriers on	On-going
	Tai Po Road (Sha Tin Section)	
NDO 14/2018	Advance and First Stage Works of Kwu Tung North	On-going
	and Fanling North New Development Areas	

- 2.3.15 Calculation of the value of 24-hour TSP concentration is given by the average of 24 calculated 1-hour TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and High-Volume Sampler.
- 2.3.16 The correlation results between the direct reading meter and High-Volume Sampler shall be review with bimonthly internal calibration. To maintain the correlation with two sets of data (monitoring data from HVS and monitoring data from Portable Laser Particle Photometer Monitors) bimonthly internal calculated are strongly linked together two sets of data.
- 2.3.17 To protect the dust meter from being damaged and to operate without disturbances or nuisance, temporary barriers shall be erected around the monitoring equipment during the monitoring period. Temporary barriers will be placed approx. 0.5m away from the dust meter.

#### Maintenance/ Calibration for the High-Volume Sampler (HVS) being correlation

- 2.3.18 The HVS shall be calibrated bimonthly in accordance to the specification in the manufacturer's manual. The calibration certificates shall be available to the IEC for checking upon request. The validity and accuracy of the HVS shall also be tested against the result by the TE-5025A Calibration Kit periodically, Details of Calibration Cert and Specification for HVS Graseby GMW and HVS- Calibration Kit TE-5025A are given in Appendix 2-1 and Appendix 2-3.
- 2.3.19 Graseby GMW is chosen as the HVS for 24-hour TSP monitoring and Tisch TE 5025A is chosen as the HVS Calibration-Kit for HVS calibration.
- 2.3.20 The high-volume motors and their accessories should be properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking should be made to ensure that the equipment and necessary power supply were in good working condition.

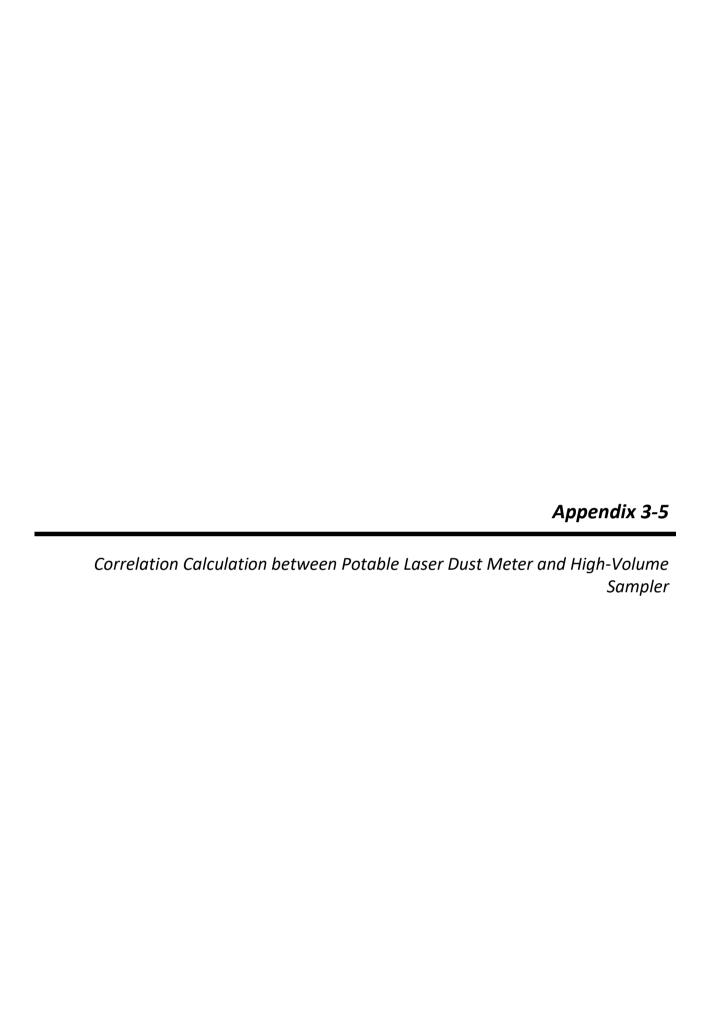



istrong Industrial Centre, I-36 Au Pui Wan Street, Fo Tan, Hong Kong

+852 2695 8318 +852 2695 3944

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 February 2022

Serial No.

014746 (ET/EA/001/06)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	28	55	81	148	196	
TSP (ug/m <sup>3</sup> )	42	88	131	232	330	
High Volume Air Sampler Serial No.: 1180	Calibration Due Date: 10 March 2022					

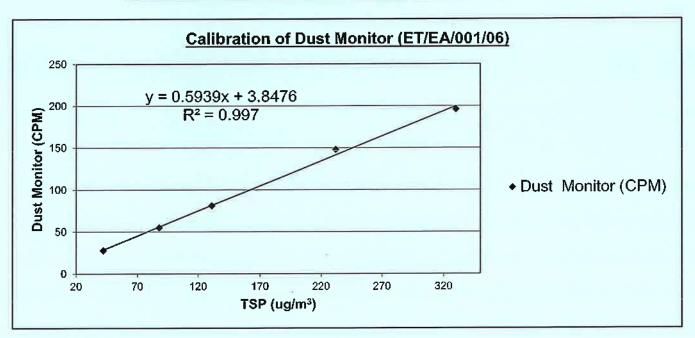

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after

five-point calibration.

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

Ē

Ll, Lok Yin

(Senior Technician)

Checked by 3

(Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +652 2695 8318 F: +852 2695 3944 E: ett@ets-testconsult.com W: www.els-testconsult.com

#### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

: 25 February 2022

Serial No.

155331 (ET/EA/001/09)

Calibration Due Date

: 24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	55	104	162	215	286
TSP (ug/m <sup>3</sup> )	60	108	186	241	323
High Volume Air Sampler, Serial No.: 9795	Calibration Due Date: 09 March 2022				

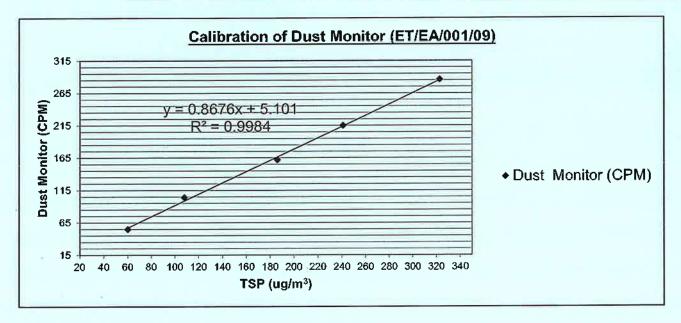

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

n

LI, Lok Yin

(Senior Technician)

Checked by

Guy, Keng Ping Ki Laboratory Manager)



34-36 Au Pui Wan Stre Fo Tan. Hong Kong

T: +852 2695 8318 E: eti@ets-testconsult.com www.ets-testconsuit.com

#### **Internal Calibration Report**

of **Dust Monitor** 

Manufacturer: SIBATA (LD-3B)

Date of Calibration

25 February 2022

Serial No.

597340 (ET/EA/001/14)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

şi	Dust Monitor (CPM)	23	54	88	132	177
	TSP (ug/m <sup>3</sup> )	31	70	117	193	252
	High Volume Air Sampler, Serial No.: 1174	Calibration Due Date: 10 March 2022				

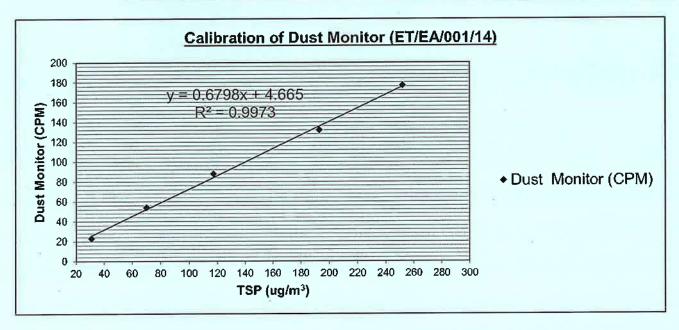

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by ;

12

LI, Lok Yin (Senior Technician) Checked by :

Guy Kong Ping (Laboratory Manager)



Veristrong Industrial Centre, 34-36 Au Pui Wan Street,

F: +852 2695 3944

#### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

25 February 2022

Serial No.

597227 (ET/EA/001/15)

Calibration Due Date:

24 April 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	27	44	77	110	155
TSP (ug/m <sup>3</sup> )	40	74	135	203	272
High Volume Air Sampler, Serial No.: 2483	Calibratio	n Due Da	te: 10 M	arch 2022	

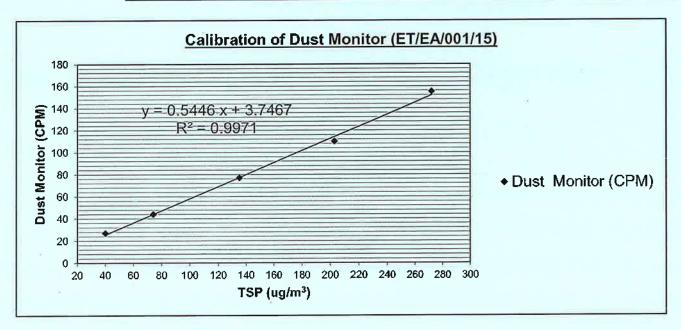

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by

20

LI, Lok Yin

Checked by

(Senior Technician)

(Laboratory Manager)



8/F Block B Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 ell@ets-testconsult.com www.ets-testconsult.com

#### **Internal Calibration Report** of

**Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

014746 (ET/EA/001/06)

Calibration Due Date:

24 June 2022


Method

: Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	25	50	77	134	178
TSP (ug/m <sup>3</sup> )	46	92	139	227	315
High Volume Air Sampler, Serial No.: 1180	Calibratio	n Due Da	ate: 07 M	av 2022	

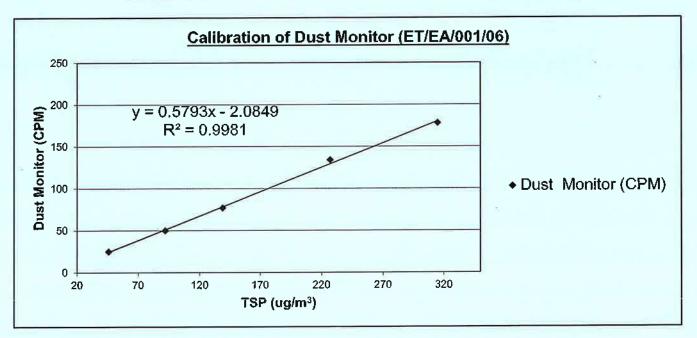

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after

five-point calibration.

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by :

20

Ll. Lok Yin

(Senior Technician)

Checked by :

Guy, Kong Ping. (Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan. Hong Kong

T: +652 2695 8316 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

155331 (ET/EA/001/09)

Calibration Due Date

: 24 June 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

:	Dust Monitor (CPM)	50	102	159	206	271
	TSP (ug/m³)	64	113	182	247	315
	High Volume Air Sampler, Serial No.: 9795	Calibratio	on Due D	ate: 08 M	lav 2022	

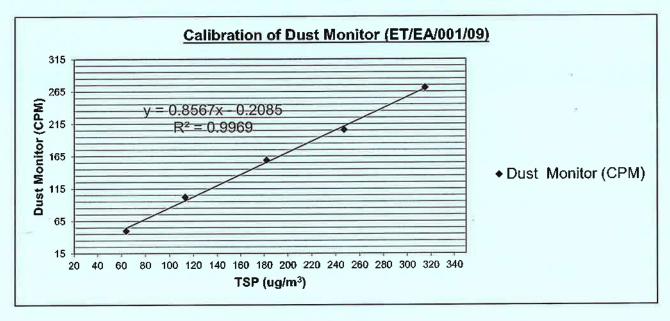

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

20

Ll, Lok Yin

(Senior Technician)

Checked by

(Laboratory Manager)



8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 E: etl@ets-testconsuft.com W: www.ets-testconsult.com

#### Internal Calibration Report

of

#### **Dust Monitor**

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

597340 (ET/EA/001/14)

Calibration Due Date:

24 June 2022


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	25	57	93	142	189
TSP (ug/m³)	37	75	128	188	263
High Volume Air Sampler, Sorial No.: 1174	Calibratio	n Due Da	ate: 07 M	av 2022	

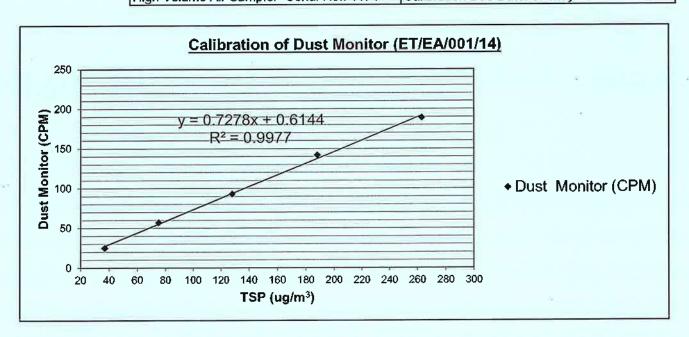

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by :

12

Checked by

Guy, Kong Ping Ki (Laboratory Manager)

LI, Lok Yin (Senior Technician)



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street,

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

#### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

25 April 2022

Serial No.

597227 (ET/EA/001/15)

Calibration Due Date:

24 June 2022


Method

: Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	22	45	75	103	144
TSP (ug/m³)	43	79	130	189	261
High Volume Air Sampler Serial No.: 2483	Calibratio	n Due Da	ite: 07 M	ay 2022	

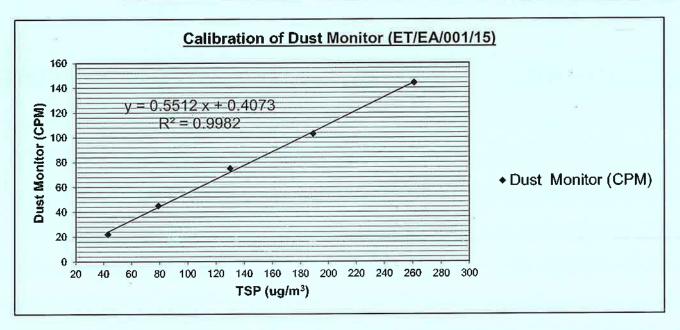

Acceptance Criteria :

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by

Checked by :

(Laboratory Manager)

LI, Lok Yin (Senior Technician)



### Contract No. EP516/2016 Port Shelter Sewerage, stage 3 – Sewage Works at Po Toi O

#### 2022/04 Air and Noise Quality Impact Monitoring Schedule

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar	1-Apr	2-Apr
						** 1 - hr TSP
						**24- hr TSP
3-Apr	4-Apr	5-Apr	6-Apr	7-Apr	8-Apr	9-Apr
					*Noise	
					** 1 - hr TSP	
					**24- hr TSP	
10-Apr	11-Apr	12-Apr	13-Apr	14-Apr	15-Apr	16-Apr
			*Noise			
			** 1 - hr TSP			
			**24- hr TSP			
17-Apr	18-Apr	19-Apr	20-Apr	21-Apr	22-Apr	23-Apr
		*Noise				** 1 - hr TSP
		** 1 - hr TSP				**24- hr TSP
		**24- hr TSP				
24-Apr	25-Apr	26-Apr	27-Apr	28-Apr	29-Apr	30-Apr
					*Noise	
					** 1 - hr TSP	
					**24- hr TSP	

<sup>\*</sup> Noise Monitoring Locations: NSM1N,NMS2N,NMS3N and NMS4N

<sup>\*\* 1</sup>hr TSP and 24- hr TSP Monitoring Locations: ASM1N ,ASM2N1, ASN3N and ASM4N


### Contract No. EP516/2016 Port Shelter Sewerage, stage 3 – Sewage Works at Po Toi O

#### 2022/05 Air and Noise Quality Impact Monitoring Schedule

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1-May	2-May	3-May	4-May	5-May	6-May	7-May
				*Noise		
				** 1 - hr TSP		
				**24- hr TSP		
8-May	9-May	10-May	11-May	12-May	13-May	14-May
			*Noise			
			** 1 - hr TSP			
			**24- hr TSP			
15-May	16-May	17-May	18-May	19-May	20-May	21-May
		*Noise				
		** 1 - hr TSP				
		**24- hr TSP				
22-May	23-May	24-May	25-May	26-May	27-May	28-May
	*Noise					** 1 - hr TSP
	** 1 - hr TSP					**24- hr TSP
	**24- hr TSP					
29-May	30-May	31-May	1-Jun	2-Jun	3-Jun	4-Jun

<sup>\*</sup> Noise Monitoring Locations: NSM1N,NMS2N,NMS3N and NMS4N

<sup>\*\* 1</sup>hr TSP and 24- hr TSP Monitoring Locations: ASM1N ,ASM2N1, ASN3N and ASM4N

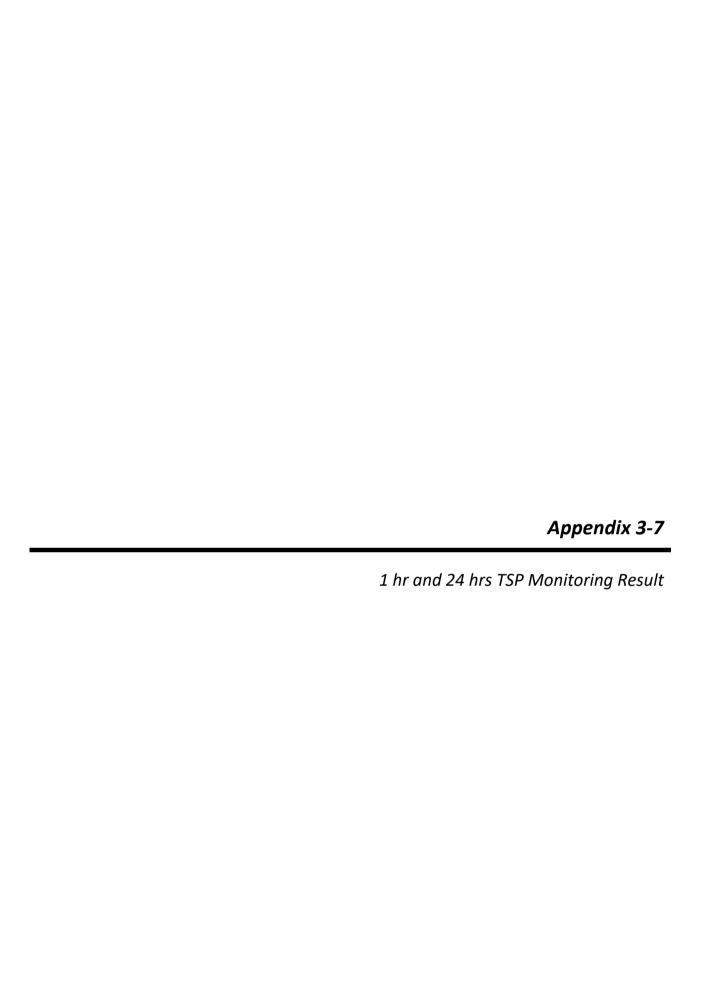

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2022/04 1-hour and 24-hours TSP Monitoring Data

Monitoring Location		AN	∕IS-1N				
			1-hou	r TSP Monitoring		24-hour TSP	Monitoring
Date	Weather		Start Time	Concentration (μg/m³)	Average Concentration (µg/m³)	Start Time	Concentration (μg/m³)
		1st hr	08:34	10.0			
2022-04-02	Cloudy	2nd hr	09:34	11.0	10.7	08:34	11.0
		3rd hr	10:34	11.0			
		1st hr	09:34	26.0			
2022-04-08	Fine	2nd hr	10:34	24.0	24.0	09:34	24.0
		3rd hr	11:34	22.0			
		1st hr	08:53	29.0			
2022-04-13	Fine	2nd hr	09:53	37.0	37.7	08:53	38.0
		3rd hr	10:53	47.0			
		1st hr	12:15	15.0			
2022-04-19	Cloudy	2nd hr	13:15	17.0	15.7	12:15	16.0
		3rd hr	14:15	15.0			
		1st hr	08:49	100.0			
2022-04-23	Cloudy	2nd hr	09:49	81.0	75.7	08:49	76.0
		3rd hr	10:49	46.0			
		1st hr	08:24	35.0			
2022-04-29	Fine	2nd hr	09:24	26.0	27.7	08:24	28.0
		3rd hr	10:24	22.0			
				Average:	31.9	Average:	32.2
				Action Level :	319	Action Level :	153
				Limit Level :	500	Limit Level :	260

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2022/04 1-hour and 24-hours TSP Monitoring Data

Monitoring Location : AMS-2N1

-			1-hou	r TSP Monitoring		24-hour TSP Monitoring	
Date	Weather		Start Time	Concentration (μg/m³)	Average Concentration (µg/m³)	Start Time	Concentration (μg/m³)
		1st hr	08:24	14.0			
2022-04-02	Cloudy	2nd hr	09:24	15.0	14.3	08:24	14.0
		3rd hr	10:24	14.0			
		1st hr	12:43	32.0			
2022-04-08	Fine	2nd hr	13:43	28.0	29.3	12:43	29.0
		3rd hr	14:43	28.0			
		1st hr	13:00	39.0			
2022-04-13	Fine	2nd hr	14:00	27.0	32.3	13:00	32.0
		3rd hr	15:00	31.0			
		1st hr	09:03	8.0			13.0
2022-04-19	Cloudy	2nd hr	10:03	15.0	12.7	12.7 09:03	
		3rd hr	11:03	15.0			
		1st hr	08:33	120.0			
2022-04-23	Cloudy	2nd hr	09:33	112.0	96.3	08:33	96.0
		3rd hr	10:33	57.0			
		1st hr	13:04	34.0			
2022-04-29	Fine	2nd hr	14:04	30.0	32.7	13:04	33.0
		3rd hr	15:04	34.0			
			· · · · · · · · · · · · · · · · · · ·	Average :	36.3	Average:	36.2
				Action Level :	279	Action Level :	179
				Limit Level :	500	Limit Level :	260

Project No. 1825

Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2022/04 1-hour and 24-hours TSP Monitoring Data

Monitoring Location :		AN	∕IS-3N				
			1-hou	r TSP Monitoring		24-hour TSP	Monitoring
Date	Weather		Start Time	Concentration (μg/m³)	Average Concentration (µg/m³)	Start Time	Concentration (µg/m³)
		1st hr	08:29	12.0			
2022-04-02	Cloudy	2nd hr	09:29	12.0	12.7	08:29	13.0
		3rd hr	10:29	14.0			
		1st hr	12:40	32.0			
2022-04-08	Fine	2nd hr	13:40	26.0	31.3	12:40	31.0
		3rd hr	14:40	36.0			
		1st hr	13:05	46.0			
2022-04-13	Fine	2nd hr	14:05	45.0	44.7	13:05	45.0
		3rd hr	15:05	43.0			
		1st hr	09:00	15.0			20.0
2022-04-19	Cloudy	2nd hr	10:00	22.0	20.3	09:00	
		3rd hr	11:00	24.0			
		1st hr	08:30	55.0			
2022-04-23	Cloudy	2nd hr	09:30	63.0	50.0	08:30	50.0
		3rd hr	10:30	32.0			
		1st hr	13:00	34.0			
2022-04-29	Fine	2nd hr	14:00	28.0	29.3	13:00	29.0
		3rd hr	15:00	26.0			
·				Average:	31.4	Average:	31.3
				Action Level :	303	Action Level :	158
				Limit Level :	500	Limit Level :	260

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2022/04 1-hour and 24-hours TSP Monitoring Data
Monitoring Location:


AMS-4N

		1-hour TSP Monitoring			24-hour TSF	Monitoring	
Date	Weather		Start Time	Concentration (μg/m³)	Average Concentration (µg/m³)	Start Time	Concentration (µg/m³)
		1st hr	08:40	15.0			
2022-04-02	Cloudy	2nd hr	09:40	13.0	13.7	08:40	14.0
		3rd hr	10:40	13.0			
		1st hr	09:29	22.0			
2022-04-08	Fine	2nd hr	10:29	22.0	21.0	09:29	21.0
		3rd hr	11:29	19.0			
		1st hr	08:59	50.0		08:59	
2022-04-13	Fine	2nd hr	09:59	48.0	48.0		48.0
		3rd hr	10:59	46.0			
		1st hr	12:20	33.0			32.0
2022-04-19	Cloudy	2nd hr	13:20	33.0	32.3 12:20	12:20	
		3rd hr	14:20	31.0			
		1st hr	08:54	111.0			
2022-04-23	Cloudy	2nd hr	09:54	98.0	90.3	08:54	90.0
		3rd hr	10:54	62.0			
		1st hr	08:29	32.0			
2022-04-29	Fine	2nd hr	09:29	26.0	33.0	08:29	33.0
		3rd hr	10:29	41.0			
				Average:	39.7	Average:	39.7
				Action Level :	278	Action Level :	144
				Limit Level :	500	Limit Level :	260


### Appendix 3-7 - 1hour and 24 hours TSP Monitoring Result

Reporting Month: 2022/04


### AMS1N – 1 – hour TSP monitoring Chart

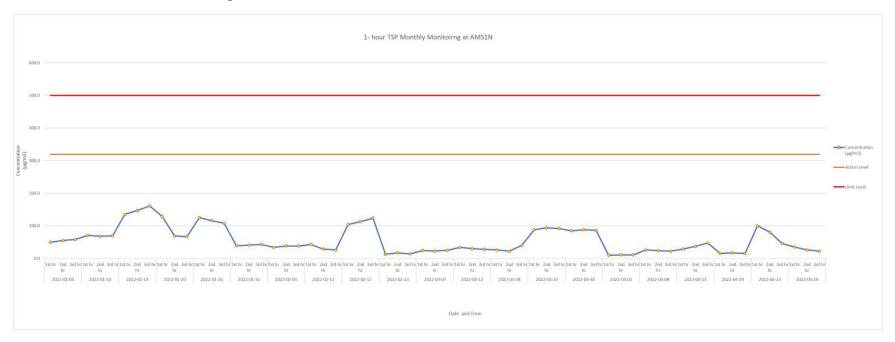


AMS1N – 24-hour TSP Monitoring

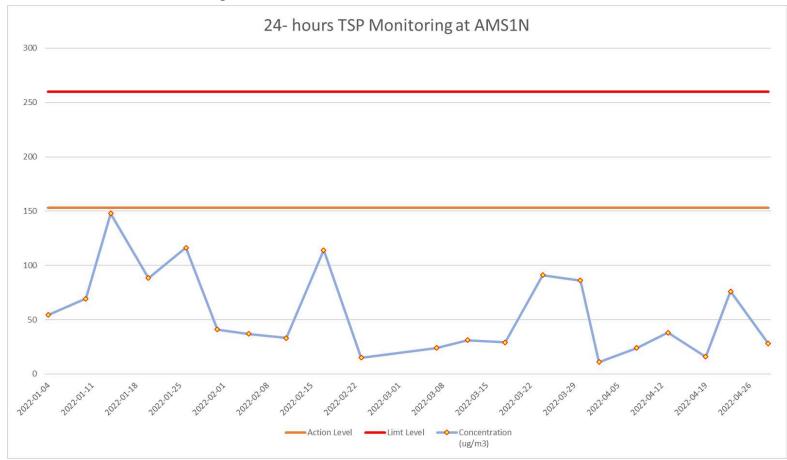


### AMS2N1 – 1 – hour TSP monitoring Chart

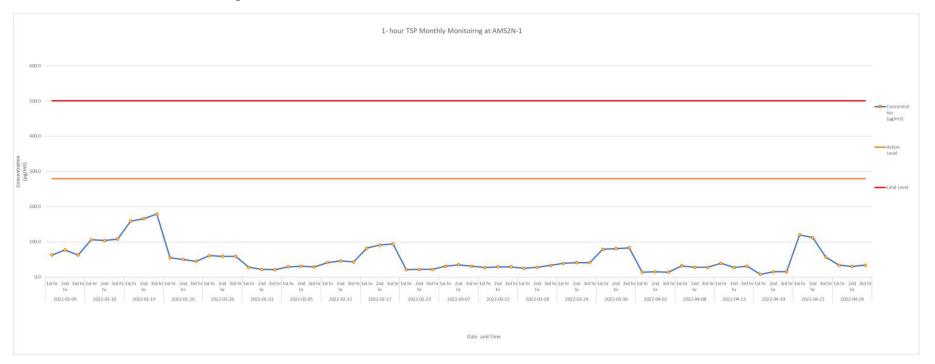


AMS2N1 – 24-hour TSP Monitoring

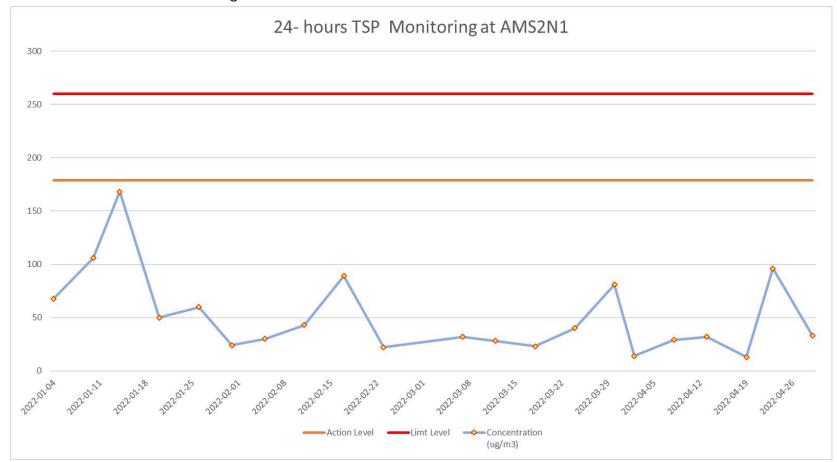


AMS3N – 1 – hour TSP monitoring Chart

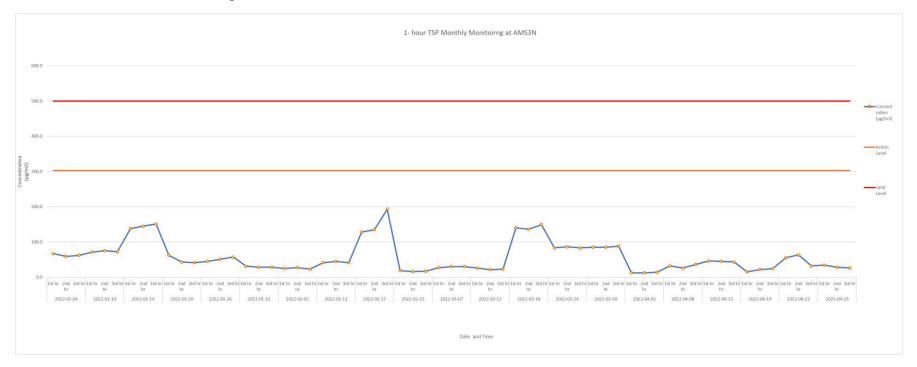


### AMS3N – 24-hour TSP Monitoring

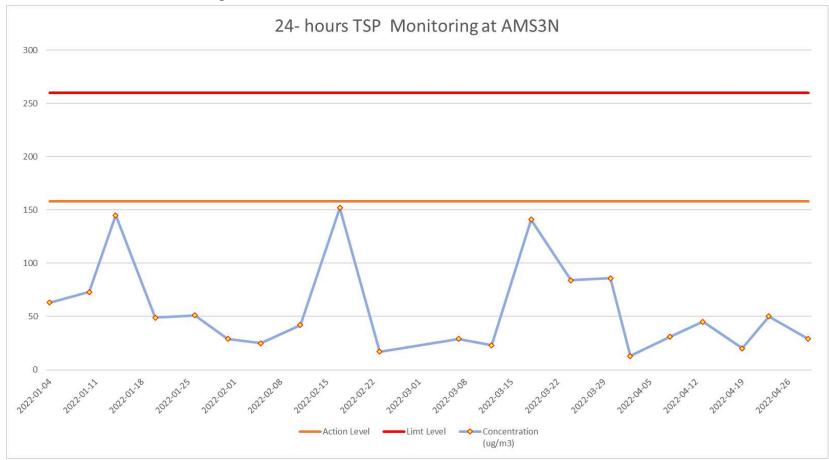


### AMS4N - 1 - hour TSP Monitoring

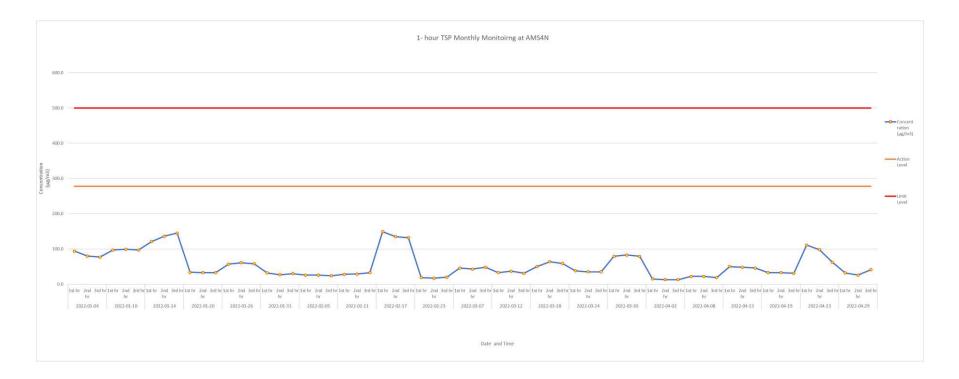

AMS4N – 24-hour TSP Monitoring

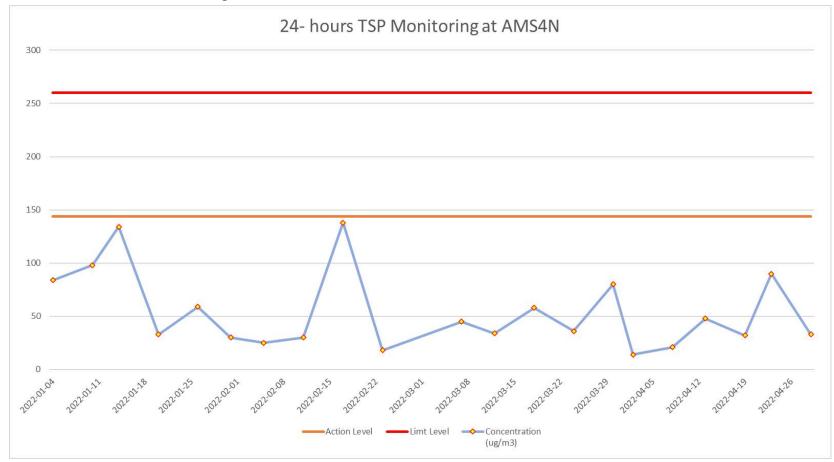

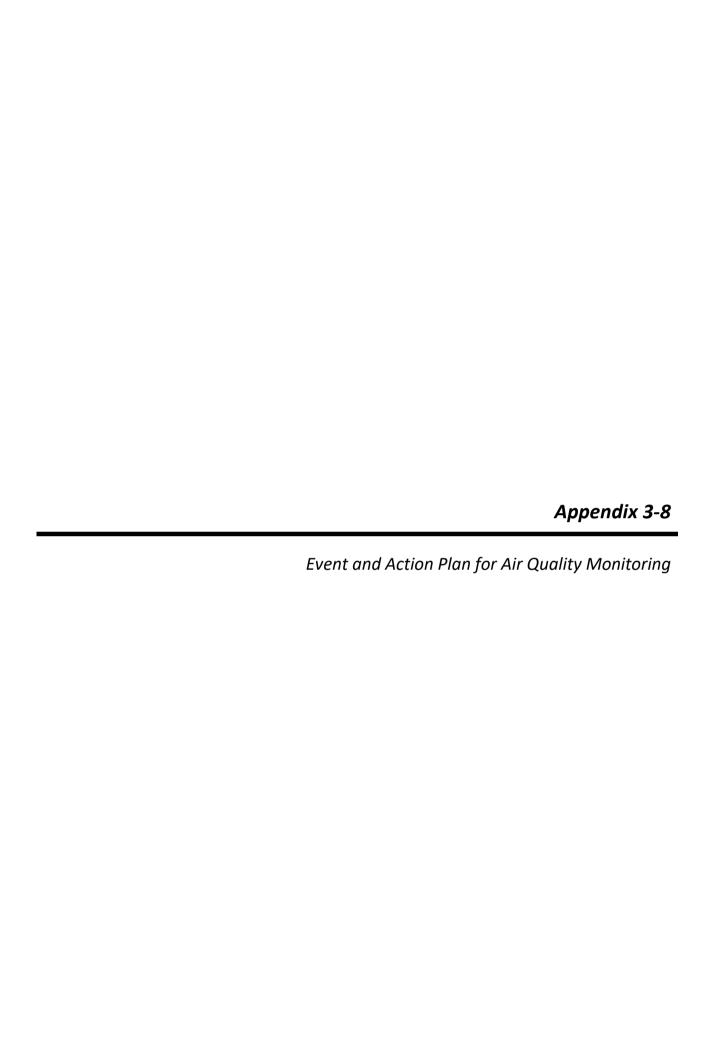


#### Appendix 3-8 Event and Action Plan for Air Quality Impact Monitoring

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level				
1.Exceedance for one sample	<ol> <li>Inform IEC, ER and Contractor;</li> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	1. Notify Contractor	<ol> <li>Rectify any unacceptable practice;</li> <li>2. Amend working methods if appropriate.</li> </ol>
2.Exceedance for two or more consecutive samples	<ol> <li>Inform IEC, ER and Contractor;</li> <li>Identify source;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC, ER and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures</li> <li>Advise the ET/ER on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented.	<ol> <li>Submit proposals for remedial to</li> <li>ER and IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>

Project No. 1825

### Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

EVENT	ACTION											
	ET	IEC	ER	CONTRACTOR								
Limit Level												
1.Exceedance for one sample	<ol> <li>Inform IEC, ER, Contractor and EPD;</li> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily;</li> <li>Assess effectiveness of Contractor remedial actions and keep IEC, EPD and ER informed of the results.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Discuss with ET and IEC on remedial actions</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>								
2.Exceedance for two or more consecutiv e samples	<ol> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER and Contractor to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct</li> <li>the Contractor to terminate that portion of work until the exceedance ceases.</li> </ol>	<ol> <li>Take immediate action to avoid</li> <li>further exceedance;</li> <li>Discuss with ET and IEC on remedial actions</li> <li>Submit proposals for remedial actions to ER and IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance ceases.</li> </ol>								

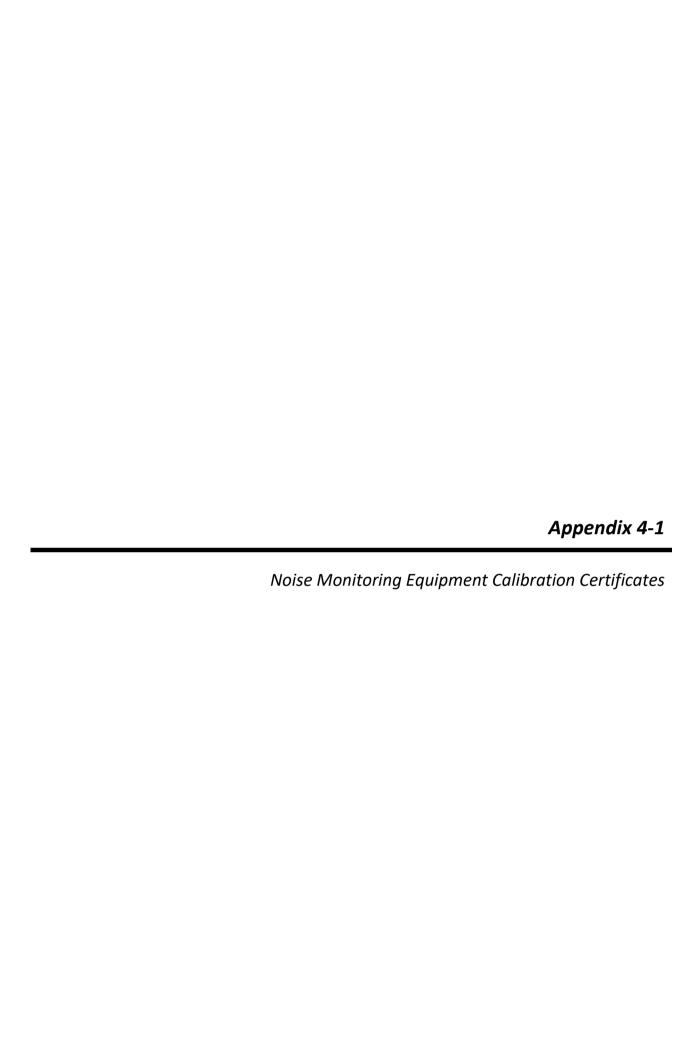



## 東業德勤測試顧問有限公司

## ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

#### **Calibration Certificate**

Certificate No.

: CSA20120

: 1 of

#### Information Provided by Customer

: ETS - TESTCONSULT LIMITED

Address

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

#### Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	RION
Туре	NL-31	UC-53A	NH-21
Equipment I.D. no.	ET/EN/003/12		
Serial No.	00773032	01291	25043
Adaptors used			
Resolution	0.1 dB		

#### Laboratory Information

Lab Ref No

Date of Issue

: Q/CAL/22/0142/I

Procedure

: CQS/001/A

Date of Calibration

: 6-Jan-2022

Date of Receipt

· 5-Jan-2022

11-Jan-2022

Calibration Location

: Calibration Laboratory

#### **Calibration Condition**

Ambient Temperature : (20±3) °C

Relative Humidity

: (50±20) %

Stabilizing Time

: 30 minutes

#### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

#### Calibration specification

- To perform the calibration of linearity and frequenny response by multi-function sound calibrator.

#### Calibration result

- The results are detailed on the subsequent pages.

#### Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

Tommy TAM (Technician)

Approved By:

CHAN Chi Wai



# 東業德勤測試顧問有限公司 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD. \*\*St. Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com

E: etl@ets-testconsult.com W: www.ets-testconsult.com



#### **Calibration Certificate**

Certificate No. : CSA20120

Page: 2 of 3

#### Result

Reference Sound Pressure Level: (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal	100-100	94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2.0
A-Weighting	Mode	Fast	114.0		114.0	0.0	0.13	2.0
	Self-cal		94.0	1	94.0	0.0	0.13	2.0
	Range	40 to 130	104.0		104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	-	94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2.0
C Maighting	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal	-	94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1 1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		113.9	-0.1	0.13	2.0

Measurement for other range on reference sound pressure level: (Unit in: dB)

Range / Mode			Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
A-Weighting	Range	20 to 100	94.0	1	94.1	0.1	0.13	2.0
A-vveighting	Mode	Fast	94.0		94.1	0.1	0.13	2.0
C Malabilina	Range	20 to 100	04.0		94.0	0.0	0.40	0.0
C-Weighting Mode		Fast	94.0		94.0	0.0	0.13	2.0

#### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B. Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E; etl@ets-testconsult.com W: www.ets-testconsult.com



#### **Calibration Certificate**

Certificate No.

CSA20120

Page

3 of 3

#### Result

#### Acoustic Sensitivity and Frequency Response:

3 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
		PARTITION NO.	31.5	54.6	54.7	0.1	-39.4 +/- 2.0
			63	67.8	67.9	0.1	-26.2 +/- 1.5
			125	77.9	78.0	0.1	-16.1 +/- 1.5
			250	85.4	85.5	0.1	-8.6 +/- 1.4
			500	90.8	90.9	0.1	-3.2 +/- 1.4
40 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	95.1	95.0	-0.1	+1.2 +/- 1.6
			4000	94.9	94.1	-0.8	+1.0 +/- 1.6
		No.	8000	92.9	90.4	-2.5	-1.1 (+2.1 ; - 3.1)
			12500	89.7	84.4	-5.3	-4.3 (+3.0 ; -6.0)
		Repair Line	16000	87.5	78.5	-9.0	-6.6 (+3.5 ; -17.0)

Frequency Response C-Weighting: (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
	Water floor	31.5	91.0	90.9	-0,1	-3.0 +/- 2.0	
			63	93.2	93.3	0.1	-0.8 +/- 1.5
		aviet en	125	93.8	94.0	0.2	-0.2 +/- 1.5
			250	94.0	94.1	0,1	0.0 +/- 1.4
			500	94.0	94.1	0.1	0.0 +/- 1.4
40 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	93.7	93.6	-0.1	-0.2 +/- 1.6
			4000	93.1	92.3	-0.8	-0.8 +/- 1.6
			8000	91.0	88.5	-2.5	-3.0 (+2.1 ; -3.1)
			12500	87.8	82.5	-5.3	-6.2 (+3.0 ; -6.0)
			16000	85.6	76.7	-8.9	-8.5 (+3.5 ; -17.0)

Remark:

- Manufacturer specification:
- IEC 61672 class 1
- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level
- Expended uncertainty of measurement:

	Range (Hz)	(dB)	Range (Hz)	(dB)
	31.5	0.20	2000	0.13
	63	0.13	4000	0.15
04 40	125	0.15	8000	0.14
94 dB	250	0.12	12500	0.14
	500	0.12	16000	0.14
	1000	0.13		



## 東業德勤測試顧問有限公司

## **ETS-TESTCONSULT LTD.**

8/F Block B Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

#### **Calibration Certificate**

Certificate No.

: CSA20121

: 1 of

#### Information Provided by Customer

Customer

: ETS - TESTCONSULT LIMITED

Address

8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

#### Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	RION
Туре	NL-52	UC-59	NH-25
Equipment I.D. no.	ET/EN/003/20		
Serial No.	00998504	16103	98718
Adaptors used			
Resolution	0.1 dB		

#### Laboratory Information

Lab. Ref. No.

: Q/CAL/22/0143/I

Procedure

: CQS/001/A

Date of Calibration

6-Jan-2022

Date of Receipt

: 5-Jan-2022 ; Calibration Laboratory

Date of Issue

11-Jan-2022

Calibration Location

#### **Calibration Condition**

Ambient Temperature : (20±3) °C

Relative Humidity

: (50±20) %

Stabilizing Time

: 30 minutes

#### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

#### Calibration specification

- To perform the calibration of linearity and frequenny response by multi-function sound calibrator.

#### Calibration result

- The results are detailed on the subsequent pages.

#### Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

**Tommy TAM** (Technician)

Approved By:

**CHAN Chi Wai** 



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



#### **Calibration Certificate**

Certificate No. : CSA20121

Page: 2 of 3

#### Result

1 Reference Sound Pressure Level: (Unit in: dB)

Range / Mode			Reference Level	REF Frequency (kHz)		Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal		94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
A-Weighting	Mode	Fast	114.0		114.0	0.0	0.13	2.0
A-vveighting	Self-cal		94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	-	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
0.141-1-10	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal	-	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	-	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
7 14(-1-1-1)	Mode	Fast	114.0		114.0	0.0	0.13	2.0
Z-Weighting	Self-cal	861-115	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0

2 Measurement for other range on reference sound pressure level: (Unit in: dB)

N/A.

Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level
- Octave filter is OFF during calibration.

\*\*\*



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



#### **Calibration Certificate**

Form Q/AS/C/01 Issue 1(3/7) [09/21]

Certificate No.

CSA20121

Page

3 of 3

#### Result

#### Acoustic Sensitivity and Frequency Response:

3 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
			31.5	54.6	53.3	-1.3	-39.4 +/- 2.0
400			63	67.8	67.5	-0.3	-26.2 +/- 1.5
			125	77.9	77.8	-0.1	-16.1 +/- 1.5
		250	85.4	85.4	0.0	-8.6 +/- 1.4	
			500	90.8	90.8	0.0	-3.2 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	95.1	94.9	-0.2	+1.2 +/- 1.6
			4000	94.9	93.9	-1.0	+1.0 +/- 1.6
			8000	92.9	90.6	-2.3	-1.1 (+2.1 ; - 3.1)
Maria de la companya			12500	89.7	84.6	-5.1	-4.3 (+3.0 ; -6.0)
		16000	87.5	77.0	-10.5	-6.6 (+3.5 ; -17.0)	

Frequency Response C-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
	S IND M	31.5	91.0	89.6	-1.4	-3.0 +/- 2.0	
		16.88	63	93.2	92.8	-0.4	-0.8 +/- 1.5
		125	93.8	93.8	0.0	-0.2 +/- 1.5	
			250	94.0	94.0	0.0	0.0 +/- 1.4
			500	94.0	94.1	0.1	0.0 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	93.7	93.6	-0.1	-0.2 +/- 1.6
			4000	93.1	92.1	-1.0	-0.8 +/- 1.6
			8000	91.0	88.7	-2.3	-3.0 (+2.1 ; -3.1)
			12500	87.8	82.6	-5.2	-6.2 (+3.0 ; -6.0)
			16000	85.6	75.2	-10.4	-8.5 (+3.5 ; -17.0)

Frequency Response Z-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class Specification
		Elizavi.	31.5	94.0	92.5	-1.5	0.0 +/- 2.0
			63	94.0	93,6	-0.4	0.0 +/- 1.5
			125	94.0	93.9	-0.1	0.0 +/- 1.5
			250	94.0	94.0	0.0	0.0 +/- 1.4
			500	94.0	94.0	0.0	0.0 +/- 1.4
30 to 130	Fast	2000 94.0 4000 94.0	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	94.0	93.7	-0.3	0.0 +/- 1.6
			94.0	92.9	-1.1	0.0 +/- 1.6	
13 10			8000	94.0	91.6	-2.4	0.0 (+2.1 ; -3.1)
The last			12500	94.0	88.1	-5.9	0.0 (+3.0 ; -6.0)
			16000	94.0	84.9	-9.1	0.0 (+3.5 ; -17.0)

Remark:

- Manufacturer specification: IEC 61672 class 1

- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level
- Expended uncertainty of measurement:

1	Range (Hz)	(dB)	Range (Hz)	(dB)
	31.5	0.15	2000	0.13
	63	0.15	4000	0.13
04.40	125	0.15	8000	0.14
94 dB	250	0.14	12500	0.14
	500	0.12	16000	0.14
	1000	0.13		



Certificate No. 110280

Page 1 of 2 Pages

Customer: ETS-Testconsult Limited

Address: 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No.: Q14041

Date of receipt

19-Oct-21

**Item Tested** 

Model

**Description**: Sound Level Calibrator

Manufacturer: Rion

I.D.

: ET/EN/002/01

: NC-73

Serial No.

: 10196943

**Test Conditions** 

Date of Test: 3-Nov-21 Supply Voltage : --

**Ambient Temperature:** 

 $(23 \pm 3)^{\circ}C$ 

Relative Humidity: (50 ± 25) %

**Test Specifications** 

Calibration check.

Ref. Document/Procedure: F21, Z02.

#### **Test Results**

All results were within the manufacturer's specification.

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No	. Description	<u>Cert. No.</u>		<u>Traceable to</u>
S014	Spectrum Analyzer	106615		NIM-PRC & SCL-HKSAR
S240	Sound Level Calibrator	106446		NIM-PRC & SCL-HKSAR
S041	Universal Counter	101743		SCL-HKSAR
\$206	Sound Level Meter	106447	24	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

Calibrated by :

Elva Chong

Approved by :

Date:

3-Nov-21

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646



Certificate No. 110280

Page 2 of 2 Pages

#### Results:

#### 1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94.0 dB	93.9 dB	± 1 dB

Uncertainty: ± 0.2 dB

#### 2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	0.982 kHz	± 2 %

Uncertainty: ± 0.1 %

3. Level Stability: 0.0 dB Uncertainty: ± 0.01 dB

4. Total Harmonic Distortion : < 0.3 %

Mfr's Spec. : < 3 %

Uncertainty: ±2.3 % of reading

Remarks: 1. UUT: Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure: 1 009 hPa

----- END -----



Certificate No. 110279

Page 1 of 2 Pages

Customer: ETS-Testconsult Limited

Address: 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No.: Q14041

Date of receipt

19-Oct-21

Item Tested

**Description**: Thermo-Anemometer

Manufacturer: AZ Instrument

I.D.

ET/EN/001/05

Model

: AZ 8908

Serial No.

: 1064869

**Test Conditions** 

Date of Test: 28-Oct-21

Supply Voltage

.

Ambient Temperature :

 $(23 \pm 3)^{\circ}C$ 

Relative Humidity: (50 ± 25) %

**Test Specifications** 

Calibration check.

Calibration procedure:

T03, Z04.

#### **Test Results**

A correction factor of x 1.1 is required to bring the meter reading to within the manufacturer's specification. The results are shown in the attached page(s).

Main Test equipment used:

Equipment No. Description

Cert. No.

Traceable to

S155

Std. Anemometer

008674

NIM-PRC

S223C

Std. Thermometer

104830

NIM-PRC

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

Calibrated by:

James Yau

Approved by:

28-Oct-21

Date:

Steve Kwan

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong. Tel: 2425 8801 Fax: 2425 8846

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



Certificate No. 110279

Page 2 of 2 Pages

Results:

#### 1. Velocity

Applied Value (m/s)	UUT Reading (m/s)	Corrected rdg. (=UUT rdg. × 1.1)	Mfr's Spec.
0.00	0.0	0.0	$\pm$ (3% of reading + 0.2 m/s)
2.50	2.4	2.6	
5.00	4.7	5.2	
10.00	*9.2	10.1	
15.00	*13.8	15.2	
19.00	*17.6	19.4	

#### 2. Temperature

Applied Value (°C)	UUT Reading (°C)	Mfr's Spec.
23.04	22.7	±1°C


Remark: 1. UUT: Unit-Under-Test

2. Uncertainty:  $\pm (0.9\% + 0.16 \text{ m/s})$  for Velocity,  $\pm 0.1$  °C for Temperature, for a confidence probability of not less than 95%.

3. Atmospheric Pressure: 1 006 hPa

4. \*Out of Specification

----- END -----



#### Appendix 4-2 : Noise Monitoring Data Month 2022/04

Monitoring Location :	NMS1

nitoring Location :		NMS1N		
Date	Leq30min dB(A)*	L10 dB(A)	L90 dB(A)	Limit Level dB(A
2022-04-08	55.4	57.6	43.0	75
2022-04-13	55.2	56.9	51.5	75
2022-04-19	55.8	59.5	41.5	75
2022-04-29	62.4	64.2	54.2	75
Average :		58.4		
Action Level :	When or	ne valid documented complaint is re	eceived	
Limit Level :		75.0 dB(A)		

Monitoring Location : NMS2N1

Start Date & Time	Leq30min dB(A)*	L10 dB(A)	L90 dB(A)	Limit Level dB(A)
2022-04-08	46.9	49.5	43.0	75
2022-04-13	52.3	59.3	50.5	75
2022-04-19	50.1	52.2	46.1	75
2022-04-29	53.1	55.2	50.0	75
Average: 51.2				
Action Level : When one valid documented complaint is received				
Limit Level: 75.0 dB(A)				
* Remark: For Free-fie	ld measurement, a correction of +3dE	B(A) should be made to the measured	results.	

NMS3N **Monitoring Location:** Start Date & Time Leq30min dB(A)\* L10 dB(A) L90 dB(A) Limit Level dB(A) 2022-04-13 57.0 60.0 52.4 75 2022-04-19 61.4 53.3 58.3 75 58.7 56.4 56.5 47.7


2022-04-29 Average : When one valid documented complaint is received 75.0 dB(A) Limit Level: 75.0 dB(A)

\* Remark: For Free-field measurement, a correction of +3dB(A) should be made to the measured results.


Monitoring Location :		NMS4N		
Start Date & Time	Leq30min dB(A)*	L10 dB(A)	L90 dB(A)	Limit Level dB(A)
2022-04-08	55.7	58.3	47.5	75
2022-04-13	50.2	52.8	43.9	75
2022-04-19	47.7	50.4	42.4	75
2022-04-29	53.4	56.0	44.4	75
Average :		52.8		
Action Level :	When	one valid documented complaint is rec	eived	
Limit Level :		75.0 dB(A)		
* Remark: For Free-field m	easurement, a correction of +3d	B(A) should be made to the measured re	esults.	

#### **Appendix 4-2 - Noise Monitoring Data Chart**


Monitoring Station: NMS1N

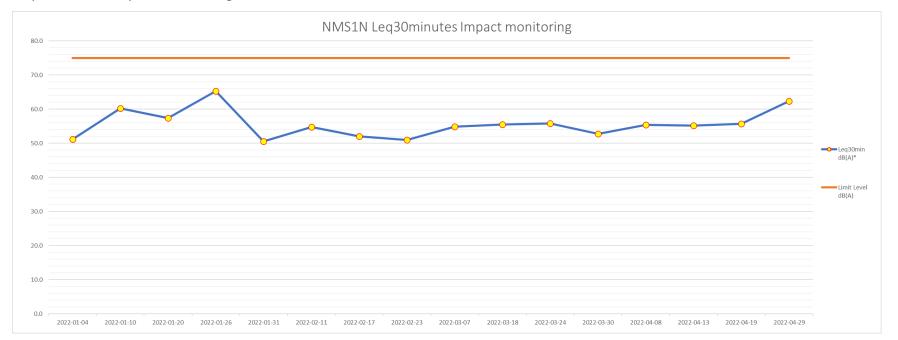


Monitoring Station: NMS2N1

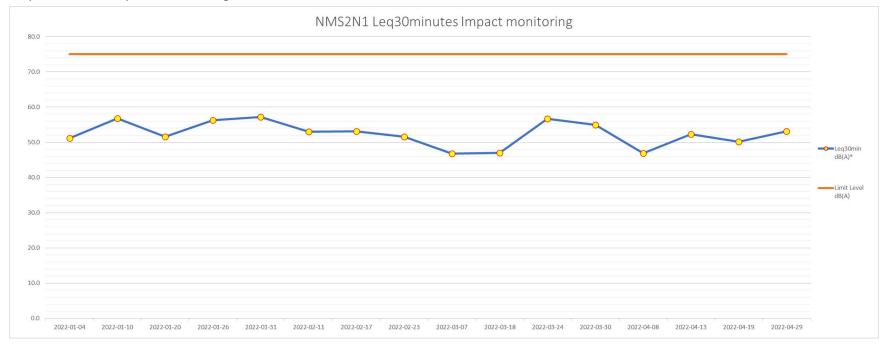


Monitoring Station: NMS3N

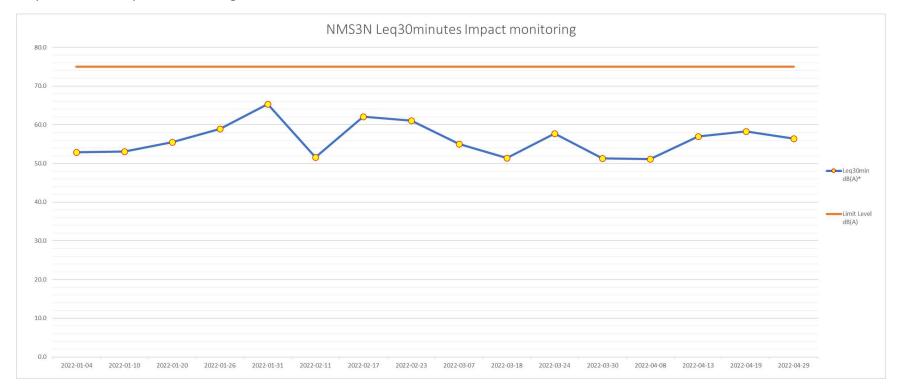

Monitoring Station: NMS4N

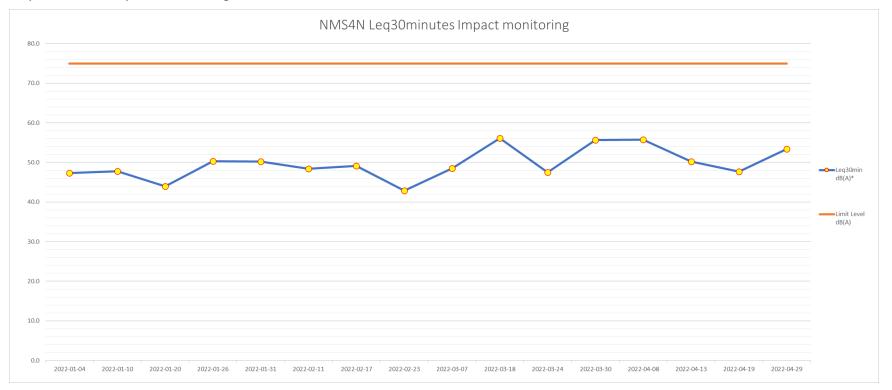

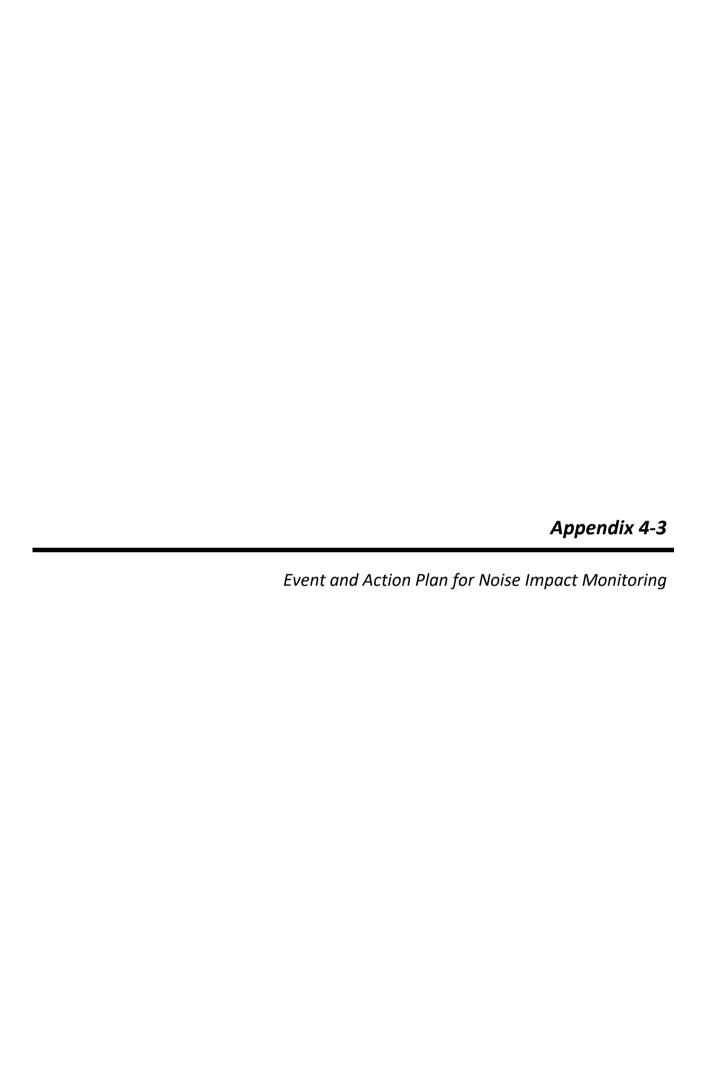


Appendix 4-3 Event and Action Plan for Noise Impact Monitoring

<b>EVENT</b>	ACTION						
	ET	IEC	ER	Contractor			
Action Level	<ol> <li>Notify IEC, ER and Contractor of exceedance;</li> <li>Identify source</li> <li>Investigate the causes of exceedance and propose remedial measures;</li> <li>Report the results of investigation to the IEC,</li> <li>ER and Contractor;</li> <li>Discuss with the IEC, ER and Contractor and formulate remedial measures;</li> <li>Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	1. Review the analysed results submitted by the ET;  2. Review the proposed remedial measures by the Contractor and advise the ER accordingly;  3. Supervise the implementation of remedial measures.	<ol> <li>Confirm receipt of notification</li> <li>of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose</li> <li>remedial measures for the</li> <li>analysed noise problem;</li> <li>Ensure remedial measures are</li> <li>properly implemented</li> </ol>	Submit noise mitigation proposals to ER with copy to ET and IEC;  Implement noise mitigation proposals.			

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

ET			
		IEC ER	CONTRACTOR
2. I 3. 4. I 5. pro be 6. I act	Inform IEC, ER, EPD and Contractor; Identify source; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working ocedures to determine possible mitigation to e implemented; Inform IEC, ER and EPD the causes and tions taken for the exceedances; Assess effectiveness of Contractor's remedial tions and keep IEC, EPD and ER informed the results;	1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;  1. Confirm receipt notification of failure writing; 2. Notify Contractor; 3. Require Contractor propose remedial measures for the analysinoise problem; 4. Ensure remedial measure properly implements	of 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to ER with copy to ET and IEC within 3 working days of notification; 3. Implement the agreed proposals; ed; 4. Resubmit proposals if problem still not under control; nd 5. Terminate the relevant portion of works as determined by the ER until



### **Appendix 6-1 Monthly Summary Waste Flow Table**

#### Monthly Summary Waste Flow Table for <u>2022</u> (year)

Name of Department: DSD

Contract No. DC 2019/09 Port Shelter Phase 3, Po Toi O Sewage Treatment Plant

		Actual	Quantities of	Inert C&D Ma	terials Generated M	lonthly	Actual Qı	uantities of	C&D Waste	s Generated	Monthly
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see notes 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	( in '000m³)
Jan	0.142	0.000	0.000	0.000	0.142	0.000	0.000	0.000	0.000	0.000	0.000
Feb	0.100	0.000	0.000	0.000	0.100	0.000	0.000	0.000	0.000	0.000	0.000
Mar	0.040	0.000	0.000	0.000	0.040	0.000	0.000	0.000	0.000	0.000	0.000
Apr	0.010	0.000	0.000	0.000	0.010	0.000	0.000	0.000	0.000	0.000	0.000
May	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
June	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sub-Total	0.292	0.000	0.000	0.000	0.292	0.000	0.000	0.000	0.000	0.000	0.000
July	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Aug	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sep	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Oct	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Nov	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Dec	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Total	0.292	0.000	0.000	0.000	0.292	0.000	0.000	0.000	0.000	0.000	0.000


Page 1

Member of AEC Group (HKEX Stock Code: 8320.HK)

Notes:

- (1) The performance targets are given in the Environmental Management Plan.
- (2) The waste flow table shall also include C&D materials to be imported for use at the Site.
- (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.

Page 2

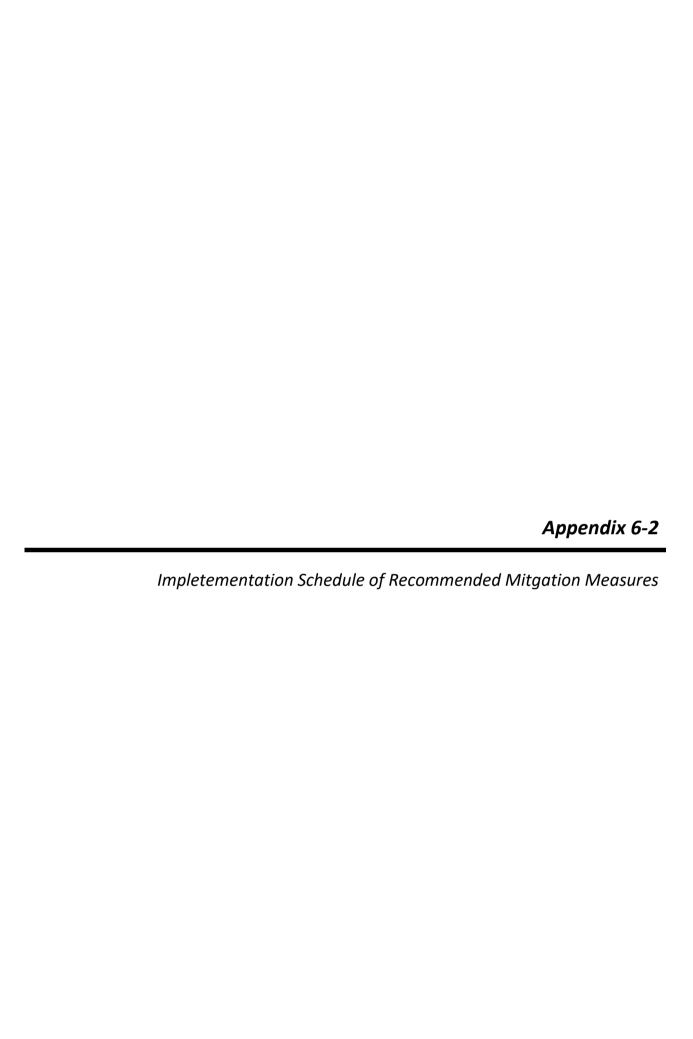

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
	ality Imp							
3.8	A1	Deodourizer should have at least 99.5% hydrogen sulfide removal efficiency.	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A2	Odourous materials (sludge, screenings and grits, worn filter) should be stored and removed in sealed tankers and containers.	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A3	Sludge should be transferred to sludge tanker by coupling method.	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A4	During release of pressure from the tanker, the odourous gas should be discharged into the sludge storage room for extraction to deodourization unit.	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A5	Regular inspection should be conducted to check for leakage of odourous gas	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A6	Maintain the removal efficiency of screenings and grits by flushing the screens and grit sump regularly to prevent build up of solids	To maintain the removal efficiency of screenings and grits	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A7	Maintain the efficiency of MBR membrane by removing organic and inorganic debris regularly	To maintain the efficiency of MBR membrane	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A8	Replace worn filter to maintain the odour removal efficiency at 99.5%	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
3.8	A9	Clean all the tanks with water regularly	To minimize odour nuisance to sensitive receivers	DSD	Sewage Treatment Plant	Throughout operational phase	Operational phase	EIAO-TM
Generi	c/Standard	1 Measures					1	
3.8	A10	Good housekeeping to minimize dust generation, e.g. by properly handling and storing dusty materials	To minimize dust generation	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A11	Adopt dust control measures, such as dust suppression using water spray on exposed soil (at least 4 times per day), in areas with dusty construction activities and during material handling	To minimize dust generation due to erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
3.8	A12	Store cement bags in shelter with 3 sides and the top covered by impervious materials if the stack exceeds 20 bags	To prevent leakage of cement	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A13	Maintain a reasonable height when dropping excavated materials to limit dust generation	To minimize dust generation during movement of excavated materials	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A14	Limit vehicle speed within construction site and in Po Toi O to 10km/hr and confine vehicle movement in haul road	To minimize dust generation due to traffic movement	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A15	Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumen	To minimize dust generation due to erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A16	Provide wheel washing at construction site exit to clean the vehicle body and wheel	To prevent dust from being brought offsite	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A17	Cover materials on trucks before leaving the construction site to prevent debris from dropping during traffic movement or being blown away by wind	To prevent falling of debris during traffic movement and by wind	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A18	Regular maintenance of plant equipment to prevent black smoke emission	To minimize black smoke emission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A19	Throttle down or switch off unused machines or machine in intermittent use	To minimize unncessary emission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A20	Minimize excavation area as far as possible	To minimize dust emission and potential release of odour from exposed ground	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A21	Store odourous excavated materials in covered containers and remove off-site as soon as possible within 24 hours	To minimize odour nuisance to sensitive receivers	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A22	Cover open stockpiles of construction materials (e.g. aggregates, sand and fill materials) with impermeable materials such as tarpaulin during rainstorms.	To prevent soil erosion under rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
3.8	A23	Hoarding of not less than 2.4 m high shall be erected from ground level to surround the construction site for sewage treatment plant along Po Toi O Chuen Road except for a construction site entrance or exit	To minimize dust emission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
3.8	A24	Carry out air quality monitoring throughout the construction period	To monitor construction dust level	DSD's Contractor	At representative ASRs	Prior to and throughout construction phase	Construction phase	EIAO-TM
3.8	I A25	Carry out regular site inspection to audit the implementation of mitigation measures	To check the implemenation status and effectiveness of mitigation measures	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
	Impact							
Project	Specific 1	Measures	Ī		***** 1		T	
4.7	N1	Use hand-held plant equipment or manual equipment within village area	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N2	For HDD, enclose the stationary plant equipment on three sides with cover. Only the side facing the sea shall be opened for heat exhaustion.	To lower noise transmission	DSD's Contractor	HDD work site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N3	Generator should be placed at a fixed location at least 5-6m away from the NSRs and screened by noise barrier whenever excavation work has to be carried out at their front doors	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7		Avoid carrying out noisy activities at the same time. The work front of village sewer installation near NSRs PTO_N1 and PTO_N3 shall not be conducted concurrently with installation of Po Toi O Chuen Road sewer and horizontal directional drilling respectively.	To mimize noise production	DSD's Contractor	Whole construction site	When the respective workfront next to the NSR is carried out	Construction phase	NCO, EIAO-TM
4.7	N5	Vibratory poker shall only be operated 4m away from NSR and with noise barrier properly erected. Surfacing work within 4m from NSR shall be carried out by manual method.	To mimize noise production	DSD's Contractor	Whole construction site	When the respective workfront next to the NSR is carried out	Construction phase	NCO, EIAO-TM
Generi	c/Standard	l Measures						
4.7	N6	Schedule noisy activities to minimise exposure of nearby NSRs to high levels of construction noise	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N7	Use Quality Powered Mechanical Equipment (QPME) which produces lower noise level	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N8	Erect 3m high mobile barriers with skid footing and a small cantilevered upper portion within a few metres of stationary plants and within about 5m of more mobile plant.	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
4.7	N9	Hand-held breaker shall be fitted with mufflers. A movable enclosure made up of plywood is proposed to surround both worker and breaker during breaking process. The internal wall of the enclosure should be laid with sound absorbent such as mineral wool.	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N10	Regular maintenance of plant equipment to prevent noise emission due to impair	To prevent noise emission due to impair	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N11	Position mobile noisy equipment in location and direction away from NSR	To minimize noise transmission to NSR	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N12	Use silencer or muffler on plant equipment and should be properly maintained	To minimize noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N13	Throttle down or switch off unused machines or machine in intermittent use between work	To mimize noise production	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N14	Make good use of stockpiles or other structures for noise screening	To minimize noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N15	Mobile plant should be sited as far away from NSRs as possible	To minimize noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N16	Reduce the percentage on-time for some noisy PMEs	To mimize noise production	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N17	Carry out noise monitoring	To monitor construction noise level	DSD's Contractor	At representative NSRs	Prior to and throughout construction phase	Construction phase	EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
	Quality I	-						
Project	t Specific 1	Measures						
5.8	1 1 1 1	Divert the water from outfall of W3 (stream near Fairway Vista) during open cut excavation for laying of gravity sewer nearby.	To prevent the excavated materials from falling into the water and being carried into the sea	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
5.8		Place sandbag along the upstream section of the stream near Fairway Vista and along rocky shore during open cut excavation for laying of gravity sewers/rising mains nearby.	To prevent the excavated materials from falling into the water and being carried into the sea	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8		Intercept the water from u-channel at the foot of the slope where the STP will be built	To prevent water from entering the construction site	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
6.8	1A//I	Install cofferdam around the proposed excavation area for entry pit of HDD work to prevent falling of debris into the sea	To prevent debris from entering the waterbodies	DSD's Contractor	HDD work site	Throughout construction phase	Construction phase	EIAO-TM
5.8	W5	Install sheet piles in marine waters by vibratory action.	To minimize dispersion of marine sediment	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
5.8	14/6	Marine works (dredging, construction and installation works at diffuser location, backfilling) shall be carried out inside the watertight cofferdam. The cofferdam can only be removed after completion of work.	To minimize dispersion of marine sediment	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
5.8		Dredging should be carried out by grab dredgers anchored outside the cofferdam. The marine sediment should be placed in sealed compartment of the marine barge.	To minimize dispersion of marine sediment	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
5.8	W/S	Water removed from the cofferdam should be desilted before discharge back into the sea.	To prevent discharge of silty water into the sea	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
5.8	W9	Carry out water quality monitoring at water sensitive receivers before and during cofferdam installation works, throughout dredging works, and during cofferdam extraction works	To identify any water quality impact due to construction works	DSD's Contractor	Water Monitoirng Stations	Before and throughout installation and extraction works of cofferdam	Construction phase	EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
5.8	W10	The following summarizes the precautionary measures for minimizing chance of emergency discharge:  • Provision of dual power by CLP;  • Equipped with Supervisory control and data acquisition system (SCADA), which signals to the operation and maintenance personnel for emergency attendance in case of plant failure;  • Provision of standby pump and screen at the PTOSTW.  • Provision of emergency generator within 4 hours by DSD's future term contractor.  • Provision of emergency storage with capacity of 4-hr sewage retention time.  • Arrangement of tankers for removing incoming sewage to other sewage treatment plants for treatment.	To prevent emergency discharge	DSD	Sewage Treatment Plant	Operational phase	Operational phase	EIAO-TM
5.8	W11	Carry out water quality monitoring at water sensitive receivers during normal operation	To identify any water quality impact due to the normal operation of the Sewage Treatment Plant (STP)	DSD	At representative WSRs	6 months before and in 1st year of operation	Operational phase	WPCO, EIAO-TM
Generi	c/Standard	d Measures						
5.8	W12	Set up sedimentation tank for settling suspended solids in wastewater before discharge into storm drains. Sand/silt removal facilities such as sand traps, silt traps and sedimentation basin should be provided with adequate capacity.	To reduce the amount of suspended solid in wastewater	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W13	Follow ProPECC PN 1/94 "Construction Site Drainage" as far as practicable	To minimize surface runoff and chance of erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W14	Construct catchpits and perimeter channels prior to commencement of site formation works and earthworks.	To stop runoff from flowing across the construction site	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W15	Maintain silt removal facilities, channels, manholes before and after rainstorm.	To prevent failure that may lead to flooding	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
5.8	W16	Remove silt and grit from silt trap at regular interval.	To prevent blockage the may lead to flooding	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W17	Well design works program to minimize the work areas to minimize the soil exposure and site runoff.	To minimize surface runoff and chance of erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W18	Arrange soil excavation works outside rainy seasons (April to September) as far as possible. If this cannot be achieved, the following measures should be implemented:  - Cover temporary exposed slope surfaces with impermeable materials, e.g. tarpaulin  - Protect temporary access roads by crushed stone or gravel  - Provide intercepting channels along crest/edge of excavation  - Carry out adequate surface protection measures well before the arrival of a rainstorm	To minimize surface runoff and chance of erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W19	Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumen	To prevent soil erosion under rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W20	Prevent rainwater from entering trenches. Excavation of trenches should be dug and backfilled in short sections during rainy seasons. Remove silt in rainwater collected from the trenches or foundation excavations prior to discharge to storm drains.	To prevent soil erosion under rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W21	Cover open stockpiles of construction materials (e.g. aggregates, sand and fill materials) with impermeable materials such as tarpaulin during rainstorms.	To prevent soil erosion under rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W22	Cover and temporary seal manholes to prevent silt, construction materials or debris and surface runoff from entering foul sewers.	To prevent overloading of foul sewers	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W23	Remove waste from the construction site regularly.	To prevent waste accumulation	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
5.8	W24	Apply discharge license for effluent discharge. Treat the discharge to comply with the requirement in TM-DSS.	To ensure compliance with effluent discharge requirement	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	WPCO, TM-DSS, EIAO- TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
5.8	W25	Reuse treated effluent onsite, e.g. dust suppression, wheel washing and general cleaning.	To minimize wastewater generation	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
5.8	W26	Monitor effluent water quality.	To ensure compliance with effluent discharge requirement	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	WPCO, EIAO-TM
5.8	W27	Register as chemical waste producer if chemical waste will be generated.	To control chemical waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM
5.8	W28	Perform maintenance of vehicles and equipment that have oil leakage and spillage potential on hard standings within a bunded area with sumps and oil interceptors.	To prevent oil leakage or spillage	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM
5.8	W29	Dispose chemical waste in accordance to Waste Disposal Ordinance. Follow the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes, examples as follows:  - Store chemical wastes with suitable containers to avoid leakage or spillage during storage, handling and transport - Label chemical waste containers according to the CoP to notify and warn the waste handlers - Store chemical wastes at designated safe location with adequate space	To avoid accident in waste storage and handling	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
5.8	W30	Provide sufficient chemical toilets with regular maintenance by registered waste collector where necessary	To proper collection of task force waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
5.8	W31	Provide a drip tray/container underneath the bentonite recycling system	To prevent any leaked bentonite from entering the watercourse or sea	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
5.8	W32	Carry out regular site inspection to audit the implementation of mitigation measures	To check the implemenation status and effectiveness of mitigation measures	DSD's Contractor	Water Monitoirng Stations	Throughout construction phase	Construction phase	EIAO-TM, APCO
5.8	W33	Carry out effluent quality monitoring at location specified in the discharge licence	To ensure compliance with effluent discharge requirement	DSD	Effluent outlet	Operational phase	Operational phase	WPCO, EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
	trial Ecol							
Project	Specific 1							
6.12	E1	Erect bright colour fencing along the boundary of the undisturbed region of the shrubland and woodland, and around <i>Diospyros vaccinioides</i> , a plant species of conservation importance, near the work boundary to remind workers not to trespass or occupy the area, and to be careful during operation of equipment.	To protect the shrub from being damaged	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
6.12	E2	Reinstate the disturbed rocky shore with the rocks temporarily removed	To restore the rocky shore habitat	DSD's Contractor	Whole construction site	After completion of works near the rocky shore	Construction phase	EIAO-TM
6.12	E3	Place sandbag around the section of W3 next to Fairway Vista and along the shore during open cut excavation for laying of gravity sewer nearby.	To prevent the excavated materials from falling into the water and being carried into the sea	DSD's Contractor	Watercourse W3	When construction work is carried out in the vicinity of W3	Construction phase	EIAO-TM
6.12	E4	Temporarily divert the water from outfall of W3 away from excavation area.	To prevent the excavated materials from falling into the water and being carried into the sea	DSD's Contractor	Watercourse W3	When construction work is carried out in the vicinity of W3	Construction phase	EIAO-TM
6.12	E5	Inspect the condition of the <i>Diospyros vaccinioides</i> near the work boundary as part of weekly site audit	To inspect the condition of the Diospyros vaccinioides	DSD's Contractor	The <i>Diospyros</i> vaccinioides near the work boundary	Throughout construction phase	Construction phase	EIAO-TM
Generic	c/Standard	l Measures						
6.12	E6	Erection of hoarding, fencing or provision of clear demarcation of work zones	To remind workers not to damage area outside the work boundary	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
6.12	E7	Designate areas for placement of equipment, building materials and wastes away from the natural environment	To prevent damage on the natural environment	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
6.12	I HX	Carry out tree preservation and compensatory tree planting will be carried out in accordance with DEVB TCW No. 7/2015.	To reinstated woodland habitat	DSD's Contractor	Whole construction site	After completion of works near woodland	Construction phase	EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
	Manager							
Project	t Specific 1	Measures		1		I	I	I
9.8	WM1	Sludge will be delivered by sealed sludge tanker for treatment at Sludge Treatment Facilities.	To prevent odour nuisance	DSD	STP	Throughout operational phase	Operational phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM
9.8	WM2	Debris from screening process and general refuse should be stored within the STP in sealed container and be disposed of at landfill regularly.	To prevent odour nuisance	DSD	STP	Throughout operational phase	Operational phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM
9.8	WM3	Worn filters and MBR membrane shall be stored and labelled as in construction phase. Chemical wastes shall be treated at chemical treatment facility by licensed contractor.	To prevent odour nuisance	DSD	STP	Throughout operational phase	Operational phase	Waste Disposal Ordinance, EIAO-TM
Generi	ic/Standard	1 Measures						
9.8	WM4	Allocate an area for waste sorting and storage of C&D materials into the following categories for reuse, recycle or disposal if possible. Remove waste from the construction site for sorting once generated if no suitable space can be identified.  - excavated materials suitable for reuse - inert C&D materials (or public fill) for disposal offsite - non-inert C&D materials (or C&D waste) for disposal at landfills - chemical waste - bentonite slurry for reconditioning and reuse - general refuse	To minimize waste generation	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
		Adopt good site practice as follows: - Provide training to workers on site cleanliness, waste management (waste reduction, reuse and recycle) and chemical handling procedures						n Waste Disposal Ordinance, EIAO-TM   Maste Disposal Ordinance, EIAO-TM
9.8	WM5	<ul> <li>Provide sufficient waste collection points and regular removal</li> <li>Cover waste materials with tarpaulin or in enclosure during transportation</li> <li>Maintain drainage systems, sumps and oil interceptors</li> <li>Sort out chemical waste for proper handling and treatment</li> </ul>	To proper handling of waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	^
9.8	WM6	onsite or offsite  Adopt waste reduction measures as follows:  - Allocate area/containers for sorting, recovering and storing waste for reuse, recycle or disposal (e.g. demolition debris and excavated materials, general refuse like aluminium cans.)  Remove waste from the construction site for sorting once generated if no suitable space can be identified.  - Allocate area for proper storage of construction materials to prevent contamination  - Minimize wastage through careful planning and avoiding overpurchase of construction materials	To minimize waste generation	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	^
9.8	WM7	Prepare and implement a site specific Waste Management Plan (WMP) as part of Environmental Management Plan (EMP) in accordance with ETWB TCW No. 19/2005. Detail waste management method in the form of avoidance, reuse, recovery, recycling, storage, collection, treatment and disposal according to the recommendations on the EIA and EM&A Manual. It should be approved by the ER and regularly reviewed.	To provide guidance to waste management	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ETWB TCW No. 19/2005, EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
9.8	WM8	Store waste materials properly as follows:  - Avoid contamination by proper handling and storing waste  - Prevent erosion by covering waste  - Apply water spray on excavated materials  - Maintain and clean storage area regularly  - Sort and stockpile different materials at designated location to enhance reuse	To properly store waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
9.8	WM9	Apply for relevant waste disposal permits in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste) Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28), Dumping at Sea Ordinance (Cap. 466).	To properly dispose waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste) Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28), Dumping at Sea Ordinance (Cap. 466), EIAO-TM
9.8	WM10	Hire licensed waste disposal contractors for waste collection and removal. Dispose waste at licensed waste disposal facilities	To properly dispose waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
9.8	WM11	Implement trip-ticket system for recording the amount of waste generated, recycled and disposed, including chemical wastes	To monitor movement of waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation, Waste Disposal Ordinance, EIAO-TM
9.8	WM12	Provide wheel washing at construction site exit to clean the vehicle body and wheel	To prevent dust from being brought offsite	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO- TM
9.8	WM13	Reduce water content in wet spoil generated from piling work by mixing with dry materials. Only dispose treated spoil with less than 25% dry density to Public Fill Reception Facilities	To minimize load to reception facilities	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
9.8	WM14	Dispose dry waste or waste with less than 70% water content by weight to landfill	To minimize load to reception facilities	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
9.8	WM15	Follow the Code of Practice on the Packaging, Labelling and Storage of Chemical Waste as follows:  - Store chemical wastes with suitable containers. Seal and maintain the container to avoid leakage or spillage during storage, handling and transport  - Label chemical waste containers in both English and Chinese with instructions in accordance to Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation  - The container capacity should be smaller than 450 litres unless	To avoid accident in waste storage and handling	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
9.8	WM16	agreed by the EPD  Comply with the requirement of the chemical storage area:  - Store only chemical waste and label clearly the chemical characters of the waste  - Have at least 3 sides enclosed and protected from rainfall with cover  - Provide sufficient ventilation  - Have impermeable floor and has bunds to contain 110% of the capacity of the largest container or 20% of the total volume of the stored waste in the area, whichever is larger  - Adequately spaced incompatible materials	To ensure proper storage of chemical waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
9.8		Transfer used lubricants, waste oils and other chemicals to oil recycling companies, if possible, and empty oil drums for reuse or refill. No direct or indirect discharge is permitted	To ensure proper disposal of chemical waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM
9.8	WM18	Hire licensed chemical waste disposal contractors for waste collection and removal. Dispose chemical waste at the approved Chemical Waste Treatment Centre at Tsing Yi or other licensed facility	To ensure proper disposal of chemical waste	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM
9.8	WM19	Hire reputable waste collector to separately collect and dispose general refuse from other wastes. Cover the waste to prevent being blown away	To ensure proper disposal of general refuse	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation, EIAO-TM

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
9.8	WMOO	Provide recycling bins for sorting out recyclables for collection by recycling companies. Non-recyclables should be removed to designated landfills every day by licensed collectors to prevent environmental and health nuisance.	To ensure proper recycling and disposal of general refuse	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	Waste Disposal Ordinance, EIAO-TM
9.8	WM21	Organize training and reminders to site staff on waste minimization through avoidance and reduction, reusing and recycling	To ensure proper management of general refuse	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
9.8	WM22	Used bentonite shall be reconditioned onsite and reused as far as practical to minimize wastage. If this is deemed not viable, the used bentonite shall be delivered offsite for reconditioning.	To minimize wastage of bentonite	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM
9.8	WM23	Characterize the sediment quality of the marine sediment to be dredged and submit a Sediment Quality Report for EPD's approval. Dispose the dredged marine sediment in accordance with ETWB TC(W) No. 34/2002	To verify the categories of sediment to be disposed in accordance with ETWB TC(W) No. 34/2002		To be allocated by CEDD	Before dredging works	Construction phase	ETWB TC(W) No. 34/2002

EIA Ref.	Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
	cape & Vi							
Table 10-6	CM8	Protective materials to be provided to natural rocky coastline to prevent damage to existing landform from plant and machinery during temporary drilling operations. Reinstatement following removal of plant & equipment to original or improved condition shall be undertaken.	To protect landscape resources		Temporary drilling site for submarine outfall	Construction planning and during construction period	Construction phase	Particular Specification
Table 10-7	OM1	Sensitive design of sewage treatment plant in terms of scale, height and bulk (visual weight) to integrate the building into the existing topography.	To mitigate visual impact	DSD's Design Architect/ Engineer	STP	Design Phase	Design Phase	Detailed Design Drawings and Specifications
				DSD's Design Architect/ Engineer		Design Phase		
Table 10-7	OM2	Use of appropriate building materials and colours for Sewage Treatment Plant to complement surroundings	To mitigate visual impacts	DSD's contractor	STP	Construction Phase & first year in Operational Phase	Design, Construction and Operational Phases	Detailed Design Drawings and Specifications
<u> </u>	-/041	1		Building Operator/DSD		Operational phase		
Generi	c/Standard	1 Measures	Т	I	STP, along	T	I	
Table 10-6	CM1	The construction area and contractor's temporary works areas should be minimised to avoid impacts on adjacent landscape.  All slope excavation shall take place from within the work boundary to minimise impacts on adjacent slopes.	To avoid impact on adjacent landscape areas	DSD's contractor	gravity sewers and rising mains		Construction phase	Detailed Design drawings and particular specifications
Table 10-6	CM2	Reduction of construction period to practical minimum	To minimise duration of impact	DSD's contractor	N/A	Construction planning and during construction period	Construction phase	N/A


EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
Table 10-6	CM3	Construction traffic (land and sea) including construction plant, construction vessels and barges to be kept to a practical minimum.	To minimize visual impacts to local residents and surrounding VSRs	DSD's contractor	STP, along gravity sewers and rising mains construction route at temporary drilling and dredging sites for submarine outfall	Construction planning and during construction period	Construction phase	As per the Particular Specification
Table 10-6	CM4	Erection of decorative mesh screens or construction hoardings and/or temporary noise barriers around works areas in visually unobtrusive colours.	To screen construction works from local residents and surrounding VSRs	DSD's contractor	STP, along gravity sewers and rising mains construction route and at temporary drilling site for submarine outfall	Construction planning and during construction period	Construction phase	As per the Particular Specification
Table 10-6	CM5	Avoidance of excessive height and bulk of site buildings and structures.	To reduce visual impact	DSD's contractor	STP, and at temporary drilling site for submarine outfall	Construction planning and during construction period	Construction phase	As per the Particular Specification
Table 10-6	CM6	Control of night-time lighting by hooding all lights and through minimisation of night working periods.	To maximize screening of the works	DSD's contractor	STP and at temporary drilling and dredging site for submarine outfall	Construction planning and during construction period	Construction phase	As per the Particular Specification

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
Table 10-6	CM7	All existing trees shall be carefully protected during construction. A Detailed Tree Protection Specification shall be provided in the Contract Specification. Under this specification, the Contractor shall be required to submit, for approval, a detailed working method statement for the protection of trees prior to undertaking any works adjacent to all retained trees, including trees in contractor's works areas. Tree risk assessment shall be undertaken to all existing trees within the project site as per "Guidelines for Tree Risk Assessment and Management Arrangement"	To maximize protection of existing trees	DSD's contractor	STP and all other construction areas	Construction planning and during construction period	Construction phase	As per Tree Protection Particular Specification, DEVB TC (W) No.10/2013 and Guidelines for Tree Risk Assessment and Management Arrangement
Table 10-7	OM3	Lighting units to be directional and minimise unnecessary light spill and glare.	To mitigate visual impacts	DSD's Design Architect/ Engineer  DSD's contractor  Building Operator/DSD	STP	Design Phase  Construction Phase & first year in Operational Phase  Operational phase	Design, Construction and Operational Phases	Detailed Design Drawings and Specifications
Table 10-7	OM4	Greening measures to reinstate the landscape which are appropriate to the context, including tree and shrub planting and vertical greening, shall be implemented.	To mitigate visual impacts	DSD's Design Landscape Architect  DSD's contractor  Building Operator/DSD	STP	Design Phase  Construction Phase & first year in Operational Phase  Operational phase	Design, Construction and Operational Phases	Detailed Design Drawings and Specifications

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
		Compensatory tree planting for all felled trees shall be provided to the satisfaction of relevant Government departments.		DSD's Landscape Architect	STP and at	Design Phase	<b>.</b>	As per approved Tree Removal Application, Detailed Design
Table 10-7	OM5	Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under the relevant technical circulars. Tree risk assessment shall be undertaken to all existing trees within the project site as per "Guidelines for Tree	To mitigate landscape and visual impacts of tree loss	Contractor's Landscape Architect	temporary drilling site for submarine outfall	Construction Phase & first year in Operational Phase	Design, Construction and Operational Phases	Drawings, Tree Protection Particular Specification and Guidelines for Tree Risk Assessment and Management
		Risk Assessment and Management Arrangement"		Building Operator/DSD		Operational phase		Arrangement

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relveant Legislation & Guidelines
Built I	Heritage							
Project	Specific 1	Measures						
11.6	BH1	Undertake condition survey by professional qualified building surveyor or engineer to record the existing condition of the built heritage resources.	To record the condition of the built heritage resources before the commencement of construction works	DSD's Contractor	GB01, BH02, LF04	Before commencement of construction works	Construction phase	EIAO-TM and Guidelines for CHIA
11.6		Carry out vibration and settlement monitoring to built heritage resources. A maximum vibration level 7.5mm/s shall be adopted for the Grade 3 Hung Shing Temple and settlement check points in the Alert/Alarm/Action limit levels at 6mm/8mm/10mm shall be adopted.	To minimise the potential impact by mechanical vibration and settlement of built heritage resources		GB01, BH02, LF04	During construction works	Construction phase	EIAO-TM and Guidelines for CHIA
11.6	ВН3	Provision of protective covering or protective screen to built heritage resources which are close to the works area	To prevent direct impact from the machine and damages by construction tools or waste	DSD's Contractor	GB01, BH02, LF01, LF04	During construction works	Construction phase	EIAO-TM and Guidelines for CHIA
11.6	BH4	Maintain public access to the cultural landscape features as far as possible	To avoid the proposed works affecting the worshippers	DSD's Contractor	LF01, LF04, LF05	During construction works	Construction phase	EIAO-TM and Guidelines for CHIA
11.6	ВН5	Provision of buffer zone of at least 1m from the proposed works as far as possible	To prevent any direct and indirect impact	DSD's Contractor	BH02, LF01, LF04	During construction works	Construction phase	EIAO-TM and Guidelines for CHIA

<sup>\*</sup> All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project

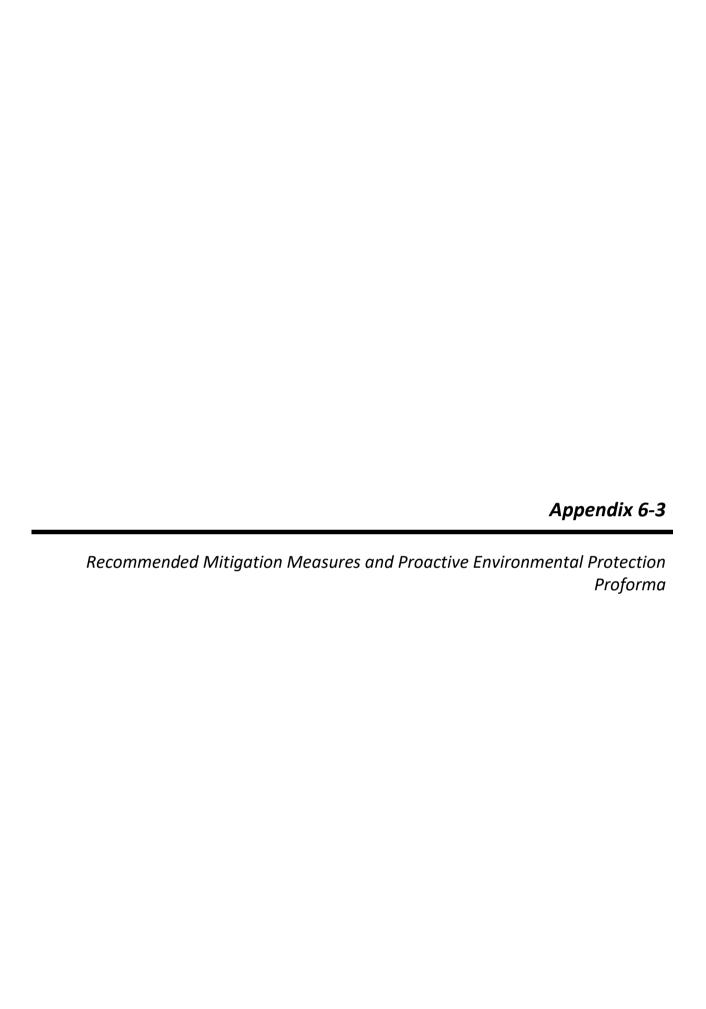

#### **Appendix 6-3 Recommended Mitigation Measures and Proactive Environmental Protection Proforma**

Reporting Period: 2022-04-01 - 2022-04-30

Construction Works Area: PTO-SW-03, PTO-Trenchless -01& STP

Anticipated Impacts: Dust, Noise, Water Quality, Terrestrial Ecology, Marine Ecology, Fisheries, Waste Management, Landscape and Visual and Build Heritage

Impact.

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
Air Quality Impact	3.8	A10 - A25	a) Major air quality impact in construction phase would arise from excavation of slope at the proposed sewage treatment plant. b) Excavation, Gas welding, slope cutting, Rock dowel, fencing, flexible barrier installation Loading & Unloading Dusty Materials storage, Dusty Waste Sorting, Temporary Site Traffic Control	<ul> <li>a) All construction plants / machineries will be checked / serviced on a regular basis during the courses of construction to minimize the emission of noise generation and eliminate dark smoke emission</li> <li>b) All dump trucks will be equipped with mechanical covers to prevent the dust emission during transportation when necessary.</li> <li>c) Dust control measures, such as water spraying, will be provided during</li> </ul>	<ul> <li>(a) Hoarding of not less than 2.4 m high shall be erected from ground level to surround the work area along Po Toi O Chuen Road except for a site entrance or exit.</li> <li>(b) Good housekeeping to minimize dust generation, e.g. by properly handling and storing dusty materials.</li> <li>(c) Adopt dust control measures, such as dust suppression using water spray on exposed soil at least 4 times a day, in areas with dusty construction activities and during material handling.</li> <li>(d) Minimize exposed earth after completion of work in a</li> </ul>	Contractor	<ul> <li>a) 1-hour and 24-hour TSP levels will be measured in accordance to the standard high-volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix A.</li> <li>b) Due to objection from the residents of Po Toi O village of the use of high-volume sampler (HVS) in conducting 24-hours TSP measurement, 24-hour TSP measures for impact monitoring is to be measured by portable dust meters during construction phase of the project. This is to be approved and verified by ER and IEC.</li> </ul>

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
				demolition works when necessary.  d) Maintaining of wet surface on access road and keep slow speed in the site.  e) Conditions in the Environmental Permit and Discharge License should be followed  f) Predict required quantity of concrete accurately and collect the unused fresh concrete at designated locations in the site for subsequent disposal.  g) Provide sufficient mitigation measures as recommended in approved EIA Manual requirement.	certain area by hydroseeding, vegetating, soil compacting or covering with bitumen.  (e) Provide wheel washing at site exit to prevent carrying dust outside of the site.  (f) Cover materials on trucks before leaving the site.  (g) Limit vehicle speed of construction trucks within the construction site and in Po Toi O, maximum at 10km/hr, and confine vehicle movement in haul road.  (h) As there is limited space in Po Toi O, stockpiling should be avoided. However, if found necessary, the materials should be covered by impervious materials such as tarpaulin.		<ul> <li>c) Other than using high volume sampler, 1-hour TSP levels can be measured alternatively by direct reading from portable dust meters upon approval from ER. The meters should be capable of producing comparable results as that by the high-volume sampling method, to indicate short event impacts.</li> <li>d) -The ET shall agree with the IEC on the monitoring position and the corrections adopted.</li> <li>e) -The agreed position shall be chosen in subsequent baseline and impact monitoring.</li> </ul>

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	N	orresponding 1itigation 1easures	EM&A Manual Recommended Mitigation/ Actions	Action By		easurement ocedures/Methods
Noise Impact Control	4.7	N1 - N17	a) The Project comprises three main works including the construction of sewage treatment plant (STP), underground sewers and rising main, and the submarine outfall	a)	Conditions in the Environmental Permit and Discharge License should be followed		Contractor	a)	Noise measurement shall normally be at a point 1 m from the exterior of the sensitive receiver building façade and be at a position 1.2 m above the ground. If the normal monitoring
			<ul> <li>b) The major noise impact will arise from the use of powered mechanical equipment.</li> <li>c) Excavation, Gas welding, slope cutting, Rock dowel, fencing, flexible barrier</li> </ul>	b)	Provide sufficient mitigation measures as recommended in approved EIA Manual requirement.				position cannot be accessed, an alternative position may be chosen, and a correction to the measurements shall be made. For reference, a correction of +3 dB(A) shall be made to the free field measurements.
			installation Loading & Unloading Dusty Materials storage, Temporary Site Traffic Control					b)	The ET shall agree with the IEC on the monitoring position and the corrections adopted.
								c)	The agreed position shall be chosen in subsequent baseline and impact monitoring.

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	N	orresponding 1itigation 1easures	EM&A Manual Recommended Mitigation/ Actions	Action By		easurement ocedures/Methods
Water Quality impact	5.8	W1 - W33	a) Major Water quality impact will be originated from minor displacement of suspended solids during installation, testing pipe and extraction of cofferdam around the proposed diffuser.	b)	Wastewater to be treated by wastewater treatment facilities before discharge Conditions in the Environmental Permit and Discharge License should be followed	<ul> <li>(a) Well manage construction materials, chemicals, sewage for proper storage and usage and to prevent accumulation onsite.</li> <li>(b) Immediately clean up contaminated soil upon chemical and oil leakage.</li> <li>(c) Label chemical waste containers according to the Code of Practice to notify and warn the waste handlers. Store fuels, chemicals and chemical waste at designated area with</li> </ul>	Contractor	a) b)	Weekly site audit to monitor the implementation of the proposed water quality mitigation measures and check the Contractor's work practice on water pollution prevention during construction phase.  Should water pollution is observed (e.g. discharge of silty water into storm drains), the ET should record the environmental deficiency for investigation. The Contractor should be notified and responsible for carrying out rectification work immediately.
						locks and bunds.  (d) Register as chemical waste producer.  (e) Set up sedimentation tank for settling suspended solids in		d) e)	The ET shall re-inspect the Project Site and review the effectiveness of the remedial measure performed until satisfaction.  The Contractor shall
						wastewater before discharge into storm			implement preventive

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
					drains. Sand/silt removal facilities such as sand traps, silt traps and sedimentation basin should be provided with adequate capacity.  (f) Provide sufficient number of chemical toilets if necessary and employ licensed contractor for regular clean-up and maintenance.		measure to avoid causing the same problem.
					(g) Provide wheel washing at site exit to prevent dust and silty water from leaving the construction site. (h) Cover slope and loose materials with tarpaulin before rainstorm and inspect the area afterwards.  (i) Cover manhole to prevent silt, construction		
					prevent silt, construction materials or debris and surface runoff from entering the foul sewer.		

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
	Ref.	Ref.					Procedures/Methods

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
Terrestrial Ecology	6.12	E1-E8	<ul> <li>a) The proposed Project will cause minor habitat loss of shrubland, temporary habitat loss of woodland, developed area and rocky shore, and removal of one individual climber species of conservation importance that is common within the Study Area and Hong Kong. Indirect water quality impact may arise from surface runoff or accidental spillage of chemicals in construction phase.</li> <li>b) Use of powered plant equipment may bring noise disturbance on wildlife.</li> </ul>	a) Conditions in the Environmental Permit and Discharge License should be followed b) Provide sufficient mitigation measures as recommended in approved EIA Manual requirement.	a) Construction noise and water quality mitigation measures proposed in the previous sections will be applicable to terrestrial ecology.	Contractor	(a)Bright colour fencing shall be erected along the boundary of the undisturbed region of the shrubland and woodland, and around <i>Diospyros vaccinioides</i> , a plant species of conservation importance, near the work boundary to remind workers not to trespass or occupy the area, and to be careful during operation of equipment.  (b)Inspect the condition of <i>Diospyros vaccinioides</i> as part of weekly site audit.  (c) Reinstate the disturbed rocky shore with the rocks temporarily removed.  (d) Carry out compensatory tree planting in accordance with DEVB TCW No. 7/2015 to reinstate the affected woodland.

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item EIA	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
Marine Ecology 7	7	<ul> <li>a) The proposed Project will cause minor habitat loss of muddy seabed.</li> <li>b) Indirect water quality impact may arise from installation and extraction of sheet pile of cofferdam in construction phase.</li> <li>c) Dredging and backfilling for installation of diffuser will be conducted inside fully enclosed cofferdam. No marine sediment loss to water column is expected.</li> </ul>	a) Conditions in the Environmental Permit and Discharge License should be followed	a) The variation in water quality at coral and amphioxus habitats during cofferdam installation and extraction works will be overseen by water quality monitoring mentioned.	Contractor	a) No specific monitoring and audit programme is required. With proper implementation of water quality mitigation measures, residual impact is expected to be acceptable.

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
Fisheries	8	8	<ul> <li>a) No direct encroachment on Fish Culture Zone and Artificial Reefs in the Study Area is expected.</li> <li>b) About 1,920 m² of fishing ground and 500 m² of benthic spawning ground will be affected. Except the 5 m² benthic spawning ground will be lost permanently, other impacted area will only be affected in construction phase temporarily (reversible impact). Indirect impact on fisheries resources by the water quality deterioration will be insignificant with proper implementation of water quality mitigation measures.</li> </ul>	a) Conditions in the Environmental Permit and Discharge License should be followed	Water quality at FCZ will be monitored during cofferdam installation and extraction works and dredging works in the construction phase as proposed.	Contractor	a) No specific monitoring and audit programme are required. With proper implementation of water quality mitigation measures, residual impact is anticipated to be acceptable.

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
Waste Management	9.8	WM4- WM23	a) Construction of the sewage treatment plant, laying of gravity sewers and rising mains and submarine outfall are expected to generate mainly inert construction and demolition (C&D) materials (or public fill) from excavation, and unused building materials. Other wastes include noninert C&D materials (or C&D waste), plant materials, scaffolding, formwork and packaging, chemical waste from plant maintenance, bentonite slurry from drilling works and general refuse from workers.  b) Dredging at the proposed diffuser location will generate marine sediment.	a) All C&D materials generated will be transported and stored at temporary storage area. Cover will be provided during transportation of dusty materials. Suitable materials will be sorted for reuse on-site. Only non-inert C&D material will be disposed off- site to NENT Landfill. b) Conditions in the Environmental Permit and Discharge	<ul> <li>(a) Reuse C&amp;D materials onsite and dispose excess uncontaminated ones to public fill.</li> <li>(b) Provide sufficient waste collection points for general refuse and regularly maintained to avoid accumulation. Dispose the waste at waste transfer or disposal facilities.</li> <li>(c) Minimize wastage through careful planning and avoiding overpurchase of construction materials.</li> <li>(d) Provide training to workers on site cleanliness, waste management (waste reduction, reuse and recycle) and chemical handling procedures.</li> <li>(e) Hire licensed waste disposal contractors for</li> </ul>	Contractor	The Contractor should apply for relevant licences/permits for waste disposal under different regulations and ordinances as follows:  (a) Chemical Waste Permits/licenses under the Waste Disposal Ordinance (Cap 354); (b) Public Dumping Licence under the Land (Miscellaneous Provisions) Ordinance (Cap 28); (c) Marine Dumping Permit under Dumping at Sea Ordinance (Cap 466); and (d) Effluent Discharge Licence under the Water Pollution Control Ordinance (Cap 358).  b) Reference should be made to EPD's booklets on licences/permits. The Contractor shall also document recycling receipts/ disposal record to keep track of waste movement. The ET shall check with the Contractor

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant


Item	EIA Ref.	EM&A Ref.	Environmental Aspect	Corresponding Mitigation Measures	EM&A Manual Recommended Mitigation/ Actions	Action By	Measurement Procedures/Methods
				c) Fueling of equipment will be conducted carefully onsite by mobile tanker to avoid storage of fuel and oil spillage.  d) Provision of drip trays for equipment likely cause spillage of chemical / fuel, and provide routine maintenance.	waste collection and removal. Dispose waste at licensed waste disposal facilities.  (f) Recondition and reuse bentonite as far as practical.  (g) Conduct marine sediment test and dump dredged marine sediment according to ETWB TCW No. 34/2002 Management of Dredged/Excavated Sediment and Dumping at Sea Ordinance.  (h) Chemical waste shall be handled, stored and disposed properly, according to the relevant guidelines.		that these licences/permits have been obtained. He should also review the above documentations regularly to ensure compliance with legislations and specifications.

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

	ГІЛ	EN 10 A	Environmental Aspect		Corresponding Mitigation Measures		1&A Manual		D 4		
Item	EIA Ref.	EM&A Ref.					commended itigation/ Actions	Action By	Measurement Procedures/Methods		
Landscape and Visual impact	Table 10-6 & 10- 7	CM1- CM8 & OM1- OM5	impact is expected due to dredging work in open sea, construction of the STP and pipelines on land and the loss of existing trees and vegetation at the sewage treatment plant site in the	b)	Conditions in the Environmental Permit and Discharge License should be followed  Implement the recommended mitigation proposed in EM&A manual	a)	The contractor shall employ a professionally qualified Registered Landscape Architect (RLA) on the Environmental Team to supervise and monitor the implementation of construction phase landscape and visual mitigation measures. This is necessary to ensure that all the recommended landscape and visual mitigation measures under Chapter 10 of the EIA are effectively implemented including minimization of the works footprint, ensuring that those existing trees earmarked for retention on site or transplanting are protected and planting works are correctly implemented.	Contractor	(a)	be undertaken by the contractor during construction to all existing trees within the project site as per "Guidelines for Tree Risk Assessment and Management Arrangement".	

Project No. 1825
Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

Item	EIA Ref.	EM&A Ref.	Environmental Aspect	M	orresponding litigation leasures	Re	//&A Manual ecommended itigation/ Actions	Action By	Measurement Procedures/Methods
Build Heritage	11.6	BH1 - BH5	a) As the proposed work is close to some of the identified built heritage resources, condition survey, vibration and settlement monitoring are recommended to identified built heritage to prevent indirect damage by mechanical vibration and settlement.	(a)	Conditions in the Environmental Permit and Discharge License should be followed Provide sufficient mitigation measures as recommended in approved EIA Manual requirement.	a) b)	Provision of protective covering or protective screen is recommended to identified built heritage to prevent damages by construction tools or waste.  Maintenance of public access is suggested for identified built heritage. Besides, buffer zone of at least 1m from the works boundary should be provided for identified built heritage as far as possible.  Condition survey, vibration and settlement monitoring to identified built heritage.	Contractor	a) A maximum vibration level of 7.5mm/s shall be adopted for the Grade 3 Hung Shing Temple and settlement check points in the Alert/Alarm/Action limit levels at 6mm/8mm/10mm shall be adopted.

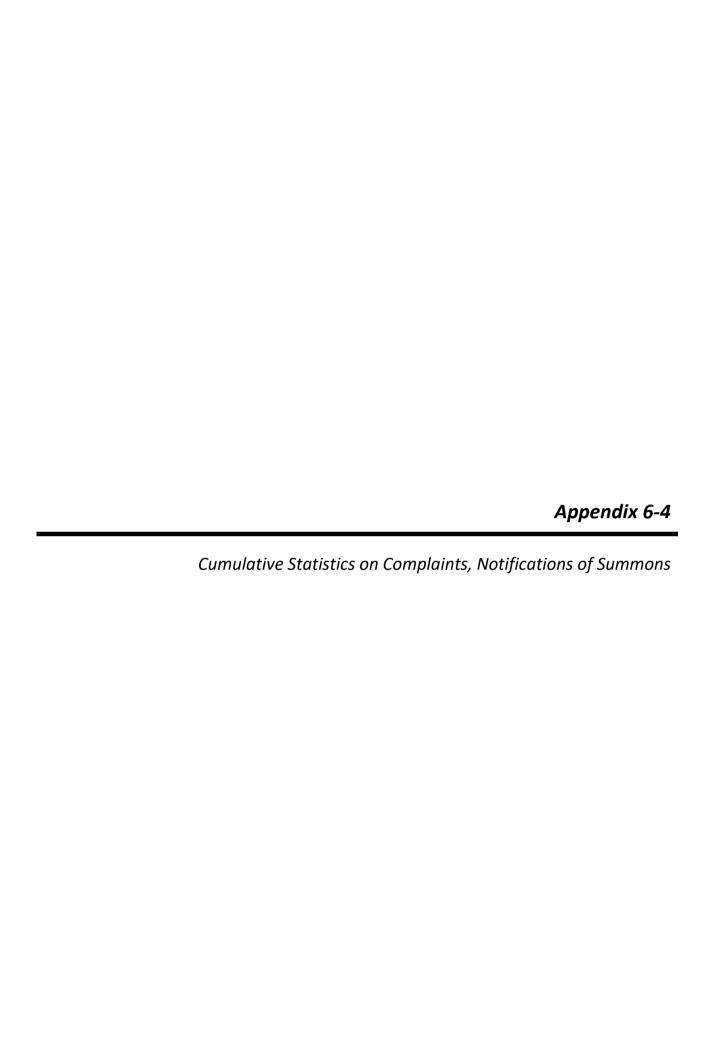

#### Appendix 6-4 Cumulative Statistics on Complaints, Notifications of Summons, Successful Prosecutions and Public Engagement Activities

#### **Environmental Complaints Log**

Complaint Log No.	Date of Complaint	Received From	Received By	Nature of Environmental Complaint	Relevant to the Construction Work of Project Site? (Y/N)	Investigation/ Mitigation Action	Status
001	28 December 2021	EPD	ET	Waste Management	N	The investigation report was submitted on 7 January 2022	Closed

#### Remark:

#### **Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions and Public Engagement Activities**

Reporting Period	Complaints	Notifications of Summons and Prosecutions	Public Engagement Activities		
This Month	0	0	0		
Cumulative Project-to-Date	1	0	0		

<sup>\*</sup> No complaints, Notifications of Summons, or Successful Prosecutions were received in the reporting period.