

Drainage Services Department

Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O Monthly EM&A Report (November 2023)

Prepared by SGS Hong Kong Limited

Certified by:

Verified by:

Johnathan Ho

Janbberg

F.C. Tsang

Environmental Team Leader Independent Environmental Checker

SGS Hong Kong Ltd. Units 303 & 305, 3/F, Building 22E Phase 3, Hong Kong Science Park Pak Shek Kok, New Territories Hong Kong, China



Drainage Services Department Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O Monthly EM&A Report (Period from 1 to 30 November 2023)

Prepared by

Drainage Services Department

SGS Hong Kong Limited

Issue and Revision Record

Revision	Description	Prepared by	Checked by	Approved by	Date
01	Submission	Various	Johnathan Ho	Grace Fung	Dec 2023

Disclaimer

This document is issued by the Company under its General Conditions of Service accessible at <u>http://www.sgs.com/en/Terms-and-Conditions.aspx</u>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

202	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	3
	Works at Po Toi O	Ref#	EMA2204/03/27
DUD	Monthly EM&A Report	Rev.	01
		Date	Dec 23

TABLE OF CONTENT

1.	EXECUTIVE SUMMARY	4			
2.	INTRODUCTION	6			
3.	AIR QUALITY	9			
4.	NOISE	.17			
5.	WATER QUALITY	.21			
6.	WASTE MANAGEMENT	.24			
7.	ENVIRONMENTAL SITE INSPECTION AND AUDIT	.25			
8.	FUTURE KEY ISSUES	.29			
9.	CONCLUSION	.30			
FIGUI	RE 2-1 – LAYOUT PLAN OF THE CAPTIONED PROJECT				
FIGUI	RE 3-1 PROPOSED AIR QUALITY AND NOISE MONITORING STATIONS LOCATIONS				
FIGUI	RE 5-1 LOCATIONS OF WATER QUALITY IMPACT MONITORING STATIONS				
APPE	NDIX A – PROJECT ORGANIZATION CHART				
APPE	NDIX B – CONSTRUCTION PROGRAMME				
APPE	NDIX C – METEORLOGICAL DATA				
APPE	NDIX D – AIR QUALITY MONITORING EQUIPMENT CALIBRATION CERTIFICATES				
	NDIX E – METHODOLOGY FOR CORRELATION CALCULATION BETWEEN POTABLE LASE	R DUST METER AND			
APPE	NDIX F – AIR QUALITY AND NOISE IMPACT MONITORING SCHEDULE				
APPE	NDIX G – AIR QUALITY MONITORING RESULT				
APPE	NDIX H – EVENT AND ACTION PLAN				
APPENDIX I - NOISE MONITORING EQUIPMENT CALIBRATION CERTIFICATES					
APPENDIX J - NOISE IMPACT MONITORING RESULT					
APPENDIX K – WATER QUALITY MONITORING SCHEDULE					
APPENDIX L – MONTHLY SUMMARY OF WASTE FLOW					
APPE	APPENDIX M - IMPLEMENTATION SCHEDULE OF RECOMMENDED MITIGATION MEASURES				
APPENDIX N - RECOMMENDED MITIGATION MEASURES AND PROACTIVE ENVIRONMENTAL PROTECTION PROFORMA					
APPE	NDIX O - CUMULATIVE STATISTICS ON COMPLAINTS, NOTIFICATIONS OF SUMMONS				



1. EXECUTIVE SUMMARY

- 1.1 The proposed sewerage works in Po Toi O (hereafter as "the Project") is an environmental enhancement project that aims to improve environmental hygiene of the Po Toi O area. The Environmental Impact Assessment (EIA) Report for the Project (Register No: AEIAR-206/2017) was approved on 27 January 2017. The Environmental Permit (EP) (Permit No.: EP-516/2016) was issued on 27 January 2017 and is the current permit for the Project.
- 1.2 Société Générale de Surveillance (SGS) Hong Kong Limited has been appointed by Drainage Services Department (DSD) under service contract no. SD 3/2022 as the Environmental Team (ET) to undertake the EM&A programme during construction phase of the Project in accordance with the approved EM&A Manual for the Project.
- 1.3 This is the 33rd monthly Environmental Monitoring & Audit (EM&A) Report prepared by SGS for the Project. This report summarized the monitoring results and audits findings of the EM&A programme under the EP and the EM&A Manual of the Project during the reporting period of 1 November 2023 to 30 November 2023.

Key Construction Works During the Reporting Period

- 1.4 The main works undertaken during the reporting period are as follows:
 - Major activities in the reporting month:
 - a) Construction of village sewer;
 - b) Slope works;
 - c) Construction of ELS for Po Toi O Sewage Treatment Plant

Summary of Exceedances, Investigation and Follow-up

1.5 There was no action or limit level exceedance record of construction noise and air quality was recorded in the reporting month.

Complaint Handling, Prosecution and Public Engagement

- 1.6 No complaints, notification of summons and successful prosecution was received in the reporting period. No public engagement activity was conducted in the reporting month.
- 1.7 No notification of summons and successful prosecution was received in the reporting period. No public engagement activity was conducted in the reporting month.
- 1.8 No air quality, noise and water complaints was received in the reporting month.



Reporting Change of EM&A Programme

1.9 No reporting change of the EM&A programme in this reporting month.

Future Key Issues

1.10 The main works will be anticipated in the next reporting period are as follows:

-Major activities in the upcoming month:

- Construction of village sewer;
- Slope works;
- Construction of ELS for Po Toi O Sewage Treatment Plant;
- Construction of Cofferdam;
- Pilot Drilling of HDD



2. INTRODUCTION

Project Information

2.1 Société Générale de Surveillance (SGS) Hong Kong Limited has been appointed by Drainage Services Department (DSD) as the Environmental Team (ET) to undertake the EM&A programme during construction phase of the Project in accordance to the approved EM&A Manual for the proposed sewerage works in Po Toi O (hereafter as "The Project"), an environmental enhancement project that aims to improve environmental hygiene of the Po Toi O area.

Project Background

- 2.2 Po Toi O is located in the southern part of Sai Kung District, next to Clear Water Bay. There is a small settlement called Po Toi O village around the bay. There is currently no public sewerage system for the village. Sewage and wastewater generated by local residents and local restaurants are treated by septic tanks/ soakaway system (STS).
- 2.3 Sewage works at Po Toi O comprise sewage collection, treatment and disposal facilities at Po Toi O under Port Shelter Sewerage, Stage 3 Sewerage Works at Po Toi O.
- 2.4 The Project in Po Toi O mainly comprises of the following items:
 - a. Provision of village sewerage to the unsewered areas of Po Toi O. The works involve construction of about 800m of gravity sewers and 400m of rising mains;
 - b. Construction of a local sewage treatment plant (STP) with Average Dry Weather Flow (ADWF) of about 139m3/day; and
 - c. Construction of a submarine outfall of about 385m in length.
- 2.5 The Project consists of the following works, which are classified as Designated Projects under Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO):
 - a. Item Q.1 A sewage treatment plant and portion of sewer alignments in a conservation area;
 - b. Item C.12 (a) (v) and (vii) A dredging operation which is less than 500m from the nearest boundary of an existing fish culture zone and coastal protection area; and
 - c. Item F.6 A submarine sewage outfall.
- 2.6 The Environmental Impact Assessment (EIA) Report "Port Shelter Sewerage, Stage 3 Sewerage Works at Po Toi O" (Register No: AEIAR-206/2017) was approved on 27 January 2017. An Environmental Permit (EP) (Permit No.: EP-516/2016) was issued on 27 January 2017 and is the current permit for the Project. The EM&A programme of the Project shall be implemented in accordance with the requirements and procedures set out in the EM&A Manual and the Environmental Permit (EP) of the Project (Permit No.: EP-516/2016).



2.7 The air quality and noise baseline monitoring works were conducted from 23 December 2020 to 5 January 2021 and the water quality baseline monitoring work was conducted from 17 December 2020 to 12 January 2021. A Baseline Monitoring Report had been submitted to EPD on 10 March 2021.

Scope of Report

2.8 This is the 33rd EM&A Report prepared by SGS for the Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O. This report summarized the monitoring results and audits findings of the EM&A programme under the EP of the Project and in accordance with the EM&A Manual during the reporting period of 1 November 2023 to 30 November 2023.

Project Organisation

2.9 The project organization structure is shown in **Appendix A**. The key personnel contact names and numbers are summarized in **Table 2-1**.

Position	Party	Name	Telephone
Project Proponent Drainage Services Department (DSD)		Mr. Gary Chung	2594 7227
Senior Resident Engineer (SRE)	Binnies Hong Kong Limited (Binnies)	Mr. Eugene Chan	6392 3809
Independent Environmental Checker (IEC)	Acuity Sustainability Consulting Limited (ASC)	Dr. F.C. Tsang	2698 8060
Environmental Team (ET) Société Générale de Surveillance (SGS) Hong Kong Limited		Mr. Johnathan Ho	9236 5528
Environmental Officer	China Geo-engineering Corporation (CGC)	Mr. Terry Yuen	6175 5320

Table 2-1 Contact information of key personnel



Construction Programme and Activities

2.10 The main works undertaken in the reporting period are as follows:

Major activities in the reporting month:

- 1. Construction of village sewer;
- 2. Slope works;
- 3. Construction of ELS for Po Toi O Sewage Treatment Plant

The Construction Programme is shown in **Appendix B**. The general layout plan of the Project is shown in **Figure 2-1**.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	9
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report		01
	Date	Dec 23

3. AIR QUALITY

Monitoring Requirements

3.1 In accordance with the EM&A Manual, impact air quality monitoring shall be carried out throughout the construction period at all approved air quality monitoring locations (AMSs). 24- hours total suspended particles (TSP) monitoring shall be conducted at least once every 6 days. Meanwhile, 1-hour TSP monitoring shall be conducted at least 3 times every 6 days when the highest dust impact takes place. The Action and Limit levels for 1-hour and 24-hours TSP level are provided in Table 3-1 and Table 3-2.

Table 3-1 Action and Limit Levels for 1-hour-TSP

Parameter	Air Quality Monitoring Station (AMSs)	Action Level (μg/m³)	Limit Level (μg/m³)
	AMS1N	319	
	AMS2N1	279	
1-hr TSP (μg/m³)	AMS3N	303	500μg/m³
	AMS4N	278	

Table 3-2 Action and Limit Levels for 24-hour-TSP

Parameter	Air Quality Monitoring Station (AMSs)	Action Level (μg/m³)	Limit Level (μg/m³)
	AMS1N	153	
	AMS2N1	179	
24-hr TSP (μg/m³)	AMS3N	158	260µg/m³
	AMS4N	144	

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	10
	Works at Po Toi O	Ref#	EMA2204/03/27
JU J	Monthly EM&A Report	Rev.	01
			Dec 23

Monitoring Equipment

3.2 The 24-hour TSP air quality monitoring was performed using High Volume Air Samplers (HVS) at each of the designated monitoring stations. The HVS are calibrated by a HVS calibrator. Meanwhile 1-hour TSP air quality monitoring was performed using portable TSP monitors. The equipment used for air quality monitoring are given in **Table 3-3**.

Air Quality Monitoring	Brand and Model of Equipment	Serial Number
24-hour TSP*	Graseby GMW High Volume Sampler	1180
	Campion	1174
		9795
		2483
	Tisch TE-5025A High Volume Sampler Calibrator	4128
1-hour TSP	Sibata LD-3B Portable TSP	014746
	Monitors	155331
		597340
		597227

Table 3-3	Equipment	Used for Ai	r Quality	Monitoring
	Equipment		i Quanty	monitoring

- 3.3 Meteorological information (such as the humidity, rainfall, air pressure and temperature etc.) were collected from Hong Kong Observatory (HKO)'s Weather Stations.
- 3.4 According to the approved EM&A Manual, wind data monitoring equipment shall be provided and setup for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
 - a. The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
 - b. The wind data should be captured by a data logger. The data shall be downloaded for



analysis at least once a month.

- c. The wind data monitoring equipment should be re-calibrated at least once every six months.
- d. Wind direction should be divided into 16 sectors of 22.5 degrees each.
- 3.5 It is noted that after liaison with the Po Toi O resident's representative on 22 December 2020, the resident's representative has rejected the access to the space and power supply for ET to install the wind data monitoring stations. Therefore, ET had proposed the alternative method for wind data collection according to section 3.4.7 of EM&A Manual.
- 3.6 The alternative method for wind data collection was adopt the wind data information collected from the HKO's Waglan Island weather station as the representative wind data. Although there are other closer weather stations, Waglan Island Station was selected as it is the nearest weather station that measures wind data information mentioned above.
- 3.7 The meteorological data from HKO's Weather Station is given in **Appendix C**.

Monitoring Parameters, Frequency and Duration

3.8 The parameters, duration and frequency for air quality impact monitoring is given in Table 3-4. Monitoring stations AMS1N, AMS2N1, AMS3N and AMS4N were set up in accordance to the requirements for placement of equipment, as set out in section 3.5.3 of the EM&A manual of the Project. Locations of the alternative AMSs are given in **Figure 3-1**.

Identification no.	Location	Type of monitoring	Parameters	Frequency
AMS1N*	Footpath above House No. 28 Po Toi O Chuen Road			
AMS2N1*	Open space Approx. 15 m from Hung Shing Temple	TSP	1-hr TSP	1-hour TSP: At least 3 times for 1- hour with every 6 days
AMS3N*	Vacant land near Temporary Structure (House) Rocky Shore			24-hr TSP
AMS4N*	Resting shelter near Seacrest Villas			

Table 3-4 Monitoring Parameters	s for Air Quality Monitoring
---------------------------------	------------------------------



Notes:

*- Due to a number of limitations identified at the air quality monitoring stations in the Approved EM&A Manual for the Project, the monitoring location AMS1 – AMS4 were replaced by alternative monitoring location AMS1N – AMS4N, which were approved by ER and IEC.

Monitoring Methodology for 24-hour TSP Monitoring

- 3.9 The HVS was installed in the vicinity of the air quality monitoring stations. The following criteria were considered in the installation of the HVS:
 - a. A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
 - b. The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
 - c. A minimum of 2 meters separation from walls, parapets and penthouse for rooftop sampler.
 - d. A minimum of 2 meters separation from any supporting structure, measured horizontally.
 - e. No furnace or incinerator flues nearby.
 - f. Airflow around the sampler was unrestricted.
 - g. Permission was obtained to set up the samplers and access to the monitoring stations.
 - h. A secured supply of electricity was obtained to operate the samplers.
 - i. The sampler was located more than 20 meters from any dripline.
 - j. Any wire fence and gate, required to protect the sampler, did not obstruct the monitoring process.
 - k. Flow control accuracy was kept within $\pm 2.5\%$ deviation over 24-hour sampling period.
- 3.10 The following procedures to be followed for the preparation of filter papers of the HVS:
 - a. Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
 - b. All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ±3 °C; the relative humidity (RH) was < 50% and not variable by more than ±5%. A convenient working RH was 40%.</p>
 - c. All filter papers were prepared and analysed by a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes.



3.11 The following procedures are followed throughout air quality monitoring works:

a. The power supply was checked to ensure the HVS works properly.

b. The filter holder and the area surrounding the filter were cleaned.

c. The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.

d. The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.

e. The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied was sufficient to avoid air leakage at the edges.

f. Then the shelter lid was closed and was secured with the aluminum strip.

g. The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.

h. A new flow rate record sheet was set into the flow recorder.

i. On site temperature and atmospheric pressure readings were taken and the flow rate of the HVS was checked and adjusted at around 1.1 m3 /min and complied with the range specified in the updated EM&A Manual (i.e., 0.6-1.7 m3 /min).

j. The programmable digital timer was set for a sampling period of 24 hrs, and the starting time, weather condition and the filter number were recorded.

k. The initial elapsed time was recorded.

I. At the end of sampling, on site temperature and atmospheric pressure readings were taken and the final flow rate of the HVS was checked and recorded.

m. The final elapsed time was recorded.

n. The sampled filter was removed carefully and folded in half-length so that only surfaces with collected particulate matter were in contact.

o. It was then placed in a clean plastic envelope and sealed.

p. All monitoring information was recorded on a standard data sheet.

3.12 The following procedures are followed for the maintenance and calibration of HVS:

- a. The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- b. 5-point calibration of the HVS was conducted using TE-5025A Calibration Kit prior to the commencement of monitoring. Bi-monthly 5-point calibration of the HVS will be carried out



during impact monitoring. The details for HVS calibration against the TE-5025A Calibration Kit is given in **Appendix D**.

Monitoring Methodology for 24-hour TSP Monitoring by Direct Reading Dust Meters

- 3.13 Since power supply for HVS for 24-hour TSP monitoring at alternative monitoring locations (i.e., AMS1N to AMS4N) were rejected, the use of direct reading dust meters is adopted to measure both 1-hour and 24-hour average TSP levels for the reporting month.
- 3.14 In accordance to Condition 3.1 of the Project's EP and Section 3.3 of the Project's EM&A Manual, the proposal for alternative monitoring equipment (i.e., direct reading dust meter) for TSP monitoring was approved by IEC and ER.
- 3.15 The measuring procedures of the direct reading dust meters are given in Section 3.5.10.
- 3.16 24 consecutive 1-hour TSP concentration measurement results is adopted for the evaluation of 24-hour TSP concentration. Results are manually logged daily, during daily maintenance of the dust meter. Calculation of the value of 24-hour TSP concentration is given by the average of 24 calculated 1-hour TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and HVS. Details for the correlation methodology and correlation record are given in Appendix D and Appendix E.
- 3.17 HVS for 24-hr TSP monitoring will be adopted once secured supply of electricity becomes available for any agreed TSP monitoring locations.

Monitoring Methodology for 1-Hour TSP Monitoring

- 3.18 The measuring procedures of the direct reading dust meters were in accordance with the Manufacturer's Instruction Manual as follows:
 - a. Turn the power on.
 - b. Close the air collecting opening cover.
 - c. Push the "TIME SETTING" switch to [BG].
 - d. Push "START/STOP" switch to perform background measurement for 6 seconds.
 - e. Turn the knob at SENSI ADJ position to insert the light scattering plate.
 - f. Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
 - g. Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
 - h. Pull out the knob and return it to MEASURE position.



- i. Push the "TIME SETTING" switch the time set in the display to 3 hours.
- j. Lower down the air collection opening cover.
- k. Push "START/STOP" switch to start measurement.
- 3.19 The following procedures are followed for the maintenance and calibration of direct reading dust meters:
 - a. The 1-hour TSP meter was calibrated at 1-year intervals against with high volume sampler.
 - b. Calibration certificates of the Laser Dust Monitors are provided in **Appendix D**. 1-hour validation checking of the TSP meter against HVS is carried out yearly at the air quality monitoring locations.

Monitoring Results and Observations

- 3.20 The schedule for environmental monitoring in the reporting period is provided in Appendix F.
- 3.21 The air quality monitoring results for 1-hour and 24-hour air quality monitoring are summarized in **Table 3-6** and **Table 3-7**. Air quality monitoring data and graphical presentation of the data are provided in **Appendix G**.

Table 3-6 1-hour Air Quality Monitoring Results in the Reporting Period

Parameter	Monitoring Station	Average (μg/m³)	Range (μg/m³)
	AMS1N	46.6	34 - 68
	AMS2N1	56.0	36 - 89
1-hr TSP in μg/m³	AMS3N	41.1	27 - 63
	AMS4N	42.1	31 - 64

Table 3-7 24-hour Air Quality Monitoring Results in the Reporting Period

Parameter	Monitoring Station	Average (μg/m³)	Range (µg/m³)
	AMS1N	46.7	35 - 55
24-hr TSP in μ g/m ³	AMS2N1	58.0	40 - 96
	AMS3N	45.2	32 - 52

Works at Po Toi O Ref# EMA2204/03/27 Monthly EM&A Report Rev. 01 Date Dec 23	SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	16
Monthly EM&A Report		Works at Po Toi O	Ref#	EMA2204/03/27
		Monthly EM&A Report	Rev.	01
			Date	Dec 23

AMS4N	45.8	37 - 54
-------	------	---------

3.22 No Action or Limit Level exceedances of air quality were recorded in the reporting month. No air quality complaints between 0700 – 1900 hours on normal weekdays (i.e., Mondays to Saturdays) were received in the reporting month.

Other Influencing Factors of the Monitoring Results

- 3.23 Major emission sources during air quality monitoring in the reporting period were mainly vehicle emission from Po Toi O Chuen Road and nearby residents' activities.
- 3.24 The event and action plan for air quality monitoring are given in **Appendix H**.



4. NOISE

Monitoring Requirements

4.1 In accordance with the EM&A Manual, noise impact monitoring was conducted during daytime construction work on normal weekdays (0700-1900 hours between Monday to Saturday), 1 set of 30-min measurement shall be carried out at approved noise monitoring stations (NMSs) every week based on the measurement procedures under EPD's" Technical Memorandum for the Assessment of Noise from Places Other Than Domestic Premises, Public Places or Construction Sites". The Action and Limit levels for construction noise monitoring is provided in Table 4-1.

Table 4-1 Action and Limit Levels for Construction Noise

NMSs ID	Noise Sensitive Receivers	Descriptions	Action Level	Limit Level
NMS1N	PTO_N1	Footpath Above House No. 28 Po Toi O Chuen Road		
NMS2N1	PTO_N2	Open Space Approx. 15 m from Hung Shing Temple	When one documented complaint is received from any one of the noise sensitive receivers	
NMS3N	PTO_N3	Vacant Land Near Temporary Structure (House) Rocky Shore		75 dB(A)*
NMS4N	PTO_N4	Resting Shelter Near Seacrest Villas		

Monitoring Equipment

4.2 Noise monitoring was completed using sound level meters at each NMSs. The sound levels meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to calibrate the sound level meters at a given sound pressure level. The equipment used for noise impact monitoring is given in **Table 4-2**.

Table 4-2 Noise Monitoring Equipment

Equipment	Brand and Model	Serial No. /Equipment ID
Integrated Sound Level Meter	Rion NL-52	00264519

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	18
	Works at Po Toi O	Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

Integrated Sound Level Meter	Rion NL-52	00264520
Integrated Sound Level Meter	Rion NL-52	00998504
Acoustic Calibrator	GA607	038641
Anemometer	AZ Instrument – AZ 8908	1064869

Monitoring Locations

4.3 Due to the limitation posed by the approved monitoring stations set out by the EM&A manual, alternative monitoring stations NMS1N, NMS2N1, NMS3N and NMS4N were proposed in accordance to Section 4.5.3 of the EM&A Manual of the Project and approved from the ER and the IEC. The locations of the NMSs are given in **Figure 3-1**, and the details of the monitoring stations are illustrated in **Table 4-3**.

Table 4-3 Description of Proposed Noise Monitoring Locations

NMSs ID	Location	Type of measurement	Type of Monitoring	Duration
NMS1N*	Footpath above House No. 28 Po Toi O Chuen Road			30 mins
NMS2N1*	Open space approximately 15 m from Hung Shing Temple		Noise	30 mins
NMS3N*	Vacant land near Temporary Structure (House) Rocky Shore	Free-Field		30 mins
NMS4N*	Resting shelter near Seacrest Villas			30 mins

Notes:

*For Free-field measurement, a correction of +3dB(A) should be made to the measured results.

* Due to the limitation posed by the approved monitoring stations set out by the EM&A manual, four alternative representative Noise Quality Monitoring Stations

(NMSs) are proposed. The alternative monitoring Locations were approved by ER and IEC.



Monitoring Parameters and Frequency

4.4 The monitoring parameters, frequency and duration of impact noise monitoring are summarized in **Table 4-4**.

Table 4-4 Parameters for Noise Impact Monitoring

Parameter and Duration	Frequency
30-mins measurement at each monitoring station between 0700 and 1900 on normal weekdays. Leq, L10 and L90 would be recorded	At least once per week

Monitoring Methodology

- 4.5 The measuring procedures of the sound level meter were in accordance with the Manufacturer's Instruction Manual as follows:
 - a. Free-field measurement was made for the noise monitoring stations.
 - b. The sound level meter was set on a tripod at a height of 1.2 m above the ground.
 - c. The battery condition was checked to ensure the correct functioning of the meter.
 - d. Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - i. frequency weighting: A
 - ii. Time weighting: Fast
 - iii. Time measurement: Leq(30-minutes) during non-restricted hours i.e., 07:00 1900 on normal weekdays; Leq(5-minutes) during restricted hours i.e., 19:00 23:00 and 23:00 07:00 of normal weekdays, whole day of Sundays and Public Holidays
 - e. Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator at a specified sound pressure level at a specified frequency. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
 - f. During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
 - g. Noise measurement was paused during periods of high intrusive noise (e.g., dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
 - h. Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s.



- 4.6 The following procedures are followed for the maintenance and calibration of sound level meters:
 - a. The microphone head of the sound level meter was cleaned with soft cloth at regular
 - b. intervals.
 - c. The meter and calibrator were sent to the supplier or HOKLAS laboratory to check
 - d. and calibrate at yearly intervals.
 - e. Calibration certificates of the sound level meters, and acoustic calibrators are provided in **Appendix I.**

Monitoring Results and Observations

- 4.7 The schedule for environmental monitoring in the reporting period is provided in **Appendix F**.
- 4.8 The monitoring results for construction noise are summarized in **Table 4-5**. The noise monitoring data graphical presentation of the data is provided in **Appendix J**.

Table 4-5 Summary of Construction Noise Monitoring Results in the Reporting Period

NMSs ID	Construction Noise	Baseline Level, dB(A)	Limit Level, db(A)
	Level,		
	dB(A)*, Leq (30 min)		
NMS1N	67.2 dB(A)	62.7 dB(A)	75
NMS2N1	60.6 dB(A)	61.8 dB(A)	75
NMS3N	58.8 dB(A)	64.6 dB(A)	75
NMS4N	51.2 dB(A)	58.1 dB(A)	75

Note:

*- A correction of +3 dB(A) was made to the free field measurements. Leq (30min) was measured at 0700-1900 hours on normal weekdays.

- 4.9 No Action or Limit Level exceedance of construction noise was recorded in the reporting month.
- 4.10 No noise complaints from between 0700 1900 hours on normal weekdays was received in the reporting month.
- 4.11 The event and action plan are provided in **Appendix H**.

Other Influencing Factors of the Monitoring Results

4.12 Major noise sources during noise monitoring in the reporting period were mainly road traffic noise.



5. WATER QUALITY

Monitoring Requirements

- 5.1 With the recommendations of the Project's EIA report, water quality impact monitoring shall be carried out carried out 3 days per week, at mid-flood and mid-ebb tides (within ± 1.75 hour of the predicted time required) at all the approved Water Quality Monitoring Stations (WQMSs) during whole cofferdam installation/extraction work and during dredging works. The interval between two sets of monitoring shall not be less than 36 hours.
- 5.2 Replicate in-situ measurements of Suspended Solids (SS) and in-situ water quality data (temperature, pH, turbidity, water depth, salinity, dissolved oxygen and percentage of saturation) shall be collected.
- 5.3 Other relevant data should also be recorded, including monitoring location/position, time, tidal stages, weather conditions and any special observation or works that may affect the monitoring results in the vicinity.
- 5.4 To ensure sufficient data for robust analysis, duplicate in-situ data shall be collected. In case the difference in the duplicate in-situ measurement results is larger than 25%, the third set of in-situ measurement shall be carried out for result confirmation purpose.
- 5.5 Water samples shall be extracted at 1m below surface, 1m above seabed and the mid-depth level at where the water depth is at least 6m. However, if the water depth is less than 3m, water samples shall only be collected at the mid-depth level. For stations with depth less than 6m, the mid-depth sample can be omitted.
- 5.6 In addition, duplicated water samples for suspended solid analysis shall be collected at all the above stations and delivered to the HOKLAS accredited laboratory for analysis. Results for suspended solids shall be received back from the laboratory within 24-hour of the receipt of the samples.
- 5.7 Water quality impact monitoring shall also be conducted at the same frequency as monitoring throughout the whole cofferdam installation/extraction work and during dredging work. In case of exceedance of Action/Limit Level recorded, the frequency of water quality monitoring shall be increased as per the Event and Action Plan.
- 5.8 The water quality impact monitoring schedule shall be issued to IEC at least one month prior to the commencement of Impact Monitoring.

Monitoring Parameters and Frequency

5.9 The monitoring parameters, monitoring periods and frequencies of the water quality monitoring are summarized in **Table 5-1**.

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	22
	Works at Po Toi O	Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

Table 5-1 Parameters of Water Quality Monitoring

Parameters	Duration	Frequency
Temperature (Oc)	During Construction Phase:	3 Days Per Week
Ph (Ph Unit)	Throughout Installation	(The Interval Between Two
Turbidity (Ntu)	And Extraction Of	Sets of Monitoring Shall Not
Water Depth (M)	Cofferdam; And	Be Less Than 36 Hours.)
Salinity (Ppt)	During Dredging	
Do (Mg/L And % Of		
Saturation)		
SS (Mg/L)		

Monitoring Locations

5.10 According to section 5.2.6 of the EM&A manual of the project, 6 water quality monitoring stations (WMSs) are proposed at the Po Toi O FCZs, major amphioxus habitats and rocky shores where coral thrives. With reference to the tidal characteristics of Po Toi O Bay, 3 control stations are proposed where fresh marine water is not affected by the cofferdam installation/ extraction works, and 2 impact stations are proposed near the cofferdam under different tidal periods. All water quality monitoring stations show as Figure 5-1 and Table 5-2.

Table 5-2 Summary of Water Quality Impact Monitoring Stations

Station	Monitoring period	Description	Easting	Northing
*WMS1N	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848416	845209
*WMS2N	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848505	815375
WMS3	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848644	815391
WMS4	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848774	815602
WMS5	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848578	815591
WMS6	Mid-Ebb, Mid-Flood	Major Amphioxus Habitat	848639	815523
l1	Mid-Flood	Impact monitoring Station	848643	815692
12	Mid-Ebb	Impact monitoring Station	848722	815910
C1	Mid-Flood	Control station	848904	816052
C2	Mid-Ebb	Control station	848529	815373
C3	Mid-Ebb	Control station	848243	815710
WMS1	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848387	815201
WMS2	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848479	815378

Notes:



*WMS1N, WMS2N are new proposed alterative monitoring location. As previous EIA proposed monitoring location WMS1, WMS2 are situated in fish barges within the Fish Culture Zone (FCZ), and accesses to WMS1 and WMS2 were subsequently denied by the tenants of the fish barges. The relocation of WMS1 and WMS2 were approved by IEC and the ER of the Project.

Results and Observations

- 5.11 According to submission of construction works schedule and location plan under the EP of Project, the commencement of construction work with cofferdam installation / extraction work and during dredging works shall be 6 December 2023.
- 5.12 Marine construction was not commenced within the reporting month; hence no water quality monitoring was conducted. Water quality monitoring would be commenced starting from 6 December 2023.
- 5.13 Refer to Sections 5.2.10 and 5.2.11 of approved EM&A Manual, construction phase site inspection for water quality mitigation measures and check the contractor's work practice on water pollution prevention during construction phase has been conducted during weekly site audit.
- 5.14 During the weekly site audit of this reporting month, no non-conformance water pollution was identified / observed in the commencement works area.



6. WASTE MANAGEMENT

- 6.1 As advised by the Contractor, 0 m³ of inert C&D material was generated in the reporting month. For C&D wastes, 0 m³ of general refuse was disposed of at NENT landfill, 0 kg waste were collected by recycling contractors, and 0 kg of chemical wastes was collected by licensed Contractors in the reporting period.
- 6.2 The actual amounts of different types of waste generated by the activities of the Project in the reporting period are shown in **Table 6-3**, the detailed monthly summary of waste flow is detailed in **Appendix K**.

Table 6-3 Summary of Waste Flow Table

Waste Type	Quantity	Disposal/ Reuse Locations
Inert C&D Waste Disposed as	0 m ³	Tseung Kwan O Area 137 Fill
Public Fill		Bank (TKO137FB).
C&D Wastes Disposed as General	0 m ³	North East New Territories
Refuse		(NENT)
Recycle Materials	0 kg	Recycling Facilities
General Refuse	0 kg	North East New Territories
		(NENT)
Chemical Waste	0 kg	Licensed Contractors

6.3 During regular site auditing, the mitigation measures proposed in the Implementation Schedule of the Environmental Mitigation Measures (EMIS) in the approved EIA report of the Project has been effectively implemented in the commenced works area. No adverse waste impact was observed from the construction works in reporting month.



7. ENVIRONMENTAL SITE INSPECTION AND AUDIT

Site Inspection

- 7.1 Site inspections were carried out by ET on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. Key observations were recorded in the site inspection checklist and passed to the Contractor together with the appropriate recommended mitigation measures where necessary.
- 7.2 In the reporting period, 5 site inspections were carried out on 2, 9, 16, 23 and 30 November 2023. No noncompliance was recorded during the site inspection. Details of observations recorded during the site inspections are presented in **Table 7-1**.

Date	Parameters	Observations and Recommendations	Action was taken by
			the contractor
2	Air Quality/Water	Observation	Follow up Observation
November 2023	Quality	Item 1: The Contractor should remove	Item 1: Chemical
		the chemical containers from the site	containers were removed
		area or should provide drip trays for	from the site area.
		temporary storage.	(Item Closed)
		Reminder	Follow up Reminder
		Item 1: The Contractor is reminded to	Item 1: Stockpile areas
		provide sand bags to stockpiles to	are covered up with sand
		prevent unavoidable discharge of	bags and tarpaulin
		muddy water.	sheets.
			(Item Closed)
9	Water Quality	Observation	Follow up Observation
November 2023		Item 1: The NRMM label has faded for	Item 1: The NRMM
		the mobile generator. The Contractor	label has been replaced.
		should replace the NRMM label.	(Item Closed)
		Reminder	Follow up Reminder
		Item 1: The Contractor is reminded to	Item 1: Stockpile areas
		provide sand bags to stockpiles to	are covered up with sand
		prevent unavoidable discharge of	bags and tarpaulin
		muddy water.	sheets.
			(Item Closed)

Table 7-1 Observations and Recommendations in the Reporting Month



Date	Parameters	Observations and Recommendations	Action was taken by
			the contractor
16	Air Quality/Water	Observation	Follow up Observation
November 2023	Quality/Waste	Item 1: The NRMM label has faded for	Item 1: The NRMM
	management	the mobile generator. The Contractor	label has been replaced.
		should replace the NRMM label.	(Item Closed)
		Item 2: Oil stains were observed at	Item 2: The oil stain was
		PTO-SPS works area. The Contractor	absorbed with clean
		should clear the oil stains and treat it	sand, treated as
		properly as chemical waste.	chemical waste and
			stored as chemical waste
			in the chemical waste
			store.
			(Item Closed)
		Item 3: Oil drums at rocky shore should	Item 3: Oil drums have
		be stored in drip trays or removed from	been removed from the
		the site area to avoid spillage of	site location.
		chemicals.	(Item Closed)
23	Air Quality/Water	Observation	Follow up Observation
November 2023	Quality/Waste	Item 1: Oil stains were observed at	Item 1: The oil stain
	management	PTO-SPS works area. The Contractor	was absorbed with clean
		should clear the oil stains and treat it	sand, treated as
		properly as chemical waste.	chemical waste and
			stored as chemical waste
			in the chemical waste
			store.
			(Item Closed)
		Item 2: Chemical containers were	Item 2: Chemical
		found in the site area without a drip tray.	containers were removed
		All chemical containers should be stored	from the site location.
		in a drip tray or removed from the site	(Item Closed)
		location.	
		Item 3: Stone breaker of the excavator	Item 3: Stone breaker of
			the excavator was
		should be covered with tarpaulin sheet	
			covered with tarpaulin



Date	Parameters	Observations and Recommendations	Action was taken by
			the contractor
		to avoid oil spillage and oil spillage	sheets and the oil
		should be cleaned up.	spillage was cleared.
			(Item Closed)
		Reminder	Follow up Reminder
		Item 1: The Contractor is reminded to	Item 1: Chemical waste
		provide a chemical storage cabinet at	store was provided at the
		the seashore for storing chemicals on	sea shore.
		site.	(Item Closed)
		Item 2: The Contractor is reminded to	Item 2: Poster was
		affix signage to avoid rubbish being	provided at the SPS
		dumped from passerbies to the silt	outfall location to remind
		curtain location and maintain site	residents and visitors not
		hygiene and cleanliness at all times.	to dump rubbish to the silt
			curtain.
			(Item Closed)
30		Observation	Follow up Observation
November 2023		Item 1: Stone breaker of the excavator	Item 1: Stone breaker
		should be covered with tarpaulin sheet	of the excavator was
		to avoid oil spillage and oil spillage	covered with tarpaulin
		should be cleaned up.	sheets and the oil
			spillage was cleared.
			(Item Closed)
		Reminder	Fellow up Dominister
		Item 1: The Contractor is reminded to	Follow up Reminder Item 1: A lock was
		provide a lock to the chemical waste	provided for the chemical
		store.	waste storage cabinet.
			(Item Closed)
No adverse observat	tion was identified in	the reporting period. Noise Impact	
No adverse observat			
No adverse observat			
No adverse observat		1 91	
		the reporting period. Landscape and Visu	al Impact
			•



Status of Environmental Licenses, Notification and Permits

7.3 The environmental licenses and permits for the Project and valid in the reporting period are summarized in **Table 7-3**.

Table 7-3 Status of Environmental License, Notification and Permit

License/ Notification/ Permit	Reference No.	Valid Period	
		From	То
Environmental Permit	EP-516/2016	27 January 2017	End of Project
Construction Dust Notification	458613	3 August 2020	N/A
Under APCO			
Wastewater Discharge License	WT00038707-	3 November 2021	31 August 2026
	2021		
Chemical Waste Producer	5213-820-	23 September 2020	N/A
Registration	C3510-		
	18		
Billing Account for Disposal of	WFG22785	17 August 2020	N/A
Construction Waste			

Implementation Status on Environmental Protection Requirements

7.4 The Implementation Schedule of the Environmental Mitigation Measures (EMIS) of the reporting period is summarized in **Appendix L**. The implementation of the key mitigation measures during the reporting period is presented in **Appendix M**.

Summary of Complaints, Notification of Summons, Successful Prosecutions and Public Engagement Activities

- 7.5 No complaints, notification of summons and successful prosecution was received in the reporting period. No public engagement activities were conducted in the reporting period.
- 7.6 Statistics on complaints, notifications of summons, successful prosecutions and public engagement activities are summarized in **Appendix N**.



8. FUTURE KEY ISSUES

CONSTRUCTION PROGRAMME FOR THE UPCOMING REPORTING MONTH

- 8.1 Major activities in the upcoming month:
 - a. Construction of village sewer;
 - b. Slope works;
 - c. Construction of ELS for Po Toi O Sewage Treatment Plant;
 - d. Construction of Cofferdam;
 - e. Pilot Drilling of HDD

Reinstatement Works Key Issues for the Upcoming Reporting Month

- 8.2 Potential environmental impacts due to the construction activities, including air quality, noise, water quality, waste, landscape and visual, will be monitored or reviewed. The ET will continue to implement the environmental monitoring & audit programme in accordance with the EM&A Manual and Environmental Permit requirement. The recommended environmental mitigation measures shall be implemented on site and regular inspections as required will be carried out to ensure that the environmental conditions are acceptable.
- 8.3 The anticipated impact of major work activities within the site and the recommended mitigation measures are shown in **Appendix M**.

Monitoring Schedule for the Coming Month

8.4 The tentative schedule for environmental monitoring in December 2023 is provided in AppendixF.



9. CONCLUSION

General

9.1 This Report Summarized the Monitoring Results and Audits Findings of the EM&A Programme Under the EP of The Project and In Accordance with the EM&A Manual During the Reporting Period of 1 November 2023 to 30 November 2023.

Environmental Impact Monitoring

9.2 No Action or Limit Level exceedance of construction air quality, noise was recorded in the reporting month. No air quality complaints and noise complaints were received in the reporting month.

Environmental Site Inspections

9.3 The environmental site inspections were carried out in the reporting month. Recommendations on remedial actions were given to the contractors for the deficiencies identified during the site inspection. The contractor had been follow-up the recommendations on the remedial action accordingly.

Complaint Log

9.4 There was no complaint received in relation to the environmental impact during the reporting period.

Reporting Changes

9.5 No report changes in this reporting period.


Notifications of Summons and Successful Prosecutions


9.6 There was no notification of summons and successful prosecution was received in the reporting period.




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		-
		EMA2204/03/27
Monthly EM&A Report		01
		Dec 23

FIGURE 2-1 – LAYOUT PLAN OF THE CAPTIONED PROJECT

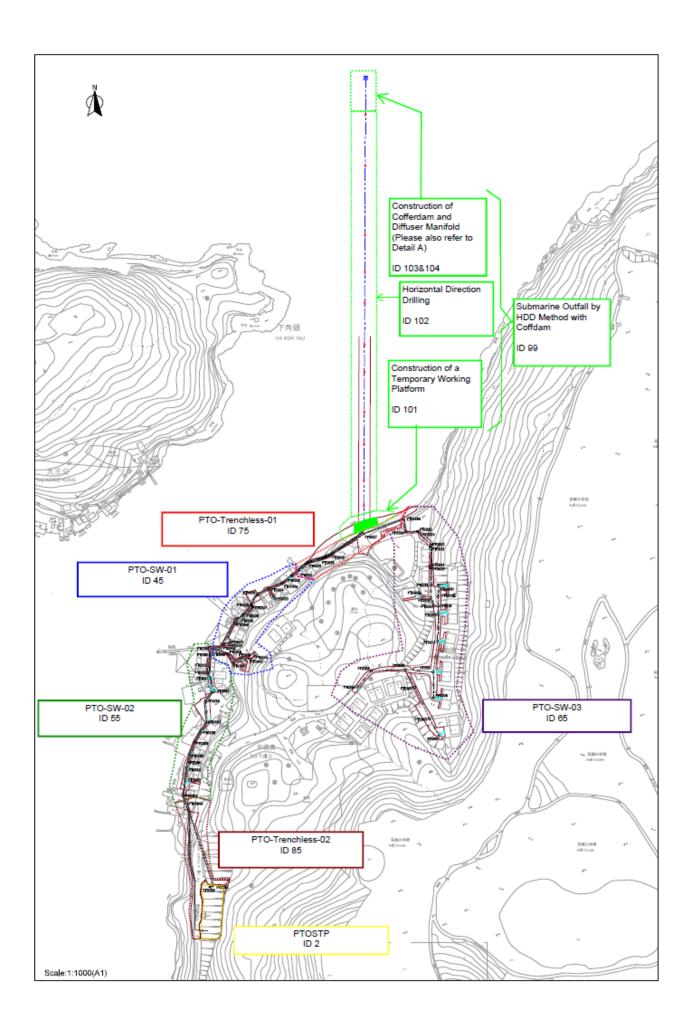

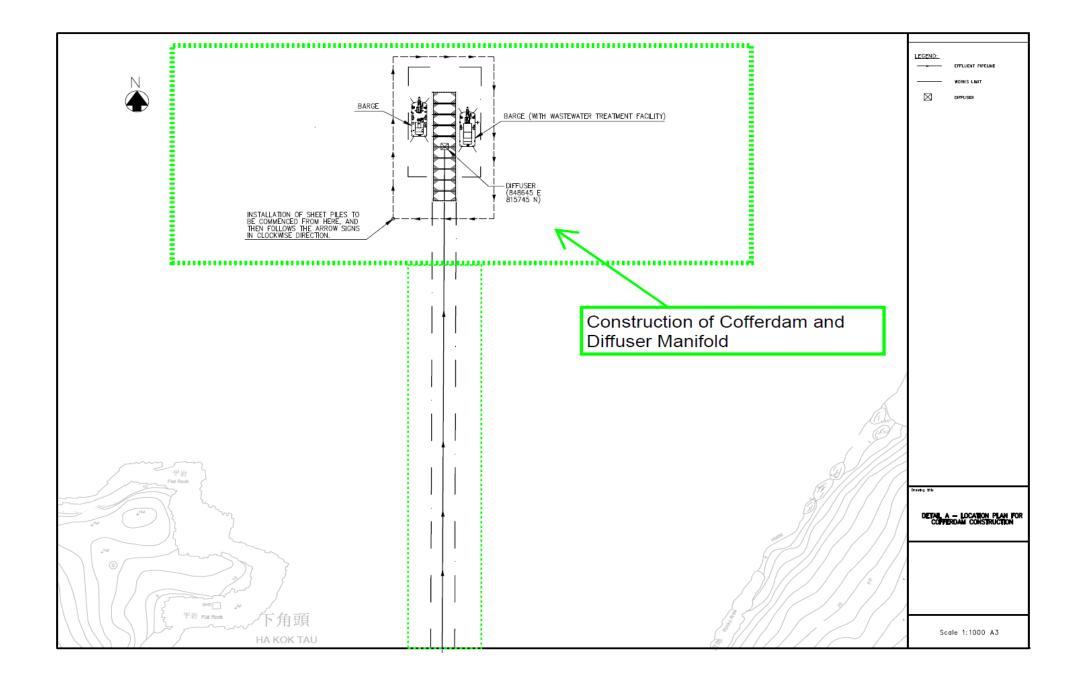

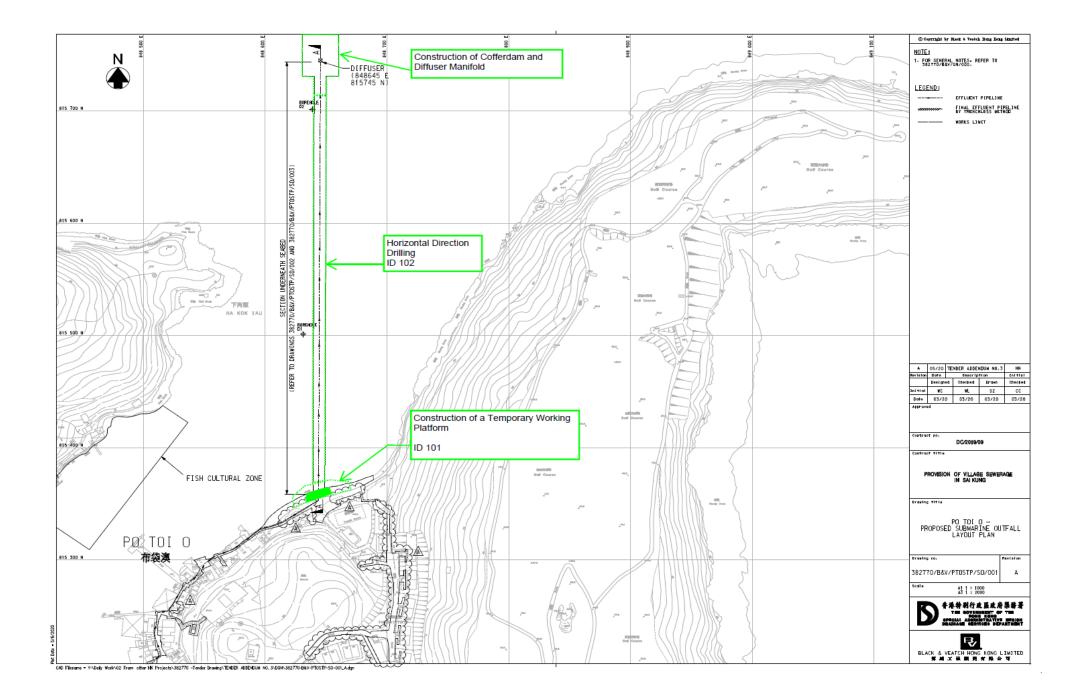

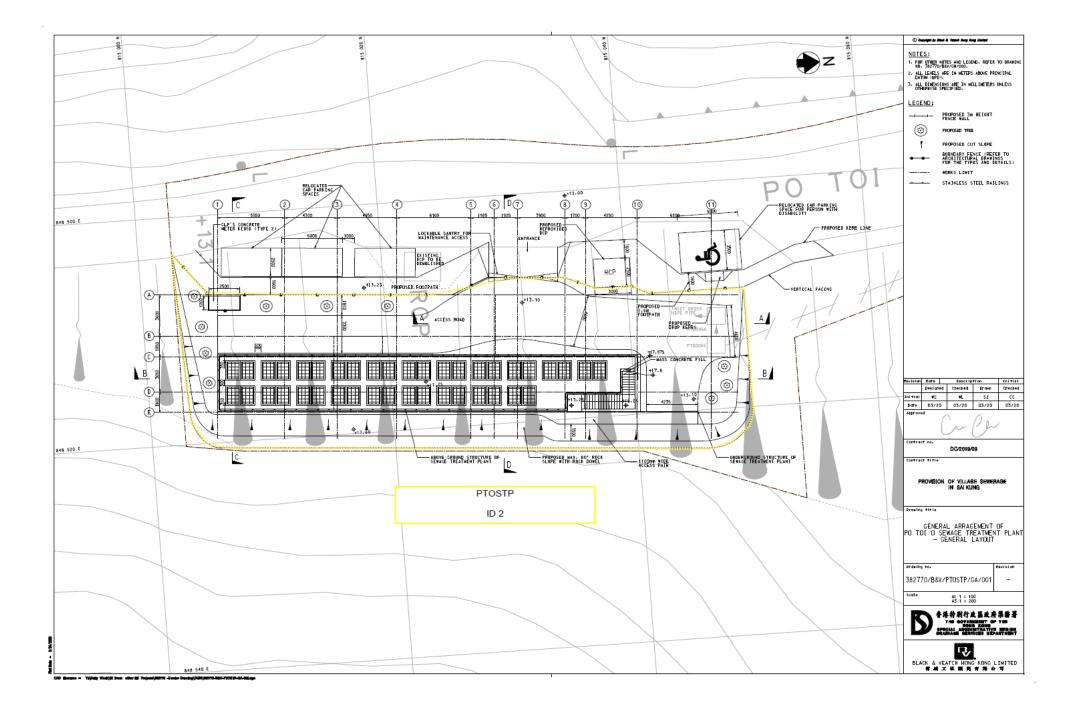




FIGURE 3-1 PROPOSED AIR QUALITY AND NOISE MONITORING STATIONS LOCATIONS


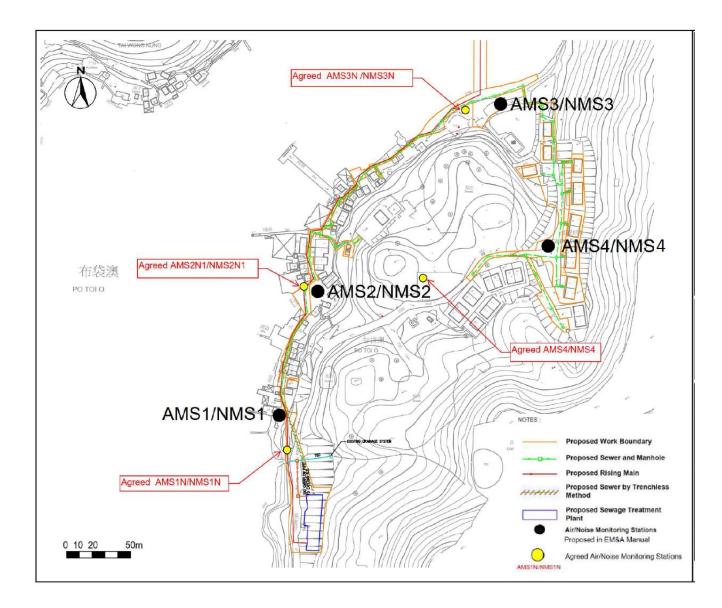




FIGURE 5–1 LOCATIONS OF WATER QUALITY IMPACT MONITORING STATIONS



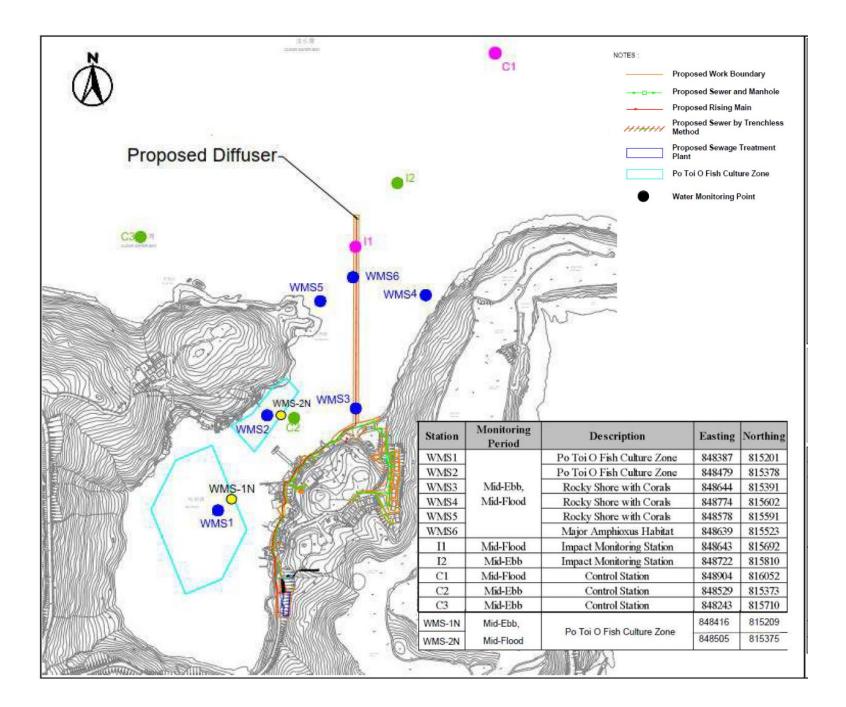

EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	A-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23


APPENDIX A – PROJECT ORGANIZATION CHART



ED 540/2040 - David Chalter Company Stars 2 - Company Works at Da Tai O	Page	A-2
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

Contract No. : DC/2019/09 Provision of Village Sewerage in Sai Kung

Environmental Organization Chart

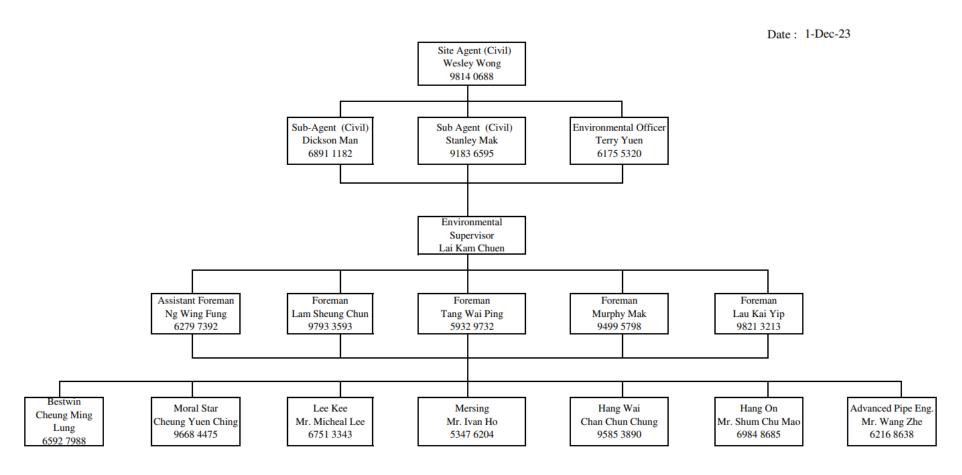



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	B-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX B – CONSTRUCTION PROGRAMME

Project	Provision of Village Sewerage in Sai Kung								Drainage Provision Ci	Services Dep of Village Sev ontract No: D	partment of H werage in Sa DC/2019/09	HKSAR ai Kung															Date: June	2023
ID	Task Name	Duration	Starting Date	Percentage of	Completion Date	TRAPredecess	iors TRA	Text10	Jan '23	Feb '23	Mar 23	Apr '23	May 73	Jun '23	Jul [23	Aug 23	Sep 23	Oct 23	Nov 23	Dec '23	Jan '24	Feb [24	Mar '24	Apr 124	May 24	Jun'24 Ju 2 9 162330	ui 24	ug 2
1	Section 2 - Village Sewerage Works at Po Toi O and PTOSTP	1209 days	Fri 24/7/20	Completion	Thu 15/8/24		-		1 8 15 22 2	12 19 26	58 12 19 26	2 9 1623	307 142128	<u>să hihsba</u>	2 9 1623B	016 132027	3 101724	1 8 15 22	98 12 1926	<u>B 101724</u>	<u>317 14212</u>	<u>sia hiihsb</u>	15 <u>B 101724</u>	317 14212	8 8 112 19 26	2 19 16 23 50	317 114 21 28	<u>4 hi</u>
2	Po Toi O Sewage Treatment Plant (PTOSTP)	1128 days	Fri 24/7/20	0%	Thu 9/5/24		-																					
3							-																					_
4	Liaise with the village representative works to ensure the possession of construction site	75 days	Fri 24/7/20	0%	Wed 21/10/20																							
5	Preperation works (i.e. TMLG meetings; Application for traffic advice for suspension of existing parking slot; Re-provision of existing RCP, etc.)		Fri 24/7/20		Thu 29/4/21																							
6	Environmental submissions	231 days	Fri 24/7/20	0%	Thu 29/4/21																							
7			Thu 22/10/20		Thu 22/10/20	4	-																					
8	Installation of site hoardings at PTOSTP	50 days	Fri 23/10/20	0%	Mon 21/12/20	7																						
9	Mobilization of plant and equipment	10 days	Tue 22/12/20	0%	Tue 5/1/21	8	+																					
10	Site clearance	95 days	Wed 6/1/21	0%	Thu 29/4/21	9	-																					
11	Initial survey, UU detection and permit-to-dig	95 days	Wed 6/1/21	0%	Thu 29/4/21	9																						
12																												
13	Preparation for geotechnical submissions	7 days	Fri 30/4/21	0%	Sat 8/5/21	11,10,5,6																						
14																												
15	Liaison with PTO VR	18 days	Mon 10/5/21	0%	Mon 31/5/21	13																						
16																												
17	Slope cutting (Total 2850 m3 solid materials to be removed, i.e. about 4275 m3 loosen materials, 23.8m3 loosen materials to be removed per day, i.e. 4 trips of dumping per day(installation of silt curtain at the outfet of the box culvert)	148 days	Tue 1/6/21	0%	Thu 25/11/21	15	-																					
18	outlet of the box culvert) Installation of rock dowl (include drilling, rebar installation and grouting, etc.)	35 days	Fri 26/11/21	0%	Sat 8/1/22	17	+																					-
19	Construction of anchorages for flexible barrier	40 days	Mon 10/1/22	0%	Mon 28/2/22	18	-																					
20	Installation of flexible barriers	40 days	Tue 1/3/22	0%	Wed 20/4/22	19																						
21																												
22	Installation of sheetpile	28 days	Thu 21/4/22	0%	Tue 24/5/22	20	-																					
23 24	3225m3 loosen materials, 23.8m3 loosen materials to be removed per day, i.e. 4 trips of dumping per		Wed 25/5/22 Thu 6/10/22		Wed 5/10/22 Fri 21/10/22	22																						
25			Sat 22/10/22		Wed 7/12/22	24																						
26	Construction of basement (below +13.25 mPD)	50 days	Thu 8/12/22	0%	Fri 10/2/23	25																						
27																												
28	Construction of R.C. walls at 1st Floor	55 days	Sat 11/2/23	0%	Thu 20/4/23	26																						
29	Construction of roothop (below + 17.75 mPD)	55 days	Fri 21/4/23	0%	Tue 27/6/23	28						-																
30	External Finishes	110 days	Wed 28/6/23	0%	Tue 7/11/23	29								1														
31	Internal Finishes (incl. installation of Door & Window etc)	110 days	Wed 28/6/23	0%	Tue 7/11/23	29								1														
32	Landscape works & other associated works	797 days	Mon 10/5/21	0%	Fri 12/1/24	13																						
33							1																					
34	E&M works	292 days	Sat 11/2/23	0%	Fri 2/2/24	26																ħ						
Project:		¢	Project Split Progre		tical Task	In	ilestone active Mile active Sum		¢		Manual Task Duration-only Manual Summ		¢ •	Star	nual Summary rt-only ish-only	•		External External Progress	Milestone	\$		Summary		÷				

Project:	Provision of Village Sewerage in Sai Kung									Services Dep of Village Se ontract No: D	partment of F werage in Sa DC/2019/09	IKSAR ai Kung														C	Date: June 202
ID 1	ask Name	Duration	Starting Date	Percentag	completio	n Date TRA	Predecessors	TRA Textlo) Jan "23	Feb '23	Mar (23	Apr 23	May '23	Jun '23	jul (23	Aug 23	Sep '23	kt/23	Nov (23))ec (23)	lan '24 🔡	Feb (24	Mar 124	Apr '24	May 24	m/24 Jul	1'24 Aug: 7 14 21 28 4 1
35	T&C (Stage 1) + T&C (Stage 2)	223 days	Tue 9/5/23	Completi 09	6 Fri 2/2/24		34FS-223 da		1 8 15 22	298 12 19 2	68 121926	2 9 1623	30 7 14 21 25	84 111825	<u>b 9 1623</u>	30 6 13 20 27	3 1017241	8 15 22 24	12 19 26	3 10 17 24 5	17 142128	1111825	3 10 17 24	17 14 21 2	8 5 112 119 26 2	9 16 23 30	7 14 21 28 4 1
36	T&C (Stage 3)	75 days	Sat 3/2/24	01	6 Thu 9/5/24		35															*					
37																											
38																											
39	Construction of PTO Village Sewerage	1173 days	Fri 24/7/20	07	6 Thu 4/7/24				-																		
40	Liaise with the village representatives	90 days	Fri 24/7/20	01	6 Mon 9/11/2	0																					
41	Initial survey and photo-taking	90 days	Wed 26/8/20	0	6 Fri 11/12/20		40SS+28 day																				
42	UU Detection and application for permit-to-dig	90 days	Mon 21/9/20	01	6 Sat 9/1/21		4188+22 da																				
43																											
44	Trial pit excavation (Access Date of PTO-B1-01: 22nd Oct 2020)	90 days	Thu 22/10/20	01	% Mon 8/2/21		42SS+25 day																				
45																											
46 47	Producing Layout plans showing the loction of terminal manholes, timber box and alignment of sewers and other associated preparation works	83 days	Tue 17/11/20	on	% Sat 27/2/21		44SS+21 days																				
48	Liaison with PTO VR	77 days	Mon 1/3/21	0	6 Mon 31/5/2	1	46		-																		
49																											
50	PTO-SW-01 (Open Trench, 18 nos. manholes (170m), and rising main(CH2+53.81 - CH4+36.66)	316 days	Tue 1/6/21	67	6 Thu 23/6/22	1																					
57	Landscape works for PTO-SW-01	316 days	Tue 1/6/21	67	6 Thu 23/6/22	2																					
59																											
60	PTO-SW-02 (Open Trench, 16nos. Manhole(145m), and a Section of Rising Main)	263 days	Fri 24/6/22	67	6 Sat 13/5/23								-														
67	Landscape works for PTO-SW-02	263 days	Fri 24/6/22	67	6 Sat 13/5/23								-														
69																											
70	PTO-SW-03 (Open Trench, 25 nos., Length: 360m)	390 days	Fri 24/6/22	67	6 Sat 14/10/23	3												-									
77	Landscape works for PTO-SW-03	390 days	Fri 24/6/22	67	6 Sat 14/10/23	3												-									
79																											
80			Fri 24/6/22		6 Wed 12/4/2																						
87	Landscape works for PTO-Trenchless-01	237 days	Fri 24/6/22	67	6 Wed 12/4/2	3						-															
89																											
90 97			Thu 13/4/23 Thu 13/4/23		6 Tue 2/4/24																						
97	Lannesage (WFK) NF F I S- I FURIHISS-92	207 mays	- AU 13/4/23	47	• rue 2/4/24							-												•			
100	Testing of PTO Village Sewerage	75 days	Wed 3/4/24	67	6 Thu 4/7/24																						,
102		-																									
103																											
104	Submarine Outfall by HDD Method with Cofferdam	492 days	Thu 15/12/22	67	6 Thu 15/8/24	•																					—
Project	DC/2019/09 Project Guide: Critical Task Summary	-	Split		ritical Task	,	Miles Inacti	tone ve Milestone	¢		Manual Task Duration-only		*		nual Summary rt-only	•		External 1 External N		۰		Summary		÷			
Page 2		¢	Progre	88	8			ve Summary			Manual Summ				ish-only			Progress		_	_						

Projec	t: Provision of Village Sewerage in Sai Kung							Draina; Provisio	e Services De on of Village S Contract No:	epartment of ewerage in S DC/2019/09	HKSAR Sai Kung															Date: June 2023
	Task Name	Duration	Starting Date	ercentage of Completion	Completion Date	TRAPredecessors TF	LA Textle	Jan '23	Feb '23	Mar 23 26 8 1 2 1 9 b	Apr 23	May 23 30 7 14 21 5	∳un '23 284 h1 h8	jui 23 bsb ja ja bia bia bia bia bia bia bia bia bia bi	Aug 23 3 50 6 1 3 20 2	Sep 23	0er 23	Nov 23	pec '23 sb hoh7b	Jan '24 24 51 17 14 121	Feb 24 bala hi hal	Mar'24 253 hoh72	Apr '24 4 31 7 14 21	May 24 1285 12195	Jun 124 6 2 9 16 23	իս:24 Aug 24 50 7 14 21 28 4 11
105																					Τ					
106	Construction of temporary working platform	111 days	Thu 15/12/22	0%	Fri 5/5/23	23FS+60 day		-			-		•	-		-			h							
107	Preparation of MDN	99 days	Mon 5/6/23	0%	Fri 29/9/23	106							*				3		ħ							
108	Construction of Cofferdam		Mon 4/12/23		Fri 2/2/24	106FS+24 d													T		1					
109	Pilot Drilling of HDD	26 days	Mon 11/12/23	0%	Fri 12/1/24	107														÷)						
110	Enlargement of HDD and Pipe Installation	52 days	Sat 13/1/24	0%	Sat 16/3/24	109														-						
111	Construction of difuser manifold	74 days	Mon 18/3/24	0%	Wed 19/6/24	110																				
112	Removal of cofferdam at both the manifold and the entry pit (including removal of silt curtain after removal of cofferdam)	30 days	Thu 11/4/24	0%	Fri 17/5/24																					
113																										
114	Testing of Submaine Outfall	75 days	Sat 18/5/24	0%	Thu 15/8/24																			-		-
116																										
117	Completion of Section 2	0 days	Thu 15/8/24	0%	Thu 15/8/24	115																				

	Task	Milestone								Sammary	8
Project:DC/2019/09		Summary									
	Split	 Project Summary	¢¢	Progress	Inactive Summary	 Manual Summary Rollup	•	Finish-only	 Progress		
Page 3											



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	C-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX C – METEORLOGICAL DATA




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	C-2
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

				Hong Kong	Observatory				King's Park	Waglan	Island^
Day	Mean Pressure (hPa)	Ai Absolute Daily Max (deg. C)	ir Temperatu Mean (deg. C)	re Absolute Daily Min (deg. C)	Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Mean Amount of Cloud (%)	Total Rainfall (mm)	Total Bright Sunshine (hours)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
1	1017.7	29.1	25.8	23.6	19.7	70	36	0	***	***	***
2	1015.5	28.4	25.8	24.4	21	75	56	0	***	***	***
3	1013.6	29.1	26	24.3	21.7	78	42	0	***	***	***
4	1013.9	29.4	26.3	24.7	21.8	76	34	0	***	***	***
5	1014.4	30.1	26.7	25	22.1	77	38	0	***	***	***
6	1015.1	30.7	27.6	25.3	20.3	65	31	0	***	***	***
7	1016.5	26.8	25.9	25.3	19.9	70	80	0	***	***	***
8	1015.8	26	25.2	24.7	20.8	77	88	0	***	***	***
9	1015.4	27.3	25.7	24.8	22.2	81	88	Trace	***	***	***
10	1016	29.3	26.9	25.6	23.5	82	83	0	***	***	***
11	1017.7	26.5	25.3	24.8	22.6	85	88	2.5	***	***	***
12	1020.2	26.6	24	22	19.5	77	84	0.6	***	***	***
13	1022.7	25.2	22	20.3	15.6	67	79	0	***	***	***
14	1022.6	23.9	20.8	18.9	15.2	70	79	0	***	***	***
15	1021.7	25.2	22.8	20.7	17.2	71	67	0	***	***	***
16	1023.6	24	21.5	17.3	14.4	65	66	0	***	***	***
17	1023.9	21.9	18.8	15.6	3.5	37	9	0	***	***	***
18	1022.9	23	19.5	16.6	6.2	42	21	0	***	***	***
19	1020.9	23.3	20.5	18.5	12.3	59	42	0	***	***	***
20	1019.4	24.6	21.3	19	14.2	65	23	0	***	***	***
21	1017.5	24.6	22	20.3	16.1	70	18	0	***	***	***
22	1016.3	25.7	22.6	20.5	17.4	73	26	0	***	***	***
23	1016.4	26.3	23	20.5	17.9	74	42	0	***	***	***
24	1019.6	25	22.9	21.5	16.3	67	36	0	***	***	***
25	1021	24.3	21.9	20	15.1	66	19	0	***	***	***
26	1020.1	25.3	22.1	19.8	15.8	68	20	0	***	***	***
27	1018.1	26.7	23	20.2	16.4	68	14	0	***	***	***
28	1018.7	25.4	22.8	20.2	14.9	61	37	Trace	***	***	***
29	1018.7	24	22.7	21.2	17.6	73	85	0.2	***	***	***
30	1019.9	26	23.8	21.9	18.6	73	79	0	***	***	***
Mean/Total	1018.5	26.1	23.5	21.6	17.3	69	50	3.3	***	***	***
Climatologic al Normal?	1017.3	24.5	22.2	20.3	16.7	72	58	39.3	172.3	70	26.6

Source: Daily Extract | Hong Kong Observatory(HKO) | Climate Information Service



APPENDIX D – AIR QUALITY MONITORING EQUIPMENT CALIBRATION CERTIFICATES

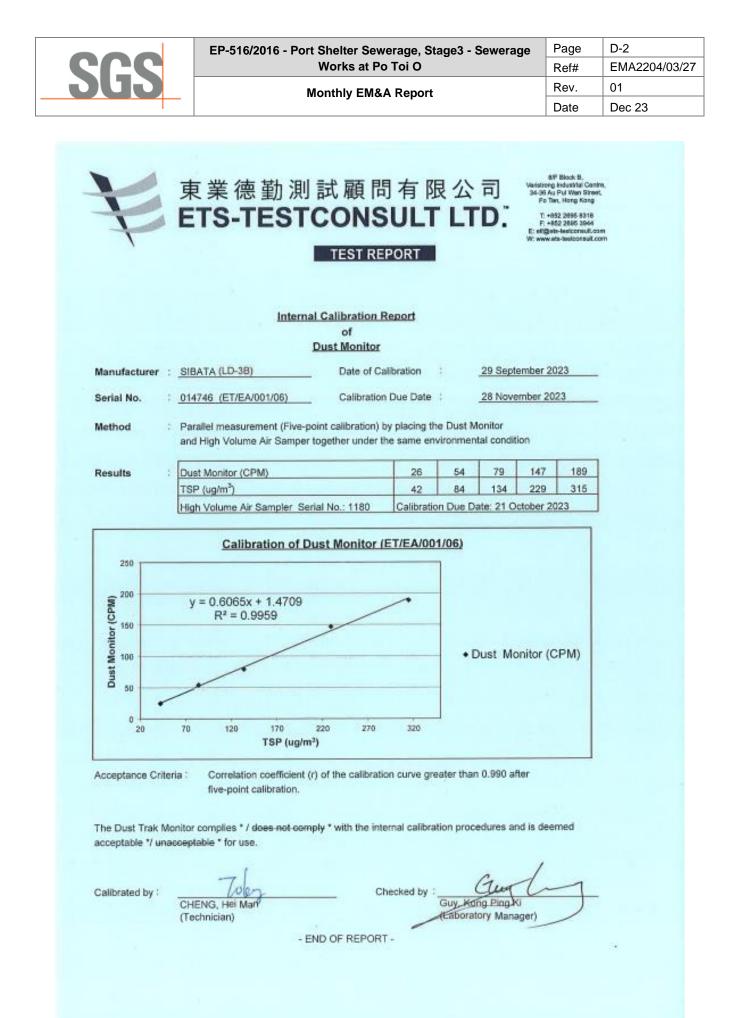


						Ref#	EMA2204
	Monthly EM&A	Report				Rev.	01
						Date	Dec 23
	東業德勤測試顧問	右限	小	= 1	Veristrong I	Block B, ndustrial Centre	
	ETS-TESTCONS				Fo Tan T: +85	Puli Wan Street, , Hong Kong 2 2695 8318	
	All and the second s	_	L 1	υ.	E: eli@ets	2 2695 3944 -testconsult.cor -testconsult.co	
	TEST REP	ORT					
	Internal Calibration Re	eport					
	of <u>Dust Monitor</u>					x	
Manufacturer :	SIBATA (LD-3B) Date of Cal	ibration ;	i.	28 Nove	mber 20	23	
Serial No.	014746 (ET/EA/001/06) Calibration	Due Date ;		27 Janua	ary 2024		
Method :	Parallel measurement (Five-point calibration) by and High Volume Air Samper together under the	10 10 10 10 10 To 10 10 10 10 10 10 10 10 10 10 10 10 10			on		
Results :	Dust Monitor (CPM)	24	55	81	150	185	
	TSP (ug/m ³)	40	85	138	233	310	
	High Volume Air Sampler Serial No.: 1180	Calibration	Due Da	ate: 20 De	ecember	2023	
-	Calibration of Dust Monitor (E	T/EA/001	/06)				
250							
200 150 100 50 50	y = 0.6066x + 1.211	~					
0 150	R ² = 0.9946						
100 IO			• 0	oust Mo	nitor (C	PM)	
Dust Dust	-						
-							
0 + 20	70 120 170 220 270 TSP (ug/m³)	320					
Acceptance Criter	ria : Correlation coefficient (r) of the calibration five-point calibration.	n curve grea	ater than	0.990 aff	ter		
The Dust Trak Ma	pnitor complies * / does not comply * with the inter	mal calibrati	on proce	edures an	d is deer	med	
	cceptable * for use.						


Calibrated by :

CHENG, Hei Man (Technician)

Checked by : Guy, Kong Ping Ki (Laboratory Manager)

- END OF REPORT -



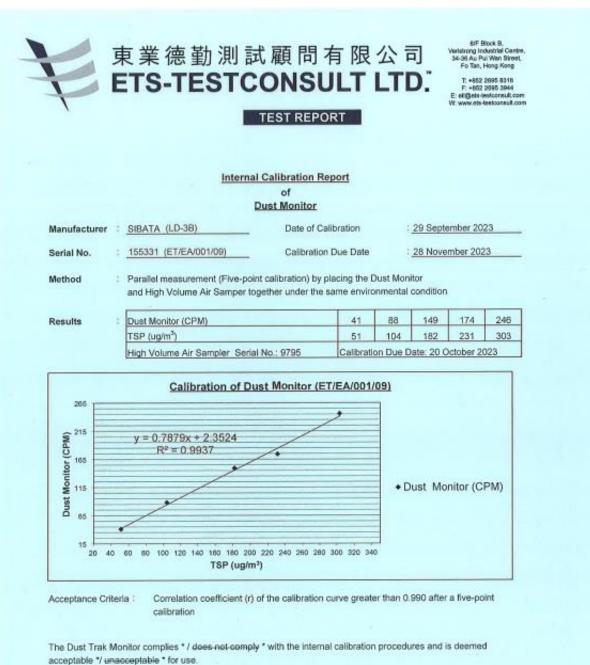

Calibrated by Checked by CHENG, Hei Guy Kong Ping Ki Mo (Technician) (Laboratory Manager)

- END OF REPORT -



Serial No.	: 155331 (ET/EA/001/09)	Calibration Due Date	27 Janua	ary 2024	
Method	: Parallel measurement (Five-po and High Volume Air Samper t				

50 100

173

237

300	Calibration of Dust Monitor (ET/	EA/001/09)
s 250	/	,
Dust Monitor (CPM)	y = 0.806x + 1.3672 R ² = 0.9938	
opito	/	Dust Monitor (CPM)
100 III		
50	/	

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point calibration

The Dust Trak Monitor complies * / does not comply * with the internal calibration procedures and is deemed acceptable */ unacceptable * for use.


Calibrated by : CHENG, Hei (Technician)

TSP (ug/m³)

Checked by Guy, Keng Ping K (Laboratory Manager)

305

- END OF REPORT -

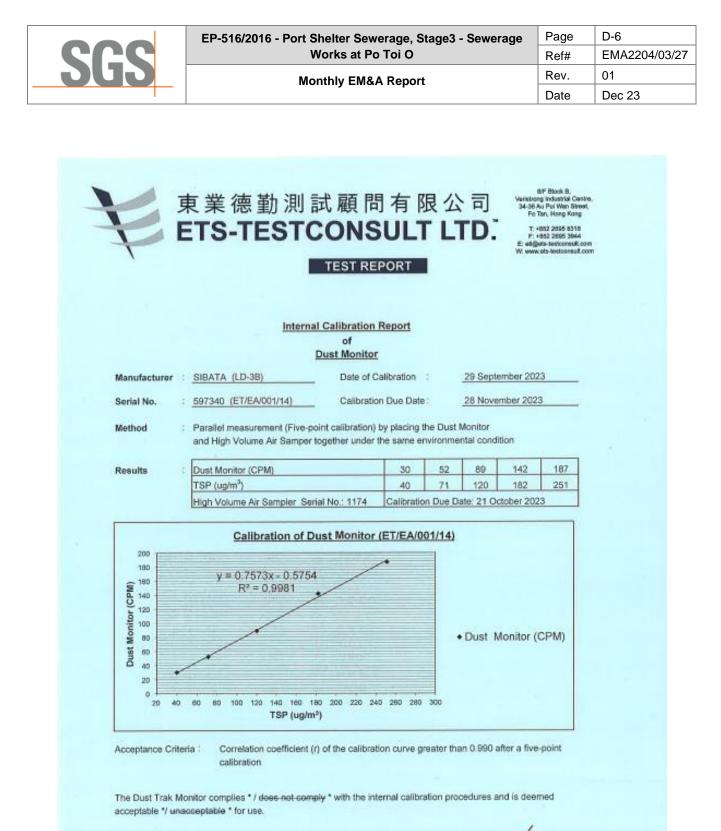


be. Checked by Calibrated by CHENG, Hel Man Guy, Keng Ping Ki (Laboratory Manager) (Technician) - END OF REPORT -





		TEST REP	PORT			W: www	ets-testconsult.com
	_						
	Internal	Calibration I of	Report				
	D	ust Monitor					
Aanufacturer	: SIBATA (LD-3B)	Date of Ca	alibration	\$	28 Nove	mber 202	3
Serial No.	: 597340 (ET/EA/001/14)	Calibration	n Due Date		27 Janu	ary 2024	
Results	: Parallel measurement (Five-poir and High Volume Air Samper to Dust Monitor (CPM)		2010			tion 146	191
toodito	TSP (ug/m ³)		37	70	125	187	256
	High Volume Air Sampler Seria	No.: 1174	Calibratio	n Due Da	ate: 20 De	cember 2	023
1.1.1	Calibration of Du	st Monitor	ET/EA/0	01/14)			
220				1			
200	y = 0.7291x + 5.771	/		-			
	R ² = 0.9977	/		_			
0 140 2 120	/						
Dust Monitor (CPM)	- /			Ξ.	Dust N	Ionitor (CPM)
08 M					Daor	ionitor (
d 40	/			-			
20			-	-			
	40 60 80 100 120 140 160 180	200 220 240	260 280	300			


The Dust Trak Monitor complies * / does not comply * with the internal calibration procedures and is deemed acceptable */ unacceptable * for use.


Calibrated by : CHENG, Hei M (Technician) Checked by Guy, Kong Ping Ki (Laboratory Manager) - END OF REPORT -

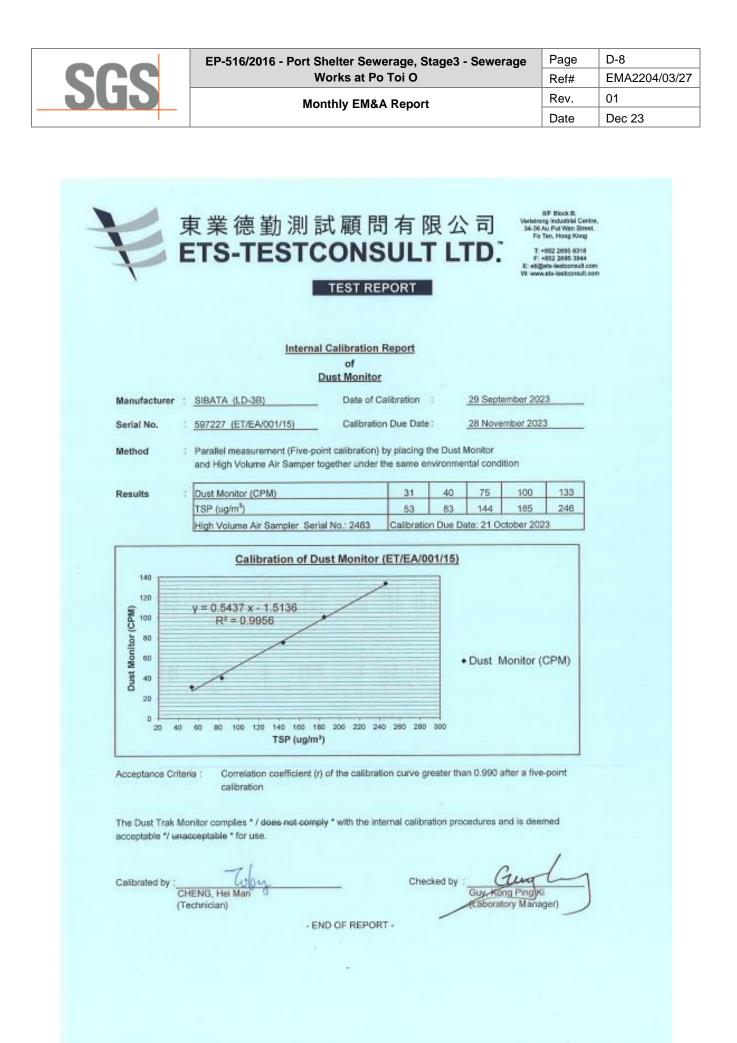

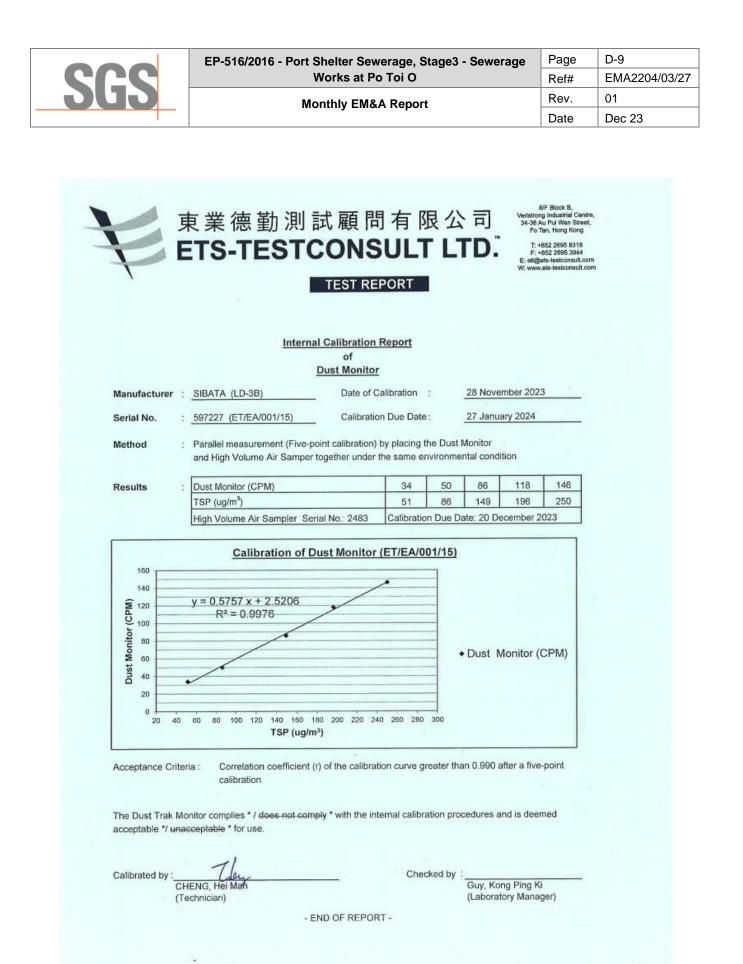

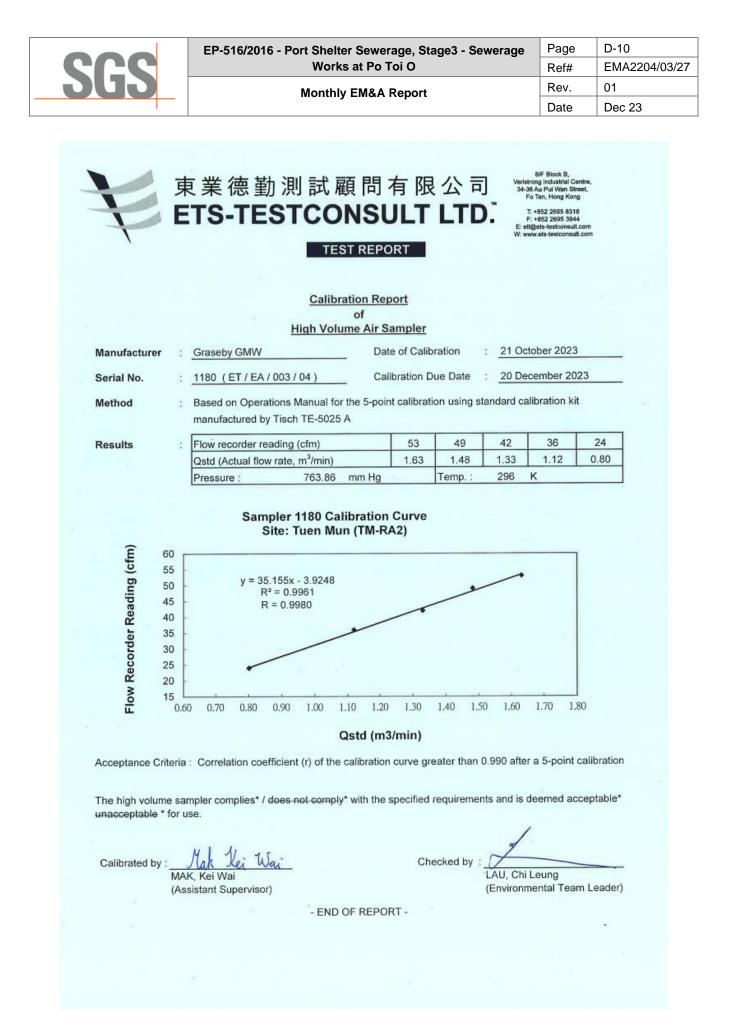

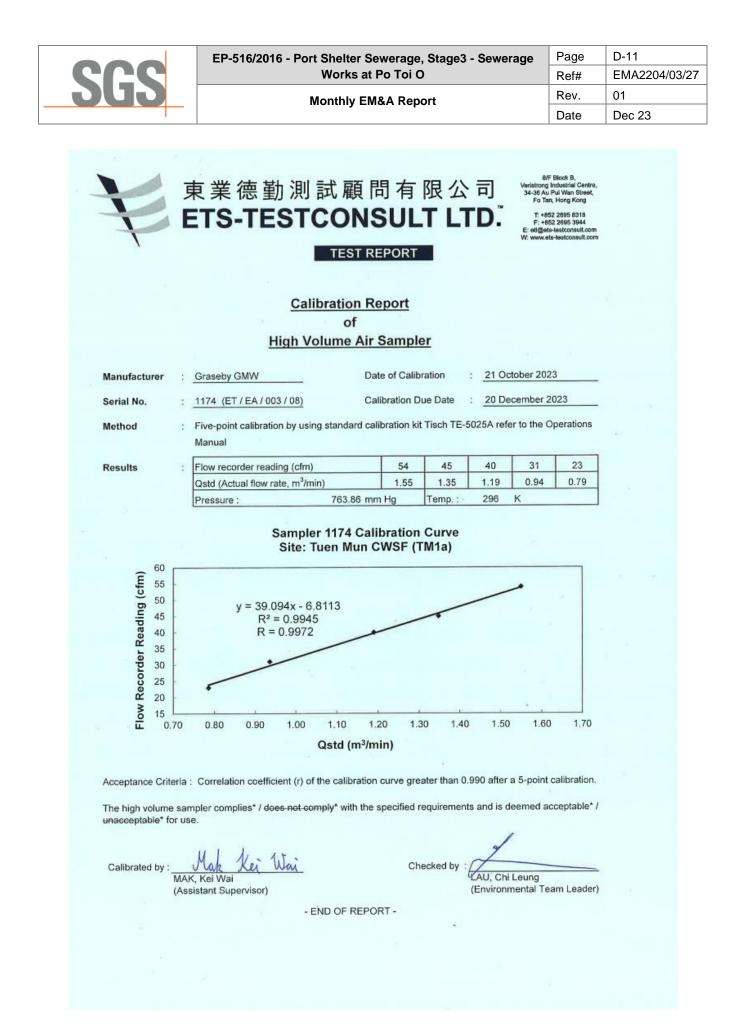

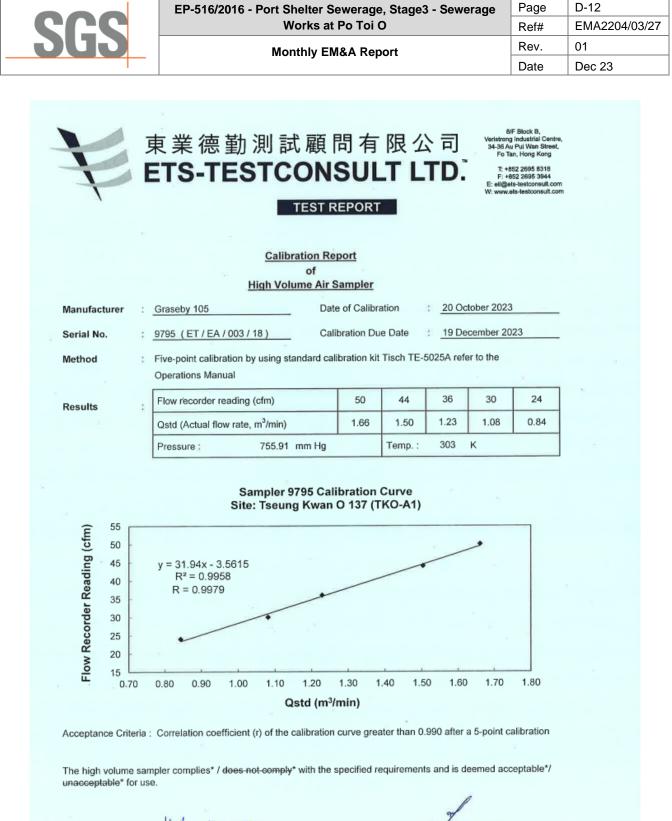

Calibrated by :


Wa MAK, Kei Wai (Assistant Supervisor)

Checked by 3 LAU, Chi Leung (Environmental Team Leader)

- END OF REPORT -

000	EP-516/2016 - Port Shelter Sewe		Sewerage	Page	D-13
	Works at Po	Τοί Ο		Ref#	EMA2204/03/2
	Monthly EM&A	Report		Rev.	01
I				Date	Dec 23
	夏業德勤測試顧問 TS-TESTCONS TEST REP	ULT LT		8/F Block B, ong Industrial Centre, Au Pul Wan Street, Tan, Hong Kong +852 2895 8318 +852 2895 3844 @ets-testconsult.com w.ets-testconsult.com	
	Calibration Rep	ort			
	of High Volume Air Sa	mpler			
			. 21 Ostaba	2022	
Manufacturer :	Graseby GMW Da	e of Calibration	: 21 Octobe	2023	
Serial No.	2483 (ET / EA / 003 / 26) Ca	ibration Due Date	: 20 Decem	per 2023	.
Method :	Five-point calibration by using standard calib Manual	ration kit Tisch TE-	5025A refer to	the Operations	
Results :	Flow recorder reading (cfm)	54 47	40	34 25	
	Qstd (Actual flow rate, m ³ /min) Pressure : 763.86 mm Hg	1.56 1.36	1.13 0 296 K	.95 0.77	-
60 55 45 40 30 20 070	y = 35.708x - 1.1413 R ² = 0.9912 R = 0.9956		-		
Ⅲ 0.70	0.80 0.90 1.00 1.10 1.20	1.30 1.40	1.50 1.	60 1.70	
	Qstd (m³/min)				
Acceptance Criteria	Correlation coefficient (r) of the calibration c	urve greater than 0	.990 after a 5-p	oint calibration	
	npler complies* / does not comply* with the sp				
Collinated by a	Mak V: 1500	Checked by 1	7_		
	Mak Lei Wai	Checked by :	LAU, Chi Leur		-
MAI	sistant Supervisor)			ng al Team Leader)
MAI					

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-14
	Works at Po Toi O	Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

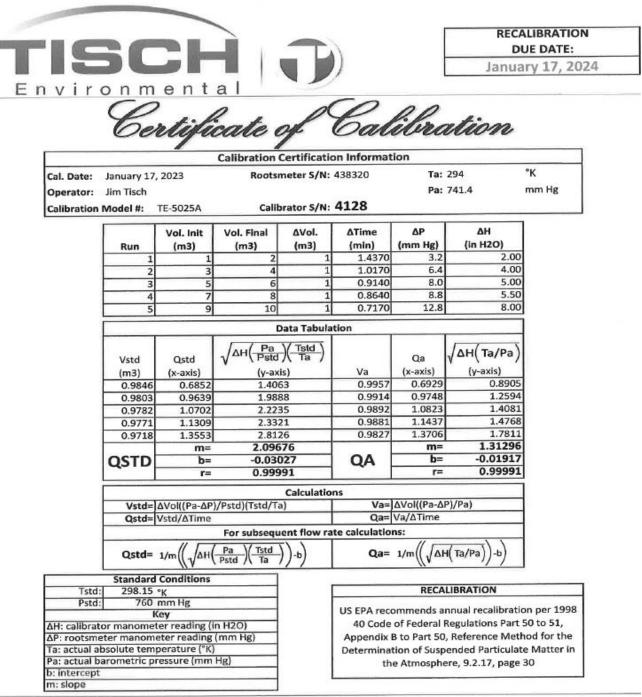

Tisch Environmental, Inc. 145 South Miami Avenue

Village of Cleves, OH 45002

www.tisch-env.com TOLL FREE: (877)263-7610 FAX: (513)467-9009



APPENDIX E – METHODOLOGY FOR CORRELATION CALCULATION BETWEEN POTABLE LASER DUST METER AND HIGH-VOLUME SAMPLER



Correlation between Portable laser dusty meter and High-volume Sampler Methodology

Correlation results between the direct reading meter and High-Volume Sampler

High – Volume Sampler Calibration

The specification, a sample of calibration certificate and certificate of comparison check with High volume sampler of the proposed air quality monitoring equipment listed in Table 2.1 are attached in appendix.

The High-Volume air sampler calibration procedure based on the requirement of manufacturer is shown below.

- a. Disconnect the sampler motor from the mass flow controller and connect the motor to a stable AC power source.
- b. Mount the calibrator orifice and top loading adapter plate to the sampler. A sampling filter is generally not used during this procedure. Tighten the top loading adapter hold down nuts securely to ensure that no air leaks are present.
- c. Allow the sampler motor to warm up to its normal operating temperature
- d. (approximately 10-15 minutes).
- e. Conduct a leak test by covering the hole(s) on top of the orifice and pressure tap on the orifice with your hands. Listen for a high-pitched squealing sound made by escaping air. If this sound is heard, a leak is present and the top loading adapter hold-down nuts need to be re-tightened. If the sound is lower, the leak is near one of the other gaskets in the system. Avoid running the sampler for longer than 30 seconds at a time with the orifice blocked to avoid overheating the motor. Do not perform this leak test procedure with a manometer connected to the side tap on the calibration orifice or the blower motor. Liquid from the manometer could be drawn into the system and cause motor damage
- f. Connect one side of a water manometer to the pressure tap on the side of the orifice with a rubber vacuum tube. Leave the opposite side of the manometer open to the atmosphere. Note: Both valves on the manometer have to be open for the liquid to flow freely. One side of the 'U' tube goes up the other goes down; add together for the "H2O reading.
- g. A manometer must be held vertically to ensure accurate readings. Tapping the backside of the continuous flow recorder will help to center the pen and provide accurate readings. When using a variable orifice, five flow rates are achieved in this step by adjusting the knob on the variable orifice to five different positions and taking five different reading.



- h. Record the ambient air temperature, the ambient barometric pressure, the sampler serial number, the orifice s/n, the orifice slope and intercept with date last certified, today's date, site location and the operators initial on the attached blank calibration sheet.
- i. An example of a Lead (or TSP) Sampler Calibration Data Sheet has been attached with data filled in from a typical calibration. This includes the transfer standard orifice calibration relationship which was taken from the Orifice Calibration Worksheet that accompanies the calibrator orifice.

Disconnect the sampler motor from its power source and remove the orifice and top loading adapter plate. Re-connect the sampler motor to the electronic mass flow controller.

Since this calibration is for a TSP sampler, the slope and intercept for this orifice uses standard flows rather than actual flows and is taken from the Q standard section of the Orifice Calibration Worksheet. The Q actual flows are only used when calibrating a PM-10 sampler.

The five orifice manometer readings taken during the calibration have been recorded in the column on the data worksheet titled Orifice "H2O. The five continuous flow recorder readings taken during the calibration have been recorded under the column titled I chart.

The orifice manometer readings need to be converted to the standard air flows they represent using the following equation:


 $Qstd = 1/m[Sqrt((H_20)(Pa/760)(298/Ta))-b]$

where:

Qstd = actual flow rate as indicated by the calibrator orifice, m^3/min H₂O = orifice manometer reading during calibration, "H₂O

- Ta = ambient temperature during calibration, K (K = 273 + °C)
- 298 = standard temperature, a constant that never changes, K
- Pa = ambient barometric pressure during calibration, mm Hg
- 760 = standard barometric pressure, a constant that never changes, mm Hg $\,$
- m = *Qstandard slope of orifice* calibration relationship

b = *Qstandard intercept of orifice* calibration relationship.



Once these standard flow rates have been determined for each of the five run points, they are recorded in the column titled Qstd and are represented in cubic meters per minute.

The continuous flow recorder readings taken during the calibration need to be corrected to the current meteorological conditions using the following equation:

IC = I[Sqrt((Pa/760)(298/Ta))]

where:
IC = continuous flow recorder readings corrected to current Ta and Pa
I = continuous flow recorder readings during calibration
Pa = ambient barometric pressure during calibration, mm Hg.
760 = standard barometric pressure, a constant that never changes, mm Hg
Ta = ambient temperature during calibration, K (K = 273 + °C)
298 = standard temperature, a constant that never changes, K

After each of the continuous flow recorder readings have been corrected, they are recorded in the column titled IC (corrected).


Using Qstd and IC (or FLOW (corrected)) as the x and y axis respectively, a slope, intercept, and correlation coefficient can be calculated using the least squares regression method. The correlation coefficient should never be less than 0.990 after a five-point calibration. A coefficient below .990 indicates a calibration that is not linear, and the calibration should be performed again. If this occurs, it is most likely the result of an air leak during the calibration or high wind speed during the calibration procedure.

The equations for determining the slope (m) and intercept (b) are as follows:

m=
$$\frac{\frac{(\sum x)(\sum y)}{\sum xy - n}}{\frac{(\sum x)^2}{\sum x^2 - n}}; \quad b = \overline{y} - m\overline{x}$$

The equation for the coefficient of correlation (r) is as follows:

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page Ref#	E-5 EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

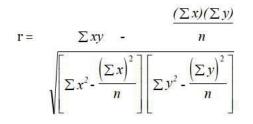

where: n = number of observations $\sum = sum of$

The acceptable operating flow range of a TSP sampler is 1.1 to 1.7 m3/min (39 to 60 CFM). Looking at the worksheet column Qstd(see page 38), the flow rates that are within this range can be identified along with the chart reading (I) that represents them. For instance, if you wanted to set this sampler at 1.265 m3/min (44.67 CFM) (Make sure the mass flow controller is plugged in and a filter is in place) you would turn the Flow Adjustment screw until the continuous flow recorder read 37 on the chart. By making sure that the sampler is operating at a chart reading (or manometer reading) that is within the acceptable range, it can be assumed that valid TSP data is being collected.

A calibration that has a correlation coefficient of less than .990 is not considered linear and should be re-calibrated. Therefore, if r < 0.990, return all the points or only the point with the greatest deviation and the recalculate.

The 24-hour TSP levels to be measured by direct reading methods, utilising portable Laser Particle Photometer Monitors (Sibata Model LD-3B), in place of High-Volume Sampler (HVS) if HVS experience difficulties in operation during monitoring. It is demonstrated by the previous project experiences, that 24-hour TSP monitoring results collected by direct reading method are comparable to those produced by the high-volume sampling method, to indicate short event impacts. The projects utilising the collection of 24-hour TSP levels data by direct reading methods are shown below.

Project Reference for utilising the collection of 24-hour TSP levels data by direct reading methods

Project Contract Number	Location	Status
NDO 03/2018	Road Widening and Retrofitting Noise Barriers on	On-going
	Tai Po Road (Sha Tin Section)	



NDO 14/2018	Advance and First Stage Works of Kwu Tung North	On-going
	and Fanling North New Development Areas	

Calculation of the value of 24-hour TSP concentration is given by the average of 24 calculated 1-hour TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and High-Volume Sampler.

The correlation results between the direct reading meter and High-Volume Sampler shall be review with bimonthly internal calibration. To maintain the correlation with two sets of data (monitoring data from HVS and monitoring data from Portable Laser Particle Photometer Monitors) bimonthly internal calculated are strongly linked together two sets of data.

To protect the dust meter from being damaged and to operate without disturbances or nuisance, temporary barriers shall be erected around the monitoring equipment during the monitoring period. Temporary barriers will be placed approx. 0.5m away from the dust meter.

Maintenance/ Calibration for the High-Volume Sampler (HVS) being correlation

The HVS shall be calibrated bimonthly in accordance to the specification in the manufacturer's manual. The calibration certificates shall be available to the IEC for checking upon request. The validity and accuracy of the HVS shall also be tested against the result by the TE-5025A Calibration Kit periodically, Details of Calibration Cert and Specification for HVS – Graseby GMW and HVS- Calibration Kit TE-5025A are given in Appendix 2-1 and Appendix 2-3.

Graseby GMW is chosen as the HVS for 24-hour TSP monitoring and Tisch TE – 5025A is chosen as the HVS Calibration-Kit for HVS calibration.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	F-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX F – AIR QUALITY AND NOISE IMPACT MONITORING SCHEDULE



2023 November Air Quality and Noise Impact Monitoring Schedule

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
29-Oct	30-Oct	31-Oct	1-Nov	2-Nov	3-Nov	4-Nov
			1 hr TSP x 3 24 hr TSP Noise (30 mins)			
5-Nov	6-Nov	7-Nov	8-Nov	9-Nov	10-Nov	11-Nov
		1 hr TSP x 3 24 hr TSP Noise (30 mins)				
12-Nov	13-Nov 1 hr TSP x 3 24 hr TSP Noise (30 mins)	14-Nov	15-Nov	16-Nov	17-Nov 1 hr TSP x 3 24 hr TSP	18-Nov
19-Nov	20-Nov	21-Nov	22-Nov	23-Nov 1 hr TSP x 3 24 hr TSP Noise (30 mins)	24-Nov	25-Nov
26-Nov	27-Nov		29-Nov 1 hr TSP x 3 24 hr TSP Noise (30 mins)	30-Nov	1-Dec	2-Dec



2023 December Air Quality and Noise Impact Monitoring Schedule

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
26-Nov	27-Nov	28-Nov	29-Nov	30-Nov	1-Dec	2-Dec
			1 hr TSP x 3 24 hr TSP Noise (30 mins)			
3-Dec	4-Dec	5-Dec	6-Dec	7-Dec	8-Dec	9-Dec
3-060		1 hr TSP x 3 24 hr TSP Noise (30 mins)		7-666	o Liel	3.060
10-Dec	11-Dec	12-Dec	13-Dec	14-Dec	15-Dec	16-Dec
	1 hr TSP x 3 24 hr TSP Noise (30 mins)					1 hr TSP x 3 24 hr TSP
17-Dec	18-Dec	19-Dec	20-Dec	21-Dec	22-Dec	23-Dec
					1 hr TSP x 3 24 hr TSP Noise (30 mins)	
24-Dec	25-Dec	26-Dec	27-Dec	28-Dec	29-Dec	30-Dec
				1 hr TSP x 3 24 hr TSP Noise (30 mins)		
31-Dec	1-Jan	2-Jan	3-Jan	4-Jan	5-Jan	6-Jan
			1 hr TSP x 3 24 hr TSP Noise (30 mins)			

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	G-1
SGS	Works at Po Toi O	Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

APPENDIX G – AIR QUALITY MONITORING RESULT

	ED 516/2016 Dart Shaltar Sawaraga Stage? Sawaraga Warks at Da Tai O	Page	G-2
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report		01
		Date	Dec 23

2023 November 1-hour Monitoring Data

Monitoring Location: AMS1N

				1-hour TSP Monitoring	
Date	Weather		Start Time	Concentration (µg/m³)	Average Concentration (µg/m ³)
		1st hr	9:38	34.0	
1- Nov -23	Fine	2nd hr	10:38	44.0	42.0
		3rd hr	13:10	48.0	
7- Nov -23		1st hr	9:40	45.0	
	Cloudy	2nd hr	10:40	55.0	49.7
		3rd hr	13:10	49.0	
	Fine	1st hr	10:45	36.0	
13- Nov -23		2nd hr	13:45	39.0	37.0
		3rd hr	14:45	36.0	
	Fine	1st hr	9:00	50.0	
17- Nov -23		2nd hr	10:00	55.0	53.3
		3rd hr	11:00	55.0	
		1st hr	9:37	43.0	
23- Nov -23	Fine	2nd hr	10:37	62.0	51.0
		3rd hr	13:10	48.0	
		1st hr	9:36	67.0	
29- Nov -23	Cloudy	2nd hr	10:36	68.0	64.0
	-	3rd hr	13:10	57.0	
				Average:	46.6
				Action Level:	319
				Limit Level:	500

	ED 516/2016 Dest Shelter Severage Stage? Severage Werke at De Tei O	Page	G-3
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November 1-hour Monitoring Data

Monitoring Location: AMS2N1

				1-hour TSP Monitoring	
Date	Weather		Start Time	Concentration (µg/m ³)	Average Concentration (µg/m³)
		1st hr	9:46	36.0	
1- Nov -23	Fine	2nd hr	10:46	43.0	40.0
		3rd hr	13:08	41.0	
		1st hr	9:45	43.0	
7- Nov -23	Cloudy	2nd hr	10:45	45.0	45.7
		3rd hr	13:08	49.0	
	Fine	1st hr	10:40	56.0	
13- Nov -23		2nd hr	13:40	63.0	60.3
		3rd hr	14:40	62.0	
	Fine	1st hr	9:05	87.0	
17- Nov -23		2nd hr	10:05	89.0	88.3
		3rd hr	13:00	89.0	
		1st hr	9:39	43.0	
23- Nov -23	Fine	2nd hr	10:39	49.0	45.7
		3rd hr	13:08	45.0	
		1st hr	9:44	62.0	
29- Nov -23	Cloudy	2nd hr	10:44	56.0	56.3
	-	3rd hr	13:08	51.0	
				Average:	56.0
				Action Level:	279
				Limit Level:	500

	ED 516/2016 Dest Shalter Severage Stage? Severage Werke at De Tei O	Page	G-4
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November 1-hour Monitoring Data

Monitoring Location: AMS3N

	1-hour TSP Monitoring				
Date	Weather		Start Time	Concentration (µg/m ³)	Average Concentration (µg/m³)
		1st hr	9:49	34.0	
1- Nov -23	Fine	2nd hr	10:49	31.0	30.7
		3rd hr	13:05	27.0	
		1st hr	9:49	42.0	
7- Nov -23	Cloudy	2nd hr	10:49	40.0	40.7
		3rd hr	13:05	40.0	
	Fine	1st hr	10:34	39.0	
13- Nov -23		2nd hr	13:34	36.0	37.7
		3rd hr	14:34	38.0	
	Fine	1st hr	9:10	52.0	
17- Nov -23		2nd hr	10:10	54.0	53.3
		3rd hr	13:05	54.0	
		1st hr	9:48	40.0	
23- Nov -23	Fine	2nd hr	10:48	48.0	43.3
		3rd hr	13:05	42.0	
		1st hr	9:47	63.0	
29- Nov -23	Cloudy	2nd hr	10:47	55.0	58.3
		3rd hr	13:05	57.0	
				Average:	41.1
				Action Level:	303
				Limit Level:	500


	ED 516/2016 Dest Shelter Severage Stage? Severage Werke at De Tei O	Page	G-5
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November 1-hour Monitoring Data


Monitoring Location: AMS4N

				1-hour TSP Monitoring	
Date	Weather		Start Time	Concentration (µg/m ³)	Average Concentration (µg/m³)
		1st hr	9:42	35.0	
1- Nov -23	Fine	2nd hr	10:42	35.0	33.7
		3rd hr	13:00	31.0	
7- Nov -23		1st hr	9:42	44.0	
	Cloudy	2nd hr	10:42	45.0	42.7
		3rd hr	13:00	39.0	
	Fine	1st hr	10:26	40.0	
13- Nov -23		2nd hr	13:26	40.0	39.7
		3rd hr	14:26	39.0	
	Fine	1st hr	9:15	47.0	
17- Nov -23		2nd hr	10:15	50.0	49.0
		3rd hr	13:10	50.0	
		1st hr	9:43	42.0	
23- Nov -23	Fine	2nd hr	10:43	55.0	45.3
		3rd hr	13:00	39.0	
		1st hr	9:40	64.0	
29- Nov -23	Cloudy	2nd hr	10:40	61.0	61.3
		3rd hr	13:00	59.0	
				Average:	42.1
				Action Level:	278
				Limit Level:	500


	ED 516/2016 Dert Shelter Sewarana Stans? Sewarana Warks at De Tei O	Page	G-6
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report	Rev.	01
		Date	Dec 23

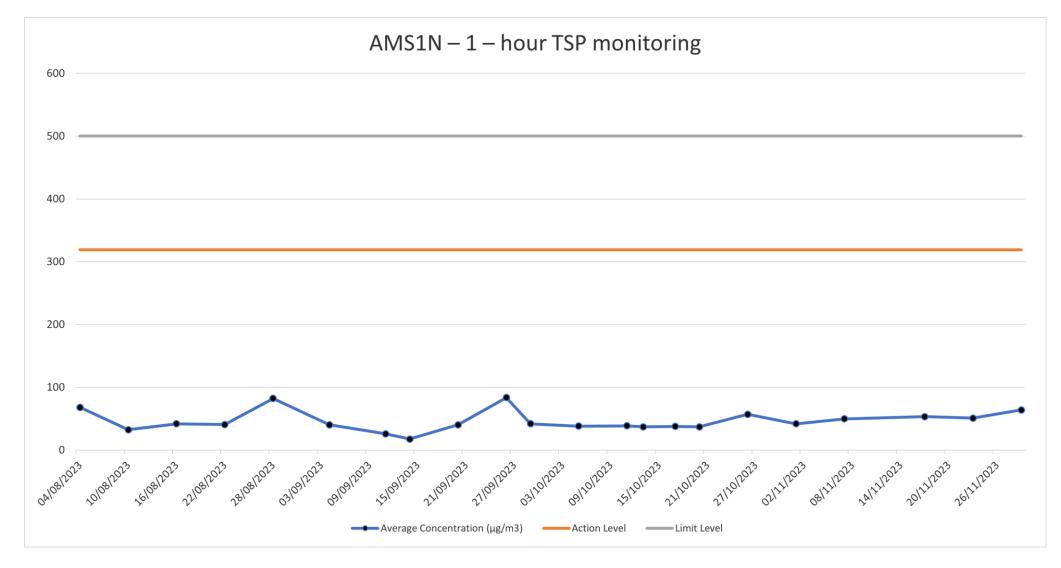


	ED 516/2016 Dart Shaltar Sawarana Stana3 Sawarana Warka at Da Tai O	Page	G-7
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report	Rev.	01
		Date	Dec 23

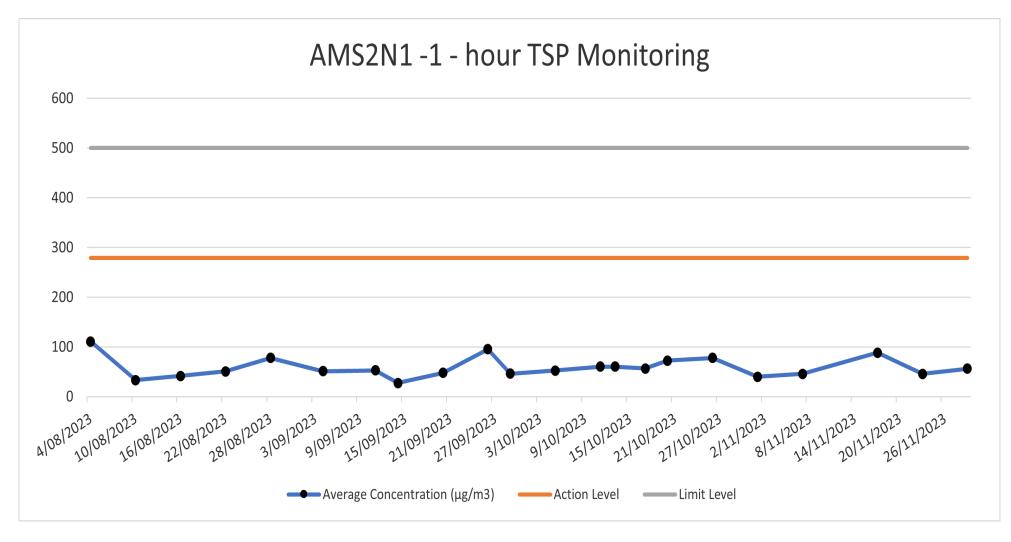

000	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	G-8
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

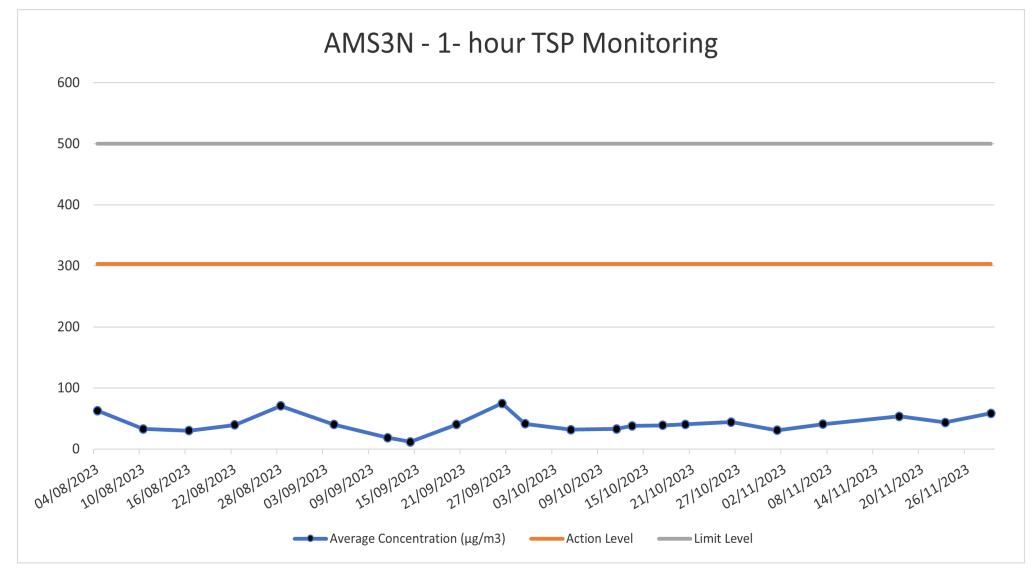

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	G-9
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

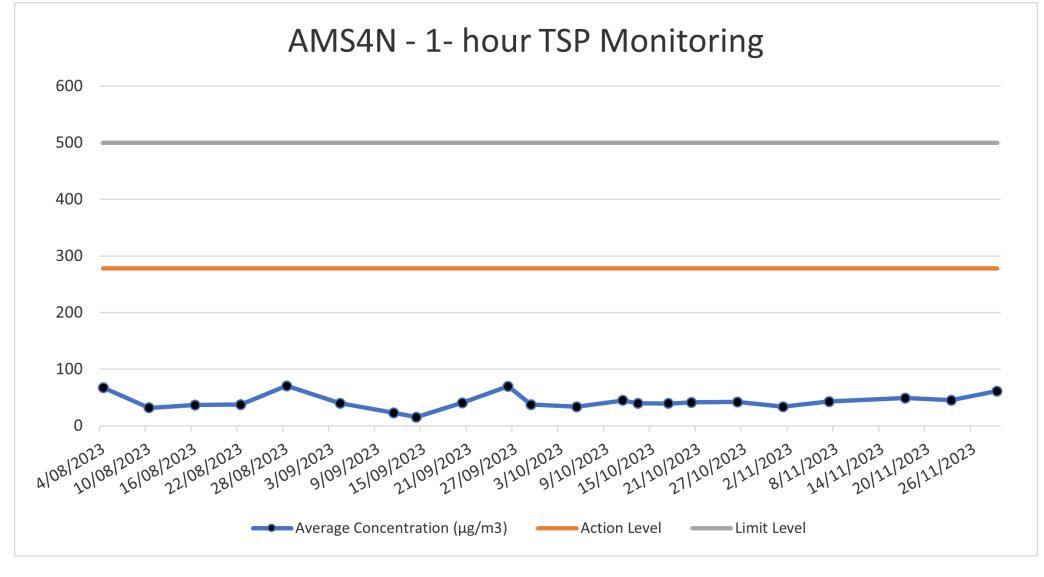

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po	Page	G-10
SGS		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November 24-hour Monitoring Data

Monitoring Location: AMS1N

Hour	1- Nov -23	7- Nov -23	13- Nov -23	17- Nov -23	23- Nov -23	29- Nov -23
1	33	48	29	43	56	56
2	29	43	34	41	48	53
3	28	40	35	46	43	69
4	30	35	32	43	41	53
5	28	34	28	39	44	60
6	27	33	31	37	45	58
7	27	37	26	40	43	58
8	25	35	30	43	41	55
9	24	38	29	45	41	52
10	24	40	31	49	37	50
11	22	41	26	51	35	42
12	24	39	30	54	36	35
13	27	38	28	46	33	36
14	28	40	29	38	34	33
15	29	43	29	32	35	33
16	29	43	32	48	40	34
17	25	44	31	46	41	32
18	29	45	29	43	37	33
19	32	47	33	43	36	38
20	31	53	32	37	47	39
21	41	49	35	46	45	46
22	46	51	33	50	58	40
23	39	45	35	53	41	41
24	37	39	38	57	44	48
Average:	30	42	31	45	42	46
24-hr TSP (µg/m³; with						
correlation(x)	35	50	36	54	50	55
Action Level:	153		I	1	1	1
Limit Level:	260					

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po	Page	G-11
	Toi O	Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November 24-hour Monitoring Data

Monitoring Location: AMS2N1

Hour	1- Nov -23	7- Nov -23	13- Nov -23	17- Nov -23	23- Nov -23	29- Nov -23
1	19	26	35	53	28	40
2	23	31	32	58	26	44
3	17	25	31	58	25	51
4	18	25	26	54	26	48
5	20	21	25	48	26	45
6	16	20	21	43	28	42
7	14	22	28	54	30	41
8	15	26	25	50	29	40
9	16	28	25	46	29	42
10	16	28	27	43	24	35
11	15	27	27	49	20	29
12	18	25	27	44	20	25
13	20	26	27	53	18	23
14	21	26	30	54	19	24
15	23	30	23	51	20	24
16	20	32	26	57	23	25
17	20	33	25	57	22	22
18	21	31	23	49	25	26
19	25	32	27	46	21	27
20	26	34	32	42	28	24
21	34	35	35	47	27	30
22	30	39	33	45	29	27
23	24	32	38	61	25	25
24	20	28	34	54	24	31
Average:	20	28	29	51	25	33
24-hr TSP (µg/m³; with						
correlation(x)	40	54	56	96	49	53
Action Level:	179		I	<u> </u>	I	1
Limit Level:	260					

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po	Page	G-12
	Toi O	Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November 24-hour Monitoring Data

Monitoring Location: AMS3N

Hour	1- Nov -23	7- Nov -23	13- Nov -23	17- Nov -23	23- Nov -23	29- Nov -23
1	17	34	30	32	40	52
2	18	40	29	37	42	53
3	22	33	25	36	40	62
4	23	30	29	40	38	64
5	24	27	29	44	39	57
6	19	29	30	42	42	59
7	18	33	31	41	39	55
8	20	35	29	46	38	54
9	20	38	24	40	37	54
10	22	35	27	37	33	47
11	21	36	29	35	29	37
12	23	37	30	33	28	33
13	26	37	30	40	31	34
14	27	41	27	34	31	34
15	25	42	30	33	34	34
16	22	40	28	37	35	35
17	25	40	31	42	36	35
18	26	39	30	44	33	37
19	29	42	30	48	32	39
20	28	42	31	41	36	33
21	35	38	33	39	36	31
22	33	39	34	33	35	32
23	27	36	31	36	35	39
24	27	32	30	35	38	50
Average:	24	36	29	39	36	44
24-hr TSP						
(µg/m ³ ; with						
correlation(x)	32	48	39	52	48	52
Action Level:	158		I	1	1	1
Limit Level:	260					


	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po	Page	G-13
2 .72	Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
	······································	Date	Dec 23

2023 November 24-hour Monitoring Data


Monitoring Location: AMS4N

Hour	1- Nov -23	7- Nov -23	13- Nov -23	17- Nov -23	23- Nov -23	29- Nov -23
1	20	29	25	28	34	41
2	18	37	25	27	37	41
3	21	31	23	33	37	50
4	22	27	23	32	34	51
5	23	22	26	35	33	48
6	21	23	27	39	35	46
7	20	23	30	43	35	45
8	20	27	27	40	32	45
9	18	30	26	36	32	46
10	18	31	28	32	30	39
11	19	33	25	26	25	28
12	20	32	26	28	23	26
13	23	32	25	33	24	26
14	27	34	29	31	25	27
15	26	36	25	33	25	25
16	25	33	28	31	26	24
17	25	31	26	29	27	22
18	24	35	25	27	27	23
19	27	38	29	26	25	24
20	29	39	26	24	30	22
21	36	34	23	23	31	27
22	37	36	24	25	33	26
23	30	33	28	28	30	30
24	31	27	26	25	35	36
Average:	24	31	26	31	30	34
24-hr TSP						
(µg/m³; with						
correlation(x)	37	49	40	48	47	54
Action Level:	144		•	•	•	
Limit Level:	260	1				


000	ED 516/2016 Dest Shalter Sewarana Stane? Sewarana Werka et De Tei O	Page	G-14
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
<u> </u>	Monthly EM&A Report	Rev.	01
		Date	Dec 23

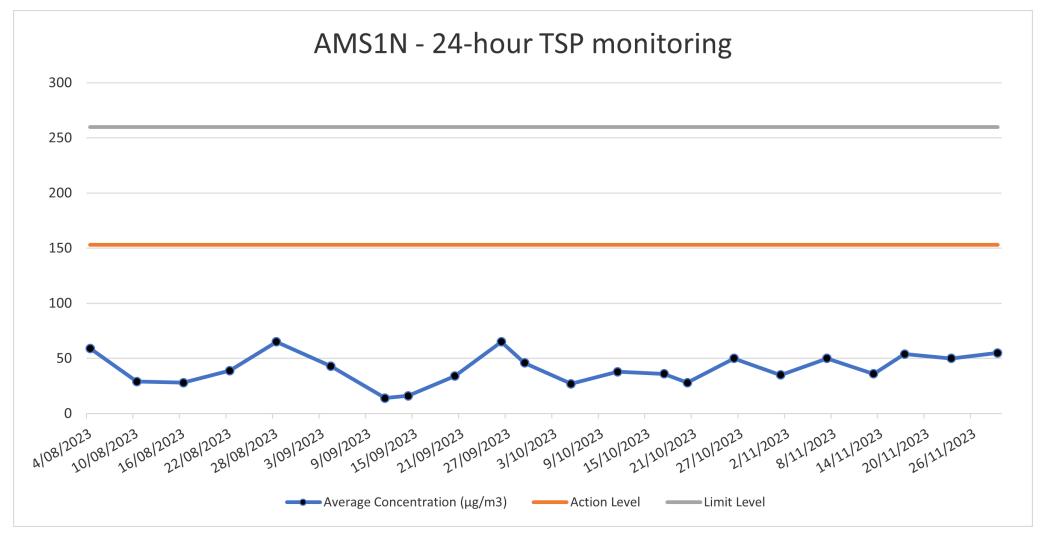


	ED 516/2016 Dert Shalter Sewarana Stane? Sewarana Warks at De Tei O	Page	G-15
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
343	Monthly EM&A Report	Rev.	01
		Date	Dec 23

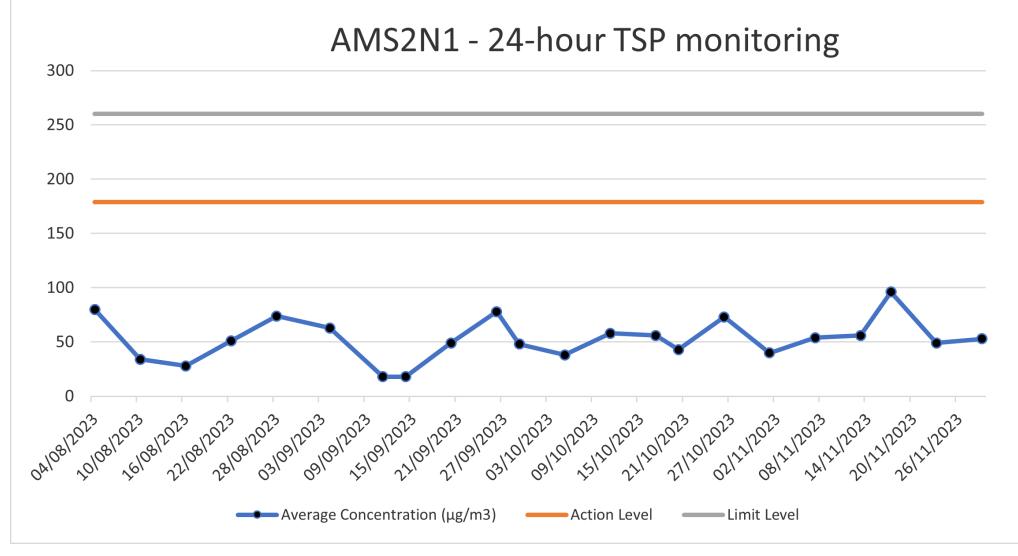

000	ED 515/2016 Dart Shelter Sourcease Stars? Sourcease Works at De Tei O	Page	G-16
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

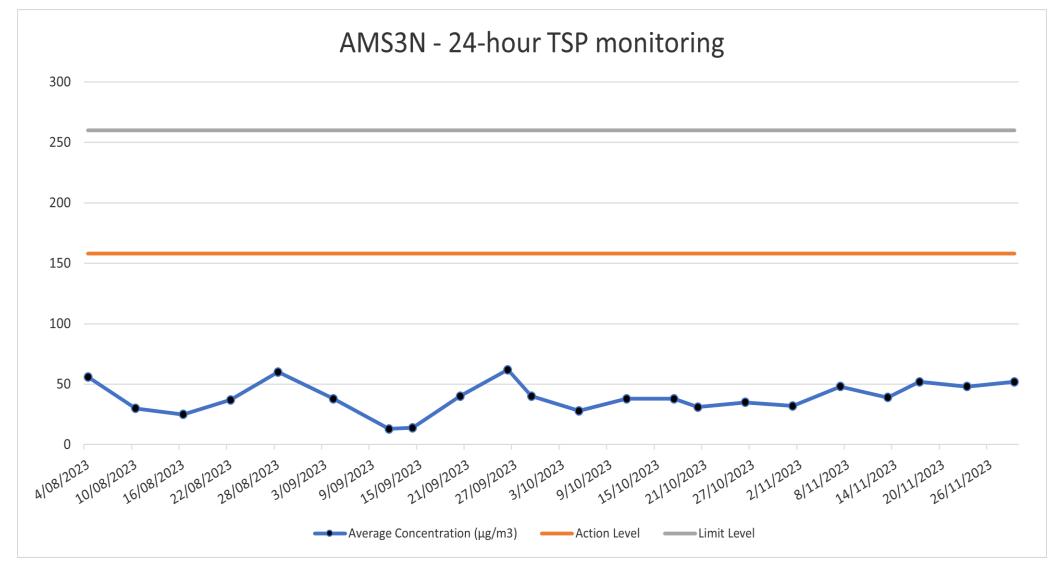

000	ED 540/2040 Dart Chalter Coursense Stars2 Coursense Works at Da Tai O	Page	G-17
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUD	Monthly EM&A Report	Rev.	01
	········, =·······	Date	Dec 23

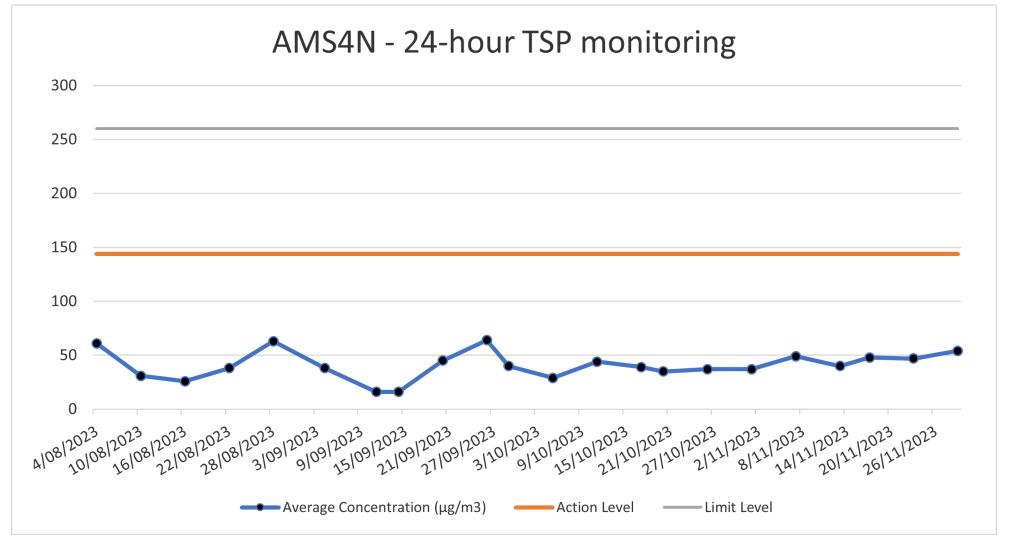



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	H-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX H – EVENT AND ACTION PLAN



AIR QUALITY MONITORING

		A	CTION	
EVENT	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
Exceedance for one sample	 Repeat measurement to confirm findings; If exceedance is confirmed, inform the Contractor, IEC and ER; Identify source(s), investigate the causes of exceedance and propose remedial measures; and Increase monitoring frequency. 	 Check monitoring data submitted by the ET; Check Contractor's working method; and Discuss with ET, ER and Contractor on possible remedial measures Review and advise the ET and ER on the effectiveness of the proposed remedial measures. 	 Confirm receipt of notification of exceedance in writing. 	 Identify source(s), investigate the causes of exceedance and propose remedial measures; Implement remedial measures; and Amend working methods agreed with the ER as appropriate.
Exceedance for two or more consecutive samples	 Repeat measurements to confirm findings; If exceedance is confirmed, inform Contractor, IEC and ER; Identify source(s), investigate the causes of exceedance and propose remedial measures; Increase monitoring frequency to daily; Advise the Contractor and ER on the effectiveness of the proposed remedial measures; Discuss with IEC and Contractor on remedial actions required; 	 Check monitoring data submitted by the ET; Check Contractor's working method; and Discuss with ET, ER and Contractor on possible remedial measures; Review and advise the ET and ER on the effectiveness of the proposed remedial measures; and Supervise Implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; In consultation with the ET and IEC agree with the Contractor on the remedial measures to be implemented; and Supervise implementation of remedial measures 	 Identify source(s) and investigate the causes of exceedance; Submit proposals for remedial measures to the ER, ET and IEC within three working days of notification for agreement; Implement the agreed proposals; and Amend proposal as appropriate.



EVENT		A	CTION	
EVENI	ET 7. If exceedance continues, arrange meeting with Contractor, IEC and ER to discuss the remedial measures to be taken; and 8. If exceedance stops, cease additional monitoring.	IEC	ER	CONTRACTOR
LIMIT LEVEL	1. Repeat measurement to	1. Check monitoring data	1. Confirm receipt of notification	1. Identify source(s) and
Exceedance for one sample	 Repeat medistrement to confirm findings; If exceedance is confirmed, inform the Contractor, IEC, EPD and ER; Identify source(s), investigate the causes of exceedance and propose remedial; Increase monitoring frequency to daily; and Discuss with the ER, IEC and Contractor on the remedial measures and assess effectiveness. 	 Submitted by the ET; Check Contractor's working method; Discuss with the ET, ER and Contractor on possible remedial measures; Review and advise the ET and ER on the effectiveness of the proposed remedial measures; and Supervise implementation of remedial measures. 	 commit receipt of notification of exceedance in writing; Review and agree on the remedial measures proposed by the Contractor; and Ensure remedial measures properly implemented. 	 Identify source(s) and investigate the causes of exceedance; Take immediate action to avoid further exceedance; Submit proposals for remedial measures to ER, ET and IEC within three working days of notification for agreement; Implement the agreed proposals; and Amend proposal if appropriate.
Exceedance for two or more consecutive samples	 Repeat measurement to confirm findings; If exceedance is confirmed, inform IEC, ER, Contractor and EPD; Identify source(s), investigate the causes of 	 Check monitoring data submitted by the ET; Discuss amongst ER, ET, and Contractor on the potential remedial actions; 	 Confirm receipt of notification of exceedance in writing; In consultation with the ET and IEC, agree with the Contractor on the remedial measures to be implemented; 	 Identify source(s) and investigate the causes of exceedance; Take immediate action to avoid further exceedance; Submit proposals for remedial measures to the



Monthly EM&A Report

EVENT		Α	CTION	
EVENT	ET	IEC	ER	CONTRACTOR
	 exceedance and propose remedial measures; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; and If exceedance stops, cease additional monitoring. 	 Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; and Supervise the implementation of remedial measures. 	 Supervise the implementation of remedial measures; and If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 ER, IEC and ET within three working days of notification for agreement; Implement the agreed proposals; Revise and resubmit proposals if problem still not under control; and Stop the relevant portion of works as determined by the ER until the exceedance is abated.

Note: ET – Environmental Team; ER – Engineer's Representative; IEC – Independent Environmental Checker



NOISE IMPACT MONITORING

Event		Act	tion	
	ET	IEC	ER	CONTRACTOR
Action Level	1. Notify IEC, ER and Contractor of	1. Review the analysed results	1. Confirm receipt of notification of	1. Submit noise mitigation proposals to
	exceedance;	submitted by the ET;	failure in writing;	ER with copy to ET and IEC;
	2. Identify source	2. Review the proposed remedial	2. Notify Contractor;	Implement noise mitigation proposals.
	3. Investigate the causes of	measures by the Contractor and advise	3. Require Contractor to propose	
	exceedance and propose remedial	the ER accordingly;	remedial measures for the analysed	
	measures;	3. Supervise the implementation of	noise problem;	
	4. Report the results of investigation to	remedial measures.	4. Ensure remedial measures are	
	the IEC, ER and Contractor;		properly implemented	
	5. Discuss with the IEC, ER and			
	Contractor and formulate remedial			
	measures;			
	6. Increase monitoring frequency to			
	check mitigation effectiveness			



Monthly EM&A Report

Event	Action							
	ET	IEC	ER	CONTRACTOR				
Limit Level								
	1. Inform IEC, ER, EPD and Contractor;	1. Discuss amongst ER, ET, and	1. Confirm receipt of notification of failure in	1. Take immediate action to avoid furthe				
	2. Identify source;	Contractor on the potential remedial	writing;	exceedance;				
	3. Repeat measurements to confirm findings;	actions;	2. Notify Contractor;	2. Submit proposals for remedial actions to E				
	4. Increase monitoring frequency;	2. Review Contractor's remedial	3. Require Contractor to propose remedial	with copy to ET and IEC within 3 working days				
	5. Carry out analysis of Contractor's working	actions whenever necessary to	measures for the analyzed noise problem;	notification;				
	procedures to determine possible mitigation to	assure their effectiveness and advise	4. Ensure remedial measures are properly	3. Implement the agreed proposals;				
	be implemented;	the ER accordingly;	implemented;	4. Resubmit proposals if problem still not unde				
	6. Inform IEC, ER and EPD the causes and	3. Supervise the implementation of	5. If exceedance continues, investigate what	control;				
	actions taken for the exceedances;	remedial measures.	portion of the work is responsible and instruct	5. Terminate the relevant portion of works as				
	7. Assess effectiveness of Contractor's remedial		the Contractor to terminate that portion of	determined by the ER until the exceedan				
	actions and keep IEC, EPD and ER informed		work until the exceedance ceases.	ceases.				
	of the results;							
	8. If exceedance stops, cease additional							
	monitoring.							



APPENDIX I - NOISE MONITORING EQUIPMENT CALIBRATION CERTIFICATES



Date Dec 23

8/F Block B. Veristrong Industrial Centre, 34-35 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +862 2695 3944 E: eti@eta-instconault.com W: www.eta-testconault.com



Form Q/AS/C/02 Issue 1(1/4) [02/22]

2

Calibration Certificate

Certificate No.	: CSA33530
Page	: 1 of

Equipment I.D. : ET/EN/002/07

: 038641

; CQS/002/A

: (50±20) %

: As received

: 17-May-2023

: Calibration Laboratory

Information Provided by Customer

Address

Customer : ETS - Testconsult Limited

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pul Wan Street, Fotan, Shatin, Hong Kong

Serial No.

Procedure Date of Receipt

Sampling

Calibration Location

Relative Humidity

Information of Unit-under-test (UUT)

Description : Sound Level Calibrator ; Castle Manufacturer : GA607 Type

Laboratory Information

Lab. Ref. No. ; Q/CAL/23/4006/I Date of Calibration : 19-May-2023 Date of Issue : 19-May-2023

Calibration Condition

Ambient Temperature : (20 ± 3) *C Stabilizing Time ; 30 minutes Ambient Pressure : (1000 ± 50) hPa

Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Measuring Amplifier, ET/2702/01/01
- Signal generator, ET/2503/01
- Reference Oscilloscope, ET/2502/01

Calibration specification

To perform the calibration of sound level calibrator.

Calibration result

The results are detailed on the subsequent pages.

Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By :

Tony MA (Technician) Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the international System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory





B/F Block B, Voristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 6310 F: +852 2896 3944 E: eligats-testconsult.com W: www.ets-testconsult.com



Calibration Certificate

Certificate No. : CSA33530

Page : 2 of 2

Calibration Result:

1. Measured Sound Pressure Level:

Nominal Frequency (Hz)	Nominal Output Sound Pressure (dB)	Measured Output (dB)	Expanded Uncertatiny (dB)	Coverage Factor
1000	94.0	94.1	0.13	2.0
1000	104.0	104.0	0.13	2.0

2. Actual Output Frequency:

Nominal Frequency (Hz)	Nominal Output Sound Pressure (dB)	Measured Output (Hz)	Expanded Uncertatiny (Hz)	Coverage Factor
1000	94.0	1000.020	0.057	2.0
1000	104.0	1000.017	0.057	2.0

Remark

- The uncertainty quoted is based on 95 % confidence level.

- Measured output are mean of three measurements.

End of certificate





B/F Block B, Veristrong Industrial Centre, 34-36 Au Pal Wen Street, Fo Tan, Hong Kong

1: +652 2005 8316 F: +852 2005 3944 E: etil@ets-testconsuit.com W: www.ets-testconsuit.com



Form Q/AS/C/01 lasue 1(1/7) [09/21]

Calibration Certificate

Certificate No.	: CS		
Page	1	d	з

Information Provided by Customer

; ETS - Testconsult Limited Customer

: B/F., Block B, Verlstrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

Procedure

Sampling

Date of Receipt

Calibration Location

Relative Humidity

Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	RION
Туре	NL-52	UC-59	NH-25
Equipment I.D. no.	ET/EN/003/17	*	
Serial No.	00264519	03558	64644
Adaptors used	A State of the second sec	*1	F
Resolution	0.1 d8		

Laboratory Information

Address

Lab. Rel. No. : Q/CAL/23/5141/I Date of Calibration : 28-Jun-2023 : 28-Jun-2023 Oate of Issue

Calibration Condition

Ambient Temperature : (20 ± 3) *C ; 30 minutes Stabilizing Time : (1000 ± 50) hPa Ambient Pressure

Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

Calibration specification

- To perform the calibration of linearity and frequency response by multi-function sound calibrator.

Calibration result

- The results are detailed on the subsequent pages.

Remarks

- The calibration results apply to the particular unit-under-leat only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertaincies quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the misa

Calibrated By :

Tony MA (Technician)

Approved By:_ CHAN Chi Wai

: CQS/001/A

: (50 ± 20) %

: As received

: 21-Jun-2023

: Calibration Laboratory

The results shown in this certificate are traceable to the international System of Links (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.





5/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2593 3944 F: eliĝeta-testconsult.com W: www.ets-testconsult.com



Calibration Certificate

Certificate No. : CSA34546

Page : 2 of 3

Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (iiHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal	Before	94.0		93.7	-0.3	0.13	2.0
A-Weighting	Range	30 to 130	104.0	1	103.7	-0.3	0.13	2.0
	Mode	Fast	114.0		113.7	-0.3	0.13	2.0
	Self-cal	Atter	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
Me	Mode	Fast	114.0		114.1	0.1	0.13	2.0
A-Weighting	Self-cal	After	94.0	1	94.0	0.0	0.13	2.0
	Range	30 to 130	104.0		104.1	0.1	0.13	2.0
	Mode	Slow	154.0		114.1	0,1	0.13	2.0
	Self-cal		94.0	1	94.0	0.0	0,13	2,0
	Range	30 to 130	104.0		104.1	0.1	0.13	2.0
C March Hora	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal	-	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
	Mode	Slow	114,0	1	114.0	0.0	0.13	2.0
	Self-cal		94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
a sala da sala	Mode	Fast	114.0		114,1	0.1	0.13	2.0
Z-Weighting	Self-cal		94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
	Mode	Slow	114.0		.114.0	0.0	0.13	2.0

Remark:

- The uncertainty quoted is based on 95 % confidence level.

- UUT reading are mean of three measurements.

- Deviation = UUT Reading - Reference Level

- Laboratory reference multi-function sound calibrator was used to adjust the "Self cal" reading of UUT-

.....





B/F Blook B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T +852 2895 8318 F: +852 2895 3944 E: et@ats-testcorsuit.com W: www.ets-testcorsuit.com



Calibration Certificate

Certificate No. CSA34546

Page : 3 of 3

Calibration Result:

Acoustic Sensitivity and Frequency Response:

2 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Lovel	Frequency (Hz)	Rafarence Lovel	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
		31.5	54.6	40.5	+14.1	0.29	2.6	
			63	67,8	57.2	-10.6	0.22	2.3
			125	77.9	72.2	-5.7	0.13	2.0
			250	85.4	63.6	-1.8	0.12	2.0
			500	90.8	90.9	0.1	0.12	2.0
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0.13	2.0
			2000	95.1	94.0	-6.1	0.13	2.0
			4000	94.9	92.3	-2.6	0.13	2.0
			8000	97,9	85.4	-7.5	0.14	2.0
			12500	89.7	76.0	-13.7	0.14	2.0
			16000	87.5	71.6	-15.9	0.16	2.0

3 Frequency Response C-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Lovel	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
			31.5	91.0	74.0	-16.4	0.22	2.3
			63	93.2	82.4	-10.8	0.15	2.0
			125	93.8	88.1	-5.7	0.15	2.0
			250	94.0	92.2	-1.8	0.14	Z.0
			500	94.0	94.1	.0.1	0.12	2.0
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0.13	2.0
			2000	93.7	92.6	-1.1	0.13	2.0
			4000	93.1	90.5	-2.6	0.13	2.0
			8000	91.0	83.5	-7.6	0.14	2.0
			12500	87.8	74.1	-13.7	0.16	2.0
			10000	85.6	69.8	-15,8	0.20	2.2

4 Frequency Response Z-Weighting (Unit in: dB)

Range	Mode	Applied Lovel	Frequency (Hz)	Reference Level	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
		31.5	94,0	77,6	-16,4	0.14	2.0	
		63	94.0	83.2	-10.8	0.15	2.0	
			125	94.0	88.3	-5.7	0.13	2.0
			250	94.0	92.2	-1.8	0.14	2.0
			500	94.0	94.0	0.0	0.12	2.0
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0.13	2.0
			2000	94.0	92.8	-1.2	0.13	2.0
			4000	94.0	91.3	-2.7	0.13	2.0
			8000	94.0	85.4	-7.6	0.14	2.0
			12500	94.0	80.7	-13.5	0,14	2,0
			10000	94.0	79.4	-14.6	0.14	2.0

Remark:

- Signal level at 1000 Hz is set as indication of reference sound pressure level.

- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.

- UUT reading are mean of three measurements.

- Deviation = UUT Reading - Reference Lovel

End of certificate





6/F Block B, /edstrong Industrial Centre 34-36 Au Pui Wan Street, Fo Tan, Hong Kong T: +852 2695 8318 F: +852 2695 3944

Date

ti@ets-testconsult.com



Dec 23

Form Q/AS/C/01 Issue 1(1/7) [09/21]

Calibration Certificate

Certificate No.	1.1	CSA	32590	
Page	1	1	of	3

Information Provided by Customer : ETS - TESTCONSULT LIMITED

Customer Address

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	-
Туре	NL-52	UC-59	NH-25
Equipment I.D. no.	ET/EN/003/18		4
Serial No.	00264520	09668	64646
Adaptors used		-	5 ×
Resolution	0.1 dB		

Laboratory Information

: Q/CAL/23/2956/I ; 19-Apr-2023 Lab. Ref. No. Date of Calibration : 20-Apr-2023 Date of Issue

: CQS/001/A Procedure : 13-Apr-2023 Date of Receipt ; Calibration Laboratory Calibration Location

Relative Humidity

Sampling

; (50 ± 20) %

: As received

Calibration Condition

Ambient Temperature : (20 ± 3) *C : 30 minutes : (1000 ± 50) hPa Stabilizing Time Ambient Pressure

Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

Calibration specification

To perform the calibration of linearity and frequency response by multi-function sound calibrator.

Calibration result

- The results are detailed on the subsequent pages.

Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By :

Tommy TAM (Technician)

Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



01 Date Dec 23



8/F Block B, Veristrong Industrial Centre 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: eti@ets-testconsult.com W: www.ets-testconsult.com



Calibration Certificate

Certificate No. : CSA32590

Page : 2 of 3

Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal	Before	94.0		94.8	0.8	0.13	2.0
A-Weighting	Range	30 to 130	104.0	1 1	104.8	0.8	0.13	2.0
2020 00.0	Mode	Fast	114.0		114.8	0,8	0.13	2.0
	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
A-Weighting	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0	104.0 1	94.0	0.0	0.13	2.0
	Range	30 to 130	104.0		104.0	0.0	0.13	2.0
0.000	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2,0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0		94,0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
Z-Weighting	Self-cal	After	94.0		94,0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
1	Mode	Slow	114.0		114.0	0.0	0.13	2.0

Remark:

- The uncertainty quoted is based on 95 % confidence level.

- UUT reading are mean of three measurements.

- Deviation = UUT Reading - Reference Level

- Laboratory reference multi-function sound calibrator was used to adjust the "Self cal" reading of UUT.



Date Dec 23



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: eti@ets-lestconsult.com W: www.ets-testconsult.com



Calibration Certificate

Certificate No.	2	
Dates	- 22	

CSA32590 3 of 3

Form QIAS/C/01 Issue 1(3/7) (99/21)

Calibration Result:

Acoustic Sensitivity and Frequency Response:

2 Frequency Response A-Wolghling (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
		31.5	54.6	54.7	0.1	-39.4 +/- 2.0	
			63	67.8	67.9	0.1	-28.2 4/- 1.5
		1 1	125	77.9	78.0	0.1	-18.1 +/- 1.5
			250	85.4	85.4	0.0	-8.6 +/- 1.4
			500	90.8	90.8	0.0	-3.2 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
111111-11			2000	95.1	95.2	0.1	+1.2 +/- 1.6
		1 1	4000	94.9	94.9	0.0	+1.0 +/- 1,6
		1 1	8000	92.9	92.0	-0.9	-1.1 (+2.1 ; - 3.1)
			12500	89.7	85.1	-4.6	-4.3 (+3.0 ; -6.0)
			10000	87.5	79.8	-7.7	-6.6 (+3.5 ; -17.0)

3 Frequency Response C-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
		31.5	91.0	90.9	-0.1	-3.0 +/- 2.0	
	1 1	63	93.2	93.2	0.0	-0.8 +/- 1.5	
			125	93.8	93.9	0.1	-0.2 +/- 1.5
			260	94.0	94.0	0.0	0.0 +/- 1.4
			500	94.0	94.0	0.0	0.0 +/- 1,4
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	93.7	93.8	0.1	-0.2 +/- 1.6
			4000	83.1	93.1	0.0	-0.8 +/- 1.6
			8000	91.0	90.1	-0.9	-3.0 (+2.1 ; -3.1)
			12500	87.8	83.2	-4.6	-6.2 (+3.0 ; -6.0)
			16000	85.6	77,9	-7.7	-8.5 (+3.5;-17.0)

4 Frequency Response Z-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
		31.5	94.0	94.0	0.0	0.0 +/- 2.0	
			63	94.0	94.0	0.0	0,0 +/- 1,5
			125	94.0	94.0	0.0	0.0 +/- 1.5
			250	94.0	94.0	0.0	0.0 +/- 1,4
			500	94.0	94.0	0.0	0.0 +/+ 1.4
30 to 130	Fast	94	1000 (Raf.)	94.0	94.0	0.0	0 +/- 1.1
			2000	94.0	94.0	0.0	0,0 +/- 1.6
			4000	94.0	93.9	0.0	0.0 +/- 1.6
			8000	94.0	93.0	-1.0	0.0 (+2.1 ; -3.1)
			12500	94.0	89.7	-4.3	0.0 (+3.0 ; -6.0)
			16000	94.0	87.6	-6.4	0.0 (+3.5; -17.0)

- Expended uncertainty of measurement:

	Range (Hz)	(dB)	Range (Hz)	(dB)
	31,6	0.15	2000	0.13
Ì	63	0.15	4000	0.13
	125	0.15	8000	0.14
94 dB	250	0.14	12500	0.14
t	500	0,12	16000	0.14
	1000	0.13		

Remark:

- Signal level at 1000 Hz is set as indication of reference sound pressure level.

- The uncertainty quoted is based on 95 % confidence level with covarage factor k=2.0.

- UUT reading are mean of three mean

- Deviation = UUT Reading - Reference Level

- Manufacturer specification:

End of certificate



東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD. B/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

Calibration Certificate

Certificate No.	: CSA35374
-----------------	------------

4

: 1 of 3

: CQS/001/A : 19-Jul-2023

: (50 ± 20) % : As received

: Calibration Laboratory

Information Provided by Customer

Customer : ETS - TESTCONSULT LIMITED

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

Procedure

Sampling

Date of Receipt

Calibration Location

Relative Humidity

Page

Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	RION
Туре	NL-52	UC-59	NH-25
Equipment I.D. no.	ET/EN/003/20		
Serial No.	00998504	06945	98718
Adaptors used	-	•	*
Resolution	0.1 dB		

Laboratory Information

Address

 Lab. Ref. No.
 :
 Q/CAL/23/6060/I

 Date of Calibration
 :
 2-Aug-2023

 Date of Issue
 :
 2-Aug-2023

Calibration Condition

 Ambient Temperature
 : (20 ± 3) °C

 Stabilizing Time
 : 30 minutes

 Ambient Pressure
 : (1000 ± 50) hPa

Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

Calibration specification

- To perform the calibration of linearity and frequency response by multi-function sound calibrator.

Calibration result

The results are detailed on the subsequent pages.

Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertabyties quoted will
 not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during
 transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By :

Tommy TAM (Technician)

Approved By: CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



Dec 23



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

Date

T: +852 2695 8318 F: +852 2695 3944 E: ell@ets-testconsult.com W: www.ets-testconsult.com



Calibration Certificate

Certificate No. : CSA35374

Page: 2 of 3

Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal		94.0		91.7	-2.3	0.13	2.0
	Range	30 to 130	104.0	1 1	101.7	-2.3	0.13	2.0
	Fast	114.0	1 1	111.7	-2.3	0.13	2.0	
A-Weighting	Self-cal		94.0		91.7	-2.3	0.13	2.0
	Range	30 to 130	104.0	1	101.7	-2.3	0.13	2.0
	Mode	Slow	114.0	1 [111.7	-2.3	0.13	2.0
	Self-cal		94.0		91.7	-2.3	0.13	2.0
-	Range	30 to 130	104.0	1	101.7	-2.3	0.13	2.0
	Mode	Fast	114.0		111.7	-2.3	0.13	2.0
C-Weighting	Self-cal	1.00	94.0		91.7	-2.3	0.13	2.0
	Range	30 to 130	104.0	1	101.7	-2.3	0.13	2.0
	Mode	Slow	114.0	1	111.7	-2.3	0.13	2.0
	Self-cal		94.0		91.7	-2.3	0.13	2.0
-	Range	30 to 130	104.0	1	101.7	-2.3	0.13	2.0
	Mode	Fast	114.0		111.7	-2.3	0.13	2.0
Z-Weighting	Self-cal	-	94.0		91.7	-2.3	0.13	2.0
	Range	30 to 130	104.0	1 1	101.7	-2.3	0.13	2.0
	Mode	Slow	114.0		111.7	-2.3	0.13	2.0

Remark:

- The uncertainty quoted is based on 95 % confidence level.

- UUT reading are mean of three measurements.

- Deviation = UUT Reading - Reference Level





8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

+852 2695 8318 +852 2695 3944 Bets-testconsult.com w.ets-testconsult.com



Calibration Certificate

Certificate No. : CSA35374

Page : 3 of 3

Calibration Result:

Acoustic Sensitivity and Frequency Response:

2 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
		31.5	54.6	52.5	-2.1	0.15	2.0	
			63	67.8	65.5	-2.3	0.13	2.0
			125	77.9	75.6	-2.3	0.13	2.0
			250	85.4	83.0	-2.4	0.12	2.0
			500	90.8	88.4	-2.4	0.12	2.0
30 to 130 Fast	94	1000 (Ref.)	94.0	91.7	-2.3	0.13	2.0	
			2000	95.1	92.9	-2.2	0.13	2.0
			4000	94.9	93.1	-1.8	0.13	2.0
			8000	92.9	92.3	-0.6	0.14	2.0
			12500	89.7	87.0	-2.7	0.14	2.0
			16000	87.5	81.0	-6.5	0.14	2.0

3 Frequency Response C-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
		31.5	91.0	88.4	-2.6	0.14	2.0	
			63	93.2	90.8	-2.4	0.13	2.0
			125	93.8	91.5	-2.3	0.13	2.0
			250	94.0	91.6	-2.4	0.12	2.0
			500	94.0	91.6	-2.4	0.12	2.0
30 to 130 Fast	130 Fast 94	94	1000 (Ref.)	94.0	91.6	-2.4	0.13	2.0
			2000	93.7	91.5	-2.2	0.13	2.0
			4000	93.1	91.3	-1.6	0.13	2.0
			8000	91.0	90.3	-0.7	0.14	2.0
			12500	87.8	85.0	-2.8	0.14	2.0
			16000	85.6	79.1	-6.5	0.14	2.0

4 Frequency Response Z-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
	-		31.5	94.0	91.5	-2.5	0.14	2.0
			63	94.0	91.6	-2.4	0.15	2.0
30 to 130 Fast 94		1 1	125	94.0	91.6	-2.4	0.13	2.0
		250	94.0	91.6	-2.4	0.12	2.0	
	1 1	500	94.0	91.6	-2.4	0.12	2.0	
	94	1000 (Rel.)	94.0	91.6	-2.4	0.13	2.0	
			2000	94.0	91.7	-2.3	0.13	2.0
			4000	94.0	92.1	-1.9	0.13	2.0
		1 1	8000	94.0	93.2	-0.8	0.14	2.0
		1	12500	94.0	91.5	-2.5	0.14	2.0
			16000	94.0	88.8	-5.2	0.14	2.0

Remark:

- Signal level at 1000 Hz is set as indication of reference sound pressure level.

- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.

- UUT reading are mean of three measurements.

- Deviation = UUT Reading - Reference Level

End of certificate



And a	東業後	喜勤 測	試願	間有	限公	司
100	ETS-	TEST	CON	SUL	.T L1	D.

	Calibrati	on record of A	nemometer	
Equipment Ref. No	:ET/EN/0	001/05 Manu	facturer	AZ Instrument
Model No.	:AZ 8	908 Serial	No.	1064869
Date of Check	:27-Oct	-2023 Due [Date :	26-Oct-2024
Method				
2 A fan with variou 3 Adjust the speed 4 Dise the relevance 5 Record the indice 6 Apply the correct	is speed control had and direction of the e anemometer and ated value of both an ted value in the refer	ength about 1m was us set in on end of the pip fan to achieve the targ memometer rence anemometer and ild not over ±5% of the	pe get wind speeds neck the wind speed i I calculate the correcto	
Reference Anen	nometer			
Equipment Ref. No	:ET/12	15/01 Calibi	ration Due Date :	15-Aug-2024
Results				
	Reference And	emometer (m/s)	Unit Unde	r Test (m/s)
Applied Range (m/s)	Reference And Indicated Value	emometer (m/s) Corrected Value	Unit Unde Indicated Value	r Test (m/s) Corrected Value
Applied Range				
Applied Range (m/s)	Indicated Value	Corrected Value	Indicated Value	Corrected Value
Applied Range (m/s) 0	Indicated Value 0.00	Corrected Value 0.00	Indicated Value 0.0	Corrected Value 0.0
Applied Range (m/s) 0 2 - 3	Indicated Value 0.00 2.38	Corrected Value 0.00 2.43 5.68 10.3	Indicated Value 0.0 2.1 6.2 10.7	Corrected Value 0.0 +0.3 -0.5 -0.4
Applied Range (m/s) 0 2 - 3 4 - 6 9 - 11 14 - 16	Indicated Value 0.00 2.38 5.74 9.7 15.3	Corrected Value 0.00 2.43 5.68 10.3 15.1	Indicated Value 0.0 2.1 6.2 10.7 15.4	Corrected Value 0.0 +0.3 -0.5 -0.4 -0.3
Applied Range (m/s) 0 2 - 3 4 - 6 9 - 11	Indicated Value 0.00 2.38 5.74 9.7	Corrected Value 0.00 2.43 5.68 10.3	Indicated Value 0.0 2.1 6.2 10.7	Corrected Value 0.0 +0.3 -0.5 -0.4
Applied Range (m/s) 0 2 - 3 4 - 6 9 - 11 14 - 16	Indicated Value 0.00 2.38 5.74 9.7 15.3 19.4 eeria	Corrected Value 0.00 2.43 5.68 10.3 15.1	Indicated Value 0.0 2.1 6.2 10.7 15.4	Corrected Value 0.0 +0.3 -0.5 -0.4 -0.3
Applied Range (m/s) 0 2 - 3 4 - 6 9 - 11 14 - 16 18 - 20 Acceptance Crit Correction value sh	Indicated Value 0.00 2.38 5.74 9.7 15.3 19.4 Peria nould < ±5% FS r complies * / does ble * / unacceptab	Corrected Value 0.00 2.43 5.68 10.3 15.1 19.7 s not comply * with t	Indicated Value 0.0 2.1 6.2 10.7 15.4 19.3	Corrected Value 0.0 +0.3 -0.5 -0.4 -0.3 +0.4



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	J-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX J - NOISE IMPACT MONITORING RESULT

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-2
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November Noise Monitoring Data

Monitoring Location: NMS1N

Date	Noise Monitoring (30min)			
Dale	Leq dB(A)	L10 dB(A)	L90 dB(A)	
1- Nov -23	69.6	72.7	55.0	
7- Nov -23	69.9	71.8	67.3	
13- Nov -23	62.2	65.6	52.2	
23- Nov -23	53.9	56.1	44.1	
29- Nov -23	58.2	60.9	53.7	
Average		67.2		
Action Level:	When one valid documented complaint is received			
Limit Level:	75.0 dB(A)			

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-3
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November Noise Monitoring Data

Monitoring Location: NMS2N1

Date	Noise Monitoring (30min)			
Dale	Leq dB(A)	L10 dB(A)	L90 dB(A)	
1- Nov -23	61.9	63.6	55.8	
7- Nov -23	58.9	60.2	55.5	
13- Nov -23	61.1	63.6	56.7	
23- Nov -23	59.8	62.7	53.9	
29- Nov -23	55.9	57.4	53.7	
Average	60.6			
Action Level:	When one valid documented complaint is received			
Limit Level:	75.0 dB(A)			

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-4
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November Noise Monitoring Data

Monitoring Location: NMS3N

Date	Noise Monitoring (30min)			
Dale	Leq dB(A)	L10 dB(A)	L90 dB(A)	
1- Nov -23	54.0	55.8	51.6	
7- Nov -23	56.9	58.7	53.8	
13- Nov -23	58.0	60.2	51.0	
23- Nov -23	62.1	64.4	56.4	
29- Nov -23	59.7	61.9	55.6	
Average		58.8		
Action Level:	When one valid documented complaint is received			
Limit Level:	75.0 dB(A)			


SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-5
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

2023 November Noise Monitoring Data


Monitoring Location: NMS4N

Date	Noise Monitoring (30min)			
Dale	Leq dB(A)	L10 dB(A)	L90 dB(A)	
1- Nov -23	53.2	55.7	46.9	
7- Nov -23	49.6	51.4	46.7	
13- Nov -23	49.8	52.0	45.4	
23- Nov -23	51.3	53.5	46.2	
29- Nov -23	50.3	53.9	43.4	
Average		51.2		
Action Level:	When one valid documented complaint is received			
Limit Level:	75.0 dB(A)			


SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-6
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

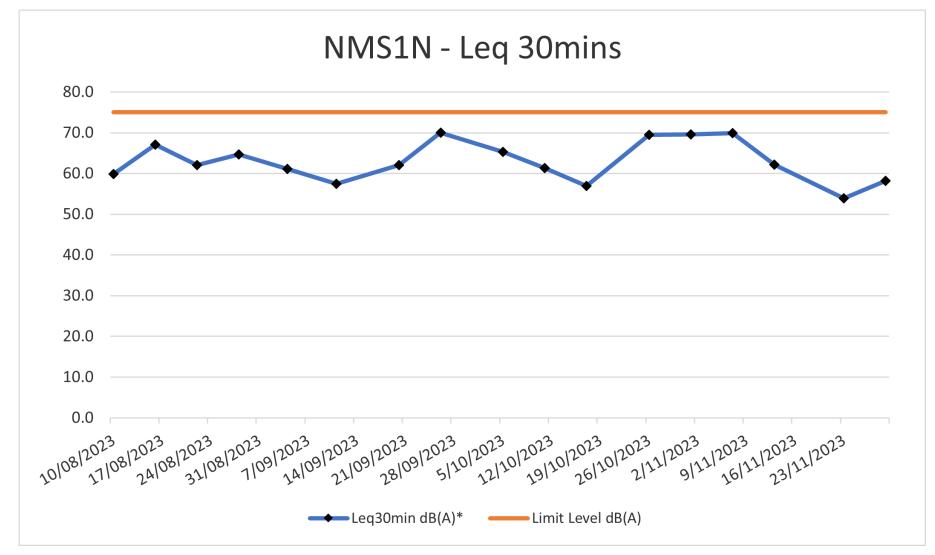


SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-7
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

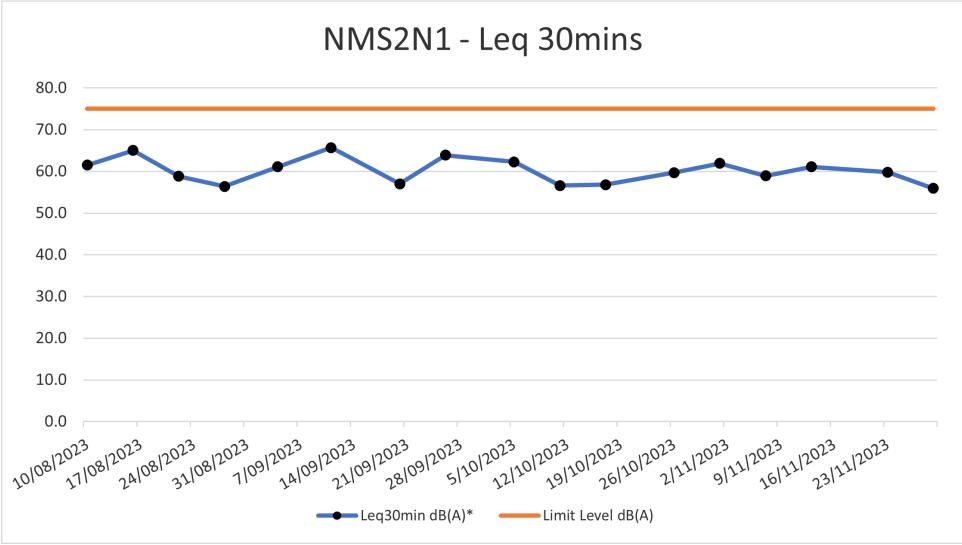

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-8
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

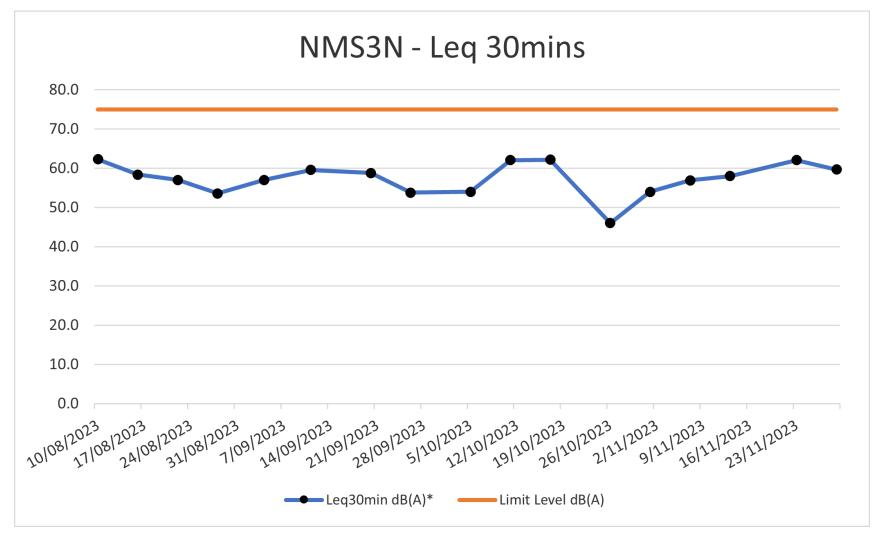

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-9
		Ref#	EMA2204/03/27
	Monthly EM&A Report	Rev.	01
		Date	Dec 23

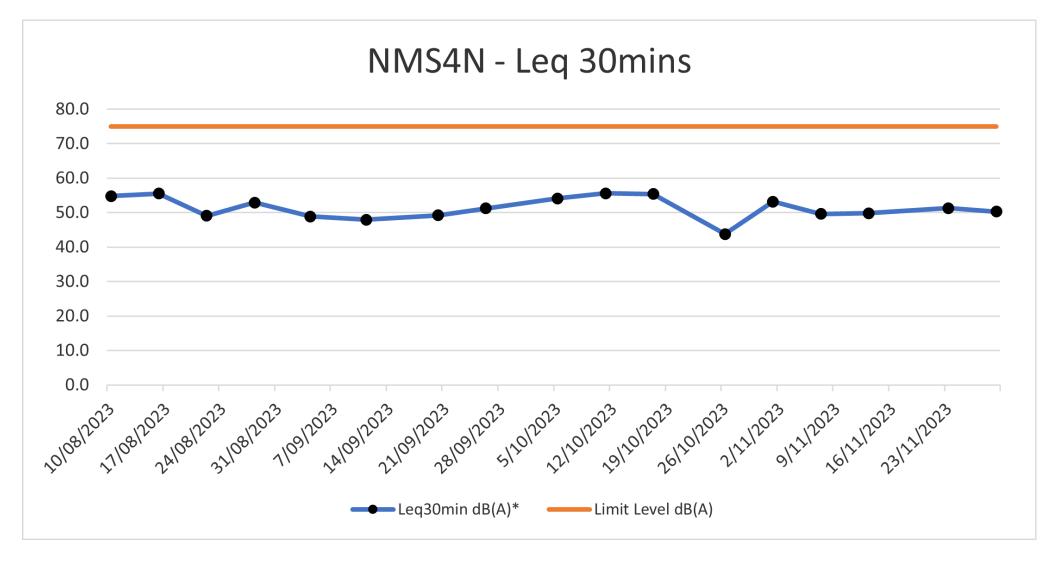



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	K-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX K – WATER QUALITY MONITORING SCHEDULE

I



DECEMBER 2023

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					Additional Water Quality Monitoring Ebb: 12:45 - 16:15 Flood: 8:15 - 11:45	
3	A Additional Water Quality Monitoring Ebb: 3:15 - 6:45 Flood: 13:15 - 16:45		6 Impact Water Quality Monitoring Ebb: 4:45 - 8:15 Flood: 12:15 - 15:45	1	8 Impact Water Quality Monitoring Ebb: 6:45 - 10:15 Flood: 13:15 - 16:45	
10	11	12 Impact Water Quality Monitoring Ebb: 10:15 - 13:45 Flood: 14:15 - 17:45		14 Impact Water Quality Monitoring Ebb: 11:15 - 14:45 Flood: 15:45 - 19:15		16 Impact Water Quality Monitoring Ebb: 13:15 - 16:45 Flood: 16:45 - 20:15
17	18 Impact Water Quality Monitoring Ebb: 2:15 - 5:45 Flood: 10:15 - 13:45	19	20 Impact Water Quality Monitoring Ebb: 4:15 - 7:45 Flood: 12:15 - 15:45	21	22 Dec. Solstice (GMT) Impact Water Quality Monitoring Ebb: 6:15 - 9:45 Flood: 13:15 - 16:45	23
24 Christmas Eve	25 Christmas Day Impact Water Quality Monitoring Ebb: 11:15 - 14:45 Flood: 4:45 - 8:15		27 Impact Water Quality Monitoring Ebb: 10:45 - 14:15 Flood: 15:15 - 18:45		29 Impact Water Quality Monitoring Ebb: 11:45 - 15:15 Flood: 16:15 - 19:45	30
31 New Year's Eve		Remarks 1. Water sampling will be conducte 2. Predicted tides time were referen (Tai Miu Wan Station).	d +/- 1.75 hour of the predicted tides	s time.	Notes:	



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	L-1
Works at Po Toi O	Ref#	EMA2204/03/27
Monthly EM&A Report	Rev.	01
	Date	Dec 23

APPENDIX L – MONTHLY SUMMARY OF WASTE FLOW



	Monthly Summary Waste Flow Table for 2023 fear										
		Actual Quant	ities of Inert	C&D Materi	als Generate	ed Monthly	Actual	Quantities of	C&D Waste	es Generate	d Monthly
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposal as Public Fill	Imported Fill	Metals	Paper / Cardboard Packaging	Plastics (see note 3)	Chemical Waste	Other, e.g. general refuse
	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	[in '000kg]	[in '000kg]	[in '000kg]	[in '000kg]	[in Tonne]
Jan	0.003	0.000	0.000	0.000	0.003	0.000	0.000	0.000	0.000	0.000	0.000
Feb	0.007	0.000	0.000	0.000	0.007	0.000	0.000	0.000	0.000	0.000	0.000
Mar	0.676	0.000	0.000	0.000	0.676	0.000	0.000	0.000	0.000	0.000	0.000
Apr	0.336	0.000	0.000	0.000	0.336	0.000	0.000	0.000	0.000	0.000	0.000
Мау	0.091	0.000	0.000	0.000	0.091	0.000	0.000	0.000	0.000	0.000	0.000
June	0.004	0.000	0.000	0.000	0.004	0.000	0.000	0.000	0.000	0.000	0.000
Sub- Total	1.117	0.000	0.000	0.000	1.117	0.000	0.000	0.000	0.000	0.000	0.000
July	0.004	0.000	0.000	0.000	0.004	0.000	0.000	0.000	0.000	0.000	0.000
Aug	0.096	0.000	0.000	0.000	0.096	0.000	0.000	0.000	0.000	0.000	0.000
Sep	0.000009	0.000	0.000	0.000	0.000009	0.000	0.000	0.000	0.000	0.000	0.000
Oct	0.000494	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000494
Nov	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Dec											
Total	1.217503	0.000	0.000	0.000	1.217009	0.000	0.000	0.000	0.000	0.000	0.000494

Monthly Summary Waste Flow Table for 2023 Year

Note:

1) The performance targets are given in the Environmental Management Plan.

(2) The waste flow table shall also include C&D materials to be imported for use at the Site.

(3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.



APPENDIX M - IMPLEMENTATION SCHEDULE OF RECOMMENDED MITIGATION MEASURES

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-2
	EP-516/2016 - Port Shelter Sewerage, Stages - Sewerage works at Po Tol O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA	EM	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	& A		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
	Ref.		Main Concerns to address					Guidelines
Air Qua	ality imp	act						
Project	t Specifie	c Measures						
3.8	A1	Deodourizer should have at least 99.5% hydrogen sulfide removal	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		efficiency.	sensitive receivers		Treatment Plant	operational phase		
3.8	A2	Odourous materials (sludge, screenings and grits, worn filter)	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		should be stored and removed in sealed tankers and containers.	sensitive receivers		Treatment Plant	operational phase		
3.8	A3	Sludge should be transferred to sludge tanker by coupling	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		method.	sensitive receivers		Treatment Plant	operational phase		
3.8	A4	During release of pressure from the tanker, the odourous gas	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		should be discharged into the sludge storage room for extraction	sensitive receivers		Treatment Plant	operational phase		
		to deodourization unit.						
3.8	A5	Regular inspection should be conducted to check for leakage of	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		odourous gas.	sensitive receivers		Treatment Plant	operational phase		
3.8	A6	Maintain the removal efficiency of screenings and grits by	To maintain the removal	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		flushing the screens and grit sump regularly to prevent buildup of	efficiency of screenings and		Treatment Plant	operational phase		
		solids	grits					
3.8	A7	Maintain the efficiency of MBR membrane by removing	To maintain the efficiency of	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		organic and inorganic debris regularly	MBR membrane		Treatment Plant	operational phase		
3.8	A8	Replace worn filter to maintain the odour removal efficiency at	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		99.5%	sensitive receivers		Treatment Plant	operational phase		
3.8	A9	Clean all the tanks with water regularly	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
			sensitive receivers		Treatment Plant	operational phase		
Genera	al/Standa	ard Measures			•		·	
3.8	A10	Good housekeeping to minimize dust generation, e.g. by	To minimize dust generation	DSD's Contractor	Whole	Throughout	Construction	EIAO-TM,
		properly handling and storing dusty materials			construction	construction phase	Phase	APCO
					site			
3.8	A11	Adopt dust control measures, such as dust suppression using	To minimize dust generation	DSD's Contractor	Whole	Throughout	Construction	EIAO-TM,
		water spray on exposed soil (at least 4 times per day), in areas	due to erosion		construction	construction phase	phase	APCO
		with dusty construction activities and during material handling			site			

EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	
Ref# E	EMA2204/03/27
Monthly EM&A Report Rev. 0	01
	Dec 23

A Ref.	Store cement bags in shelter with 3 sides and the top covered by impervious materials if the stack exceeds 20 bags Maintain a reasonable height when dropping excavated materials to limit dust generation	Recommended Measure & Main Concerns to address To prevent leakage of cement To minimize dust generation during movement of excavated materials	Agent DSD's Contractor DSD's Contractor	the measure Whole construction site Whole	measure Throughout construction phase	stages Construction phase	Legislation & Guidelines EIAO-TM, APCO
A13	top covered by impervious materials if the stack exceeds 20 bags Maintain a reasonable height when dropping excavated materials to limit dust generation	To prevent leakage of cement To minimize dust generation during movement of excavated	Contractor DSD's	construction site	construction phase		
A13	top covered by impervious materials if the stack exceeds 20 bags Maintain a reasonable height when dropping excavated materials to limit dust generation	To minimize dust generation during movement of excavated	Contractor DSD's	construction site	construction phase		EIAO-TM, APCO
	exceeds 20 bags Maintain a reasonable height when dropping excavated materials to limit dust generation	5 5	DSD's	site	phase	phase	
	Maintain a reasonable height when dropping excavated materials to limit dust generation	5 5			•		
	excavated materials to limit dust generation	5 5		Whole	Thursday and		
14		materials	Contractor		Throughout	Construction	EIAO-TM, APCO
\14	Limit vehicle speed within construction site and in			construction	construction	phase	
14	Limit vehicle speed within construction site and in			site	phase		
		To minimize dust generation due to traffic movement	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
	Po Toi O to 10km/hr and confine vehicle		Contractor	construction	construction	phase	
	movement in haul road			site	phase		
\15	Minimize exposed earth after completion of work in	To minimize dust generation due to erosion	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
	a certain area by hydroseeding, vegetating, soil		Contractor	construction	construction	phase	
	compacting or covering with bitumen			site	phase		
\16	Provide wheel washing at construction site exit to	To prevent dust from being brought offsite	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
	clean the vehicle body and wheel		Contractor	construction	construction	phase	
				site	phase		
\17	Cover materials on trucks before leaving the	To prevent falling of debris during traffic movement and by wind	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
	construction site to prevent debris from dropping		Contractor	construction	construction	phase	
	during traffic movement or being blown away by			site	phase		
	wind						
\18	Regular maintenance of plant equipment to	To minimize black smoke emission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
	prevent black smoke emission		Contractor	construction	construction	phase	
				site	phase		
\19	Throttle down or switch off unused machines or	To minimize unnecessary emission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
	machine in intermittent use		Contractor	construction	construction	phase	
				site	phase		
\20	Minimize excavation area as far as possible	To minimize dust emission and potential release of odour from	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		exposed ground	Contractor	construction	construction	phase	
				site	phase		
<u>4</u> .	16 17 18 19	movement in haul road 15 Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumen 16 Provide wheel washing at construction site exit to clean the vehicle body and wheel 17 Cover materials on trucks before leaving the construction site to prevent debris from dropping during traffic movement or being blown away by wind 18 Regular maintenance of plant equipment to prevent black smoke emission 19 Throttle down or switch off unused machines or machine in intermittent use	movement in haul roadTo minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumenTo minimize dust generation due to erosion16Provide wheel washing at construction site exit to clean the vehicle body and wheelTo prevent dust from being brought offsite17Cover materials on trucks before leaving the construction site to prevent debris from dropping during traffic movement or being blown away by windTo prevent falling of debris during traffic movement and by wind18Regular maintenance of plant equipment to prevent black smoke emissionTo minimize black smoke emission19Throttle down or switch off unused machines or machine in intermittent useTo minimize dust emission and potential release of odour from	movement in haul roadTo minimize dust generation due to erosionDSD's Contractor15Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumenTo minimize dust generation due to erosionDSD's Contractor16Provide wheel washing at construction site exit to clean the vehicle body and wheelTo prevent dust from being brought offsiteDSD's Contractor17Cover materials on trucks before leaving the construction site to prevent debris from dropping during traffic movement or being blown away by windTo prevent falling of debris during traffic movement and by windDSD's Contractor18Regular maintenance of plant equipment to prevent black smoke emissionTo minimize black smoke emissionDSD's Contractor19Throttle down or switch off unused machines or machine in intermittent useTo minimize dust emission and potential release of odour from DSD'sDSD's Contractor	movement in haul roadsite15Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumenTo minimize dust generation due to erosionDSD's ContractorWhole construction site16Provide wheel washing at construction site exit to clean the vehicle body and wheelTo prevent dust from being brought offsiteDSD's ContractorWhole construction site17Cover materials on trucks before leaving the construction site to prevent debris from dropping during traffic movement or being blown away by windTo prevent falling of debris during traffic movement and by wind of prevent black smoke emissionDSD's ContractorWhole construction site18Regular maintenance of plant equipment to prevent black smoke emissionTo minimize black smoke emissionDSD's ContractorWhole construction site19Throttle down or switch off unused machines or machine in intermittent useTo minimize dust emission and potential release of odour from exposed groundDSD's ContractorWhole construction site	movement in haul roadmovement in haul roadsitephase15Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumenTo minimize dust generation due to erosionDSD's ContractorWholeThroughout construction16Provide wheel washing at construction site exit to clean the vehicle body and wheelTo prevent dust from being brought offsiteDSD's ContractorWholeThroughout construction site17Cover materials on trucks before leaving the construction site to prevent debris from dropping during traffic movement or being blown away by windTo prevent falling of debris during traffic movement and by windDSD's ContractorWholeThroughout construction site18Regular maintenance of plant equipment to prevent black smoke emissionTo minimize unnecessary emissionDSD's ContractorWhole Construction siteThroughout construction construction siteThroughout construction construction siteThroughout construction construction site19Throttle down or switch off unused machines or machine in intermittent useTo minimize dust emission and potential release of odour from exposed groundDSD's ContractorWhole construction construction siteThroughout construction construction site20Minimize excavation area as far as possibleTo minimize dust emission and potential release of odour from exposed groundDSD's ContractorWholeThroughout construction construction site	movement in haul roadsitephase15Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumenTo minimize dust generation due to erosionDSD's ContractorWhole constructionThroughout constructionConstruction phase16Provide wheel washing at construction site exit to clean the vehicle body and wheelTo prevent dust from being brought offsiteDSD's ContractorWhole constructionThroughout constructionConstruction phase17Cover materials on trucks before leaving the construction site to prevent debris from dropping windTo prevent falling of debris during traffic movement and by windDSD's ContractorWhole constructionThroughout constructionConstruction phase18Regular maintenance of plant equipment to prevent black smoke emissionTo minimize black smoke emissionDSD's constructionWhole constructionThroughout constructionConstruction phase19Throttle down or switch off unused machines or machine in intermittent useTo minimize dust emission and potential release of odour from exposed groundDSD's constructionWhole constructionThroughout constructionConstruction phase20Minimize excavation area as far as possibleTo minimize dust emission and potential release of odour from exposed groundDSD's constructionWhole constructionThroughout constructionConstruction phase20Minimize excavation area as far as possibleTo minimize dust emission and pot

606	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-4
	EF-510/2010 - Fort Sheller Sewerage, Stages - Sewerage Works at Fo Tor O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
3.8	A21	Store odourous excavated materials in covered	To minimize odour nuisance to sensitive receivers	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		containers and remove off-site as soon as possible		Contractor	construction	construction	phase	
		within 24 hours			site	phase		
3.8	A22	Cover open stockpiles of construction materials	To prevent soil erosion under rainstorm	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		(e.g. aggregates, sand and fill materials) with		Contractor	construction	construction	phase	
		impermeable materials such as tarpaulin during			site	phase		
		rainstorms						
3.8	A23	Hoarding of not less than 2.4 m high shall be	To minimize dust emission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		erected from ground level to surround the		Contractor	construction	construction	phase	
		construction site for sewage treatment plant along			site	phase		
		Po Toi O Chuen Road except for a construction						
		site entrance or exit						
3.8	A24	Carry out air quality monitoring throughout the	To monitor construction dust level	DSD's	At	Prior to and	Construction	EIAO-TM
		construction period		Contractor	representative	throughout	phase	
					ASRs	construction		
						phase		
3.8	A25	Carry out regular site inspection to audit the	To check the implementation status and effectiveness of	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		implementation of mitigation measures	mitigation measures	Contractor	construction	construction	phase	
					site	phase		

000	ED 516/2016 Devt Shalter Severage Stage? Severage Works at De Tei O	Page	M-5
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA	EM	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	& A		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
	Ref.		Main Concerns to address					Guidelines
Noise	Impact	I						
Projec	ct Specif	ic Measures						
4.7	N1	Use hand-held plant equipment or manual equipment within village area	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N2	For HDD, enclose the stationary plant equipment on three sides with cover. Only the side facing the sea shall be opened for heat exhaustion.	To lower noise transmission	DSD's Contractor	HDD work site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N3	Generator should be placed at a fixed location at least 5-6m away from the NSRs and screened by noise barrier whenever excavation work has to be carried out at their front doors	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N4	Avoid carrying out noisy activities at the same time. The work front of village sewer installation near NSRs PTO_N1 and PTO_N3 shall not be conducted concurrently with installation of Po Toi O Chuen Road sewer and horizontal directional drilling respectively.	To minimize noise production	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N5	Vibratory poker shall only be operated 4m away from NSR and with noise barrier properly erected. Surfacing work within 4m from NSR shall be carried out by manual method	To minimize noise production	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
Gene	ric/Stand	dard Measures			•			
4.7	N6	Schedule noisy activities to minimise exposure of nearby NSRs to high levels of construction noise	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N7	Use Quality Powered Mechanical Equipment (QPME) which produces lower noise level	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N8	Erect 3m high mobile barriers with skid footing and a small cantilevered upper portion within a few metres of stationary plants and within about 5m of more mobile plant.	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM

	ED 516/2016 Dert Shelter Sewerere Stars? Sewerere Werke at De Tei O	Page	M-6
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	
JUD	Monthly EM&A Report	Rev.	
		Date	Dec 23

	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
4.7	NO		Main Concerns to address	DODI		T 1 1 4		Guidelines
4.7	N9	Hand-held breaker shall be fitted with mufflers. A movable enclosure made	To lower noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		up of plywood is proposed to surround both worker and breaker during		Contractor	construction	construction	phase	
		breaking process. The internal wall of the enclosure should be laid with			site	phase		
		sound absorbent such as mineral wool.						
4.7	N10	Regular maintenance of plant equipment to prevent noise emission due to	To prevent noise emission due	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		impair	to impair	Contractor	construction	construction	phase	
					site	phase		
4.7	N11	Position mobile noisy equipment in location and direction away from NSR	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
			to NSR	Contractor	construction	construction	phase	
					site	phase		
4.7	N12	Use silencer or muffler on plant equipment and should be properly	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		maintained		Contractor	construction	construction	phase	
					site	phase		
4.7	N13	Throttle down or switch off unused machines or machine in Intermittent	To minimize noise production	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		use between work		Contractor	construction	construction	phase	
					site	phase		
4.7	N14	Make good use of stockpiles or other structures for noise screening	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
4.7	N15	Mobile plant should be sited as far away from NSRs as possible	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
4.7	N16	Reduce the percentage on-time for some noisy PMEs	To mimize noise production	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
4.7	N17	Carry out noise monitoring	To monitor construction noise	DSD's	At	Prior to and	Construction	EIAO-TM, APCO
			level	Contractor	representative	throughout	phase	
					NSRs	construction		
						phase		

	ED 540/2040 Dent Chelter Coursenes Sterre? Coursenes Works at De Tai O	Page	M-7
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA	EM	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant
Ref.	& A		Recommended Measure &	Agent	the measure	the	stages	Legislation &
	Ref.		Main Concerns to address			measure		Guidelines
Water	Quality	Impact						
Projec	t Specif	fic Measures						
5.8	W1	Divert the water from outfall of W3 (stream near Fairway Vista) during open cut	To prevent the excavated	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		excavation for laying of gravity sewer nearby	materials from falling into the	Contractor	construction site	construction	phase	EIAOTM
			water and being carried into the		310	phase		
			sea					
5.8	W2	Place sandbag along the upstream section of the stream near Fairway Vista and	To prevent the excavated	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		along rocky shore during open cut excavation for laying of gravity sewers/rising	materials from falling into the	Contractor	construction	construction	Phase	EIAOTM
		mains nearby.	water and being carried into the		site	phase		
			sea					
5.8	W3	Intercept the water from u-channel at the foot of the slope where the STP will be	To prevent water from entering	DSD's	Whole	Throughout	Construction	EIAO-TM
		built	the construction site	Contractor	construction site	construction	Phase	
					5110	phase		
5.8	W4	Install cofferdam around the proposed excavation area for entry pit of HDD work	To prevent debris from entering	DSD's	HDD work site	Throughout	Construction	EIAO-TM
		to prevent falling of debris into the sea	the waterbodies	Contractor		construction	Phase	
						phase		
5.8	W5	Install sheet piles in marine waters by vibratory action.	To minimize dispersion of	DSD's		Throughout	Construction	EIAO-TM
			marine sediment	Contractor	construction site	construction	phase	
					0.10	phase		
5.8	W6	Marine works (dredging, construction and installation works at diffuser location,	To minimize dispersion of	DSD's	Whole	Throughout	Construction	EIAO-TM
		backfilling) shall be carried out inside the watertight cofferdam. The cofferdam	marine sediment	Contractor	construction site	construction	Phase	
		can only be removed after completion of work				phase		
5.8	W7	Dredging should be carried out by grab dredgers anchored outside the cofferdam.	To minimize dispersion of	DSD's	Whole	Throughout	Construction	EIAO-TM
		The marine sediment should be placed in sealed compartment of the marine	marine sediment	Contractor	construction site	construction	Phase	
		barge.				phase		
5.8	W8	Water removed from the cofferdam should be desilted before discharge back into		DSD's	Whole	Throughout	Construction	EIAO-TM
		the sea.	To prevent discharge of silty	Contractor	construction site	construction	phase	
			water into the sea		0.10	phase		

	ED 540/2040 Dart Chalter Courseans Stars? Courseans Works at Do Tai O	Page	M-8
CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	Ref# EMA2204/03/27 Rev. 01
JUJ	Monthly EM&A Report	Rev.	
		Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
5.8	W9	Carry out water quality monitoring at water sensitive receivers before and during	To identify any water quality	DSD's	Water	Before and	Construction	EIAO-TM
		cofferdam installation works, throughout dredging works, and during cofferdam	impact due to construction	Contractor	Monitoirng	throughout	phase	
		extraction works	works		Stations	installation and		
						extraction works		
						of cofferdam		
5.8	W10	The following summarizes the precautionary measures for	To prevent emergency	DSD	Sewage	Operational phase	Operational	EIAO-TM
		minimizing chance of emergency discharge:	discharge		Treatment Plant		phase	
		Provision of dual power by CLP;						
		• Equipped with Supervisory control and data acquisition system (SCADA), which						
		signals to the operation and maintenance personnel for emergency attendance in						
		case of plant failure;						
		 Provision of standby pump and screen at the PTOSTW. 						
		Provision of emergency generator within 4 hours by DSD's future term contractor.						
		Provision of emergency storage with capacity of 4-hr sewage retention time.						
		Arrangement of tankers for removing incoming sewage to other sewage treatment						
		plants for treatment.						
5.8	W11	Carry out water quality monitoring at water sensitive receivers during normal	To identify any water quality	DSD	At	6 months before	Operational	WPCO, EIAO-TM
		operation	impact due to the normal		representative	and in 1st year of	phase	
			operation of the Sewage		WSRs	operation		
			Treatment Plant (STP)					
Generi	c/Standard N	leasures						
5.8	W12	Set up sedimentation tank for settling suspended solids in wastewater before	To reduce the amount of	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		discharge into storm drains. Sand/silt removal facilities such as sand traps, silt traps	suspended solid in wastewater	Contractor	construction	construction	phase	EIAO-TM
		and sedimentation basin should be provided with adequate capacity.			site	phase		
5.8	W13	Follow ProPECC PN 1/94 "Construction Site Drainage" as far as practicable	To minimize surface runoff and	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
			chance of erosion	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W14	Construct catchpits and perimeter channels prior to commencement of site formation	To stop runoff from flowing	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		works and earthworks.	across the construction site	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W15	Maintain silt removal facilities, channels, manholes before and after rainstorm.	To prevent failure that may lead	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
			to flooding	Contractor	construction	construction	phase	EIAO-TM
					site	phase		

	ED 510/0010 Dart Chalter Coursena Stars? Courseas Works at Do Toi O	Page	M-9
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA Ref.	EM & A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relevant Legislation & Guidelines
5.8	W16	Remove silt and grit from silt trap at regular interval.	To prevent blockage the may lead to flooding	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W17	Well design works program to minimize the work areas to minimize the soil exposure and site runoff.	To minimize surface runoff and chance of erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W18	Arrange soil excavation works outside rainy seasons (April to September) as far as possible. If this cannot be achieved, the following measures should be implemented: - Cover temporary exposed slope surfaces with impermeable materials, e.g. tarpaulin - Protect temporary access roads by crushed stone or gravel - Provide intercepting channels along crest/edge of excavation - Carry out adequate surface protection measures well before the arrival of a rainstorm	To minimize surface runoff and chance of erosion	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W19	Minimize exposed earth after completion of work in a certain area by hydroseeding, vegetating, soil compacting or covering with bitumen	To prevent soil erosion under Rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W20	Prevent rainwater from entering trenches. Excavation of trenches should be dug and backfilled in short sections during rainy seasons. Remove silt in rainwater collected from the trenches or foundation excavations prior to discharge to storm drains.	To prevent soil erosion under Rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W21	Cover open stockpiles of construction materials (e.g. aggregates, sand and fill materials) with impermeable materials such as tarpaulin during rainstorms.	To prevent soil erosion under rainstorm	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W22	Cover and temporary seal manholes to prevent silt, construction materials or debris and surface runoff from entering foul sewers.	To prevent overloading of foul sewers	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	ProPECC PN 1/94, EIAO-TM
5.8	W23	Remove waste from the construction site regularly.	To prevent waste accumulation	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	EIAO-TM, APCO
5.8	W24	Apply discharge license for effluent discharge. Treat the discharge to comply with the requirement in TM-DSS.	To ensure compliance with effluent discharge requirement	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	WPCO, TM-DSS, EIAOTM

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-10
	EI -510/2010 - 1 Oft Onener Gewerage, Stages - Gewerage Works at 10 1010	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
	······································	Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
5.8	W25	Reuse treated effluent onsite, e.g. dust suppression, wheel washing and general cleaning.	To minimize wastewater	DSD's	Whole	Throughout	Construction	Waste Disposal
			generation	Contractor	construction	construction	phase	Ordinance, EIAO-
					site	phase		TM
5.8	W26	Monitor effluent water quality	To ensure compliance with	DSD's	Whole	Throughout	Construction	WPCO, EIAO-TM
			effluent discharge requirement	Contractor	construction	construction	phase	
					site	phase		
5.8	W27	Register as chemical waste producer if chemical waste will be generated.	To control chemical waste	DSD's	Whole	Throughout	Construction	Waste Disposal
				Contractor	construction	construction	phase	(Chemical
					site	phase		Waste) (General)
								Regulation, EIAO-
								TM
5.8	W28	Perform maintenance of vehicles and equipment that have oil leakage and spillage potential on	To prevent oil leakage or	DSD's	Whole	Throughout	Construction	Waste Disposal
		hard standings within a bunded area with sumps and oil interceptors.	spillage	Contractor	construction	construction	phase	(Chemical
					site	phase		Waste) (General)
								Regulation, EIAO-
								TM
5.8	W29	Dispose chemical waste in accordance to Waste Disposal Ordinance. Follow the Code of Practice	To avoid accident in waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		on the Packaging, Labelling and Storage of Chemical Wastes, examples as follows:	storage and handling	Contractor	construction	construction	phase	Ordinance, EIAO-
		- Store chemical wastes with suitable containers to avoid leakage or spillage during storage,			site	phase		TM
		handling and transport						
		- Label chemical waste containers according to the CoP to notify and warn the waste handlers						
		- Store chemical wastes at designated safe location with adequate space						
5.8	W30	Provide sufficient chemical toilets with regular maintenance by registered waste collector where	To proper collection of tasks	DSD's	Whole	Throughout	Construction	Waste Disposal
		necessary	force waste	Contractor	construction	construction	phase	Ordinance, EIAO-
					site	phase		TM
5.8	W31	Provide a drip tray/container underneath the bentonite recycling system	To prevent any leaked bentonite	DSD's	Whole	Throughout	Construction	EIAO-TM
			from entering the watercourse	Contractor	construction	construction	phase	
			or sea		site	phase		
5.8	W32	Carry out regular site inspection to audit the implementation of mitigation measures	To check the implementation	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
			status and effectiveness of	Contractor	construction	construction	phase	
			mitigation measures		site	phase		
5.8	W33	Carry out effluent quality monitoring at location specified in the discharge licence	To ensure compliance with	DSD	Effluent outlet	Operational phase	Operational phase	WPCO, EIAO-TM
			effluent discharge requirement					

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-11
	Er-510/2010 - Foit Sheller Sewerage, Stages - Sewerage Works at FO 1010	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA Ref.	EM & A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relevant Legislation &
Tourset								Guidelines
	ial Ecolog	·						
	Specific M			:			1	
6.12	E1	Erect bright color fencing along the boundary of the undisturbed region of the shrubland and woodland, and around <i>Diospyros vaccinioides</i> , a plant species of conservation importance,	To protect the shrub from being Damaged	DSD's Contractor	Whole construction site	Throughout construction	Construction phase	EIAO-TM
		near the work boundary to remind workers not to trespass or occupy the area, and to be careful during operation of equipment.			310	phase		
6.12	E2	Reinstate the disturbed rocky shore with the rocks temporarily removed	To restore the rocky shore habitat	DSD's Contractor	HDD work site	After completion of works near the	Construction Phase	EIAO-TM
						rocky shore	1 11000	
6.12	E3	Place sandbag around the section of W3 next to Fairway Vista and along the shore during	To prevent the excavated	DSD's	Whole	When	Construction	EIAO-TM
		open cut excavation for laying of gravity sewer nearby.	materials from falling into the	Contractor	construction site	construction work	Phase	
			water and being carried into the sea			is carried out in the vicinity of W3		
6.12	E4	Temporarily divert the water from outfall of W3 away from excavation area.	To prevent the excavated materials from	DSD's	Whole	When	Construction	EIAO-TM
			falling into the water and being carried into	Contractor	construction site	construction work	Phase	
			the sea			is carried out in		
						the vicinity of W3		
6.12	E5	Inspect the condition of the Diospyros vaccinioides near the work boundary as part of weekly	To inspect the condition of the Diospyros	DSD's Contractor	Whole construction	Throughout	Construction	EIAO-TM
		site audit	vaccinioides	Contractor	site	construction phase	phase	
Generic	/Standard	Measures						
6.12	E6	Erection of hoarding, fencing or provision of clear demarcation of work zones	To remind workers not to	DSD's	Whole	Throughout	Construction	EIAO-TM
			damage area outside the work boundary	Contractor	construction site	construction phase	Phase	
6.12	E7	Designate areas for placement of equipment, building materials and wastes away from the	To prevent damage on the	DSD's	Whole	Throughout	Construction	EIAO-TM
		natural environment	natural environment	Contractor	construction site	construction phase	Phase	
6.12	E8	Carry out tree preservation and compensatory tree planting will be carried out in accordance		DSD's	Whole	After completion	Construction	EIAO-TM
		with DEVB TCW No. 7/2015.	To reinstated woodland habitat	Contractor	construction site	of works near woodland	phase	

	ED 516/2016 Dest Shelter Severage Stage? Severage Werks at De Tei O	Page	M-12
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
Terrest	trial Ecology							
Project	Specific Me	asures						
9.8	WM1	Sludge will be delivered by sealed sludge tanker for treatment at Sludge	To prevent odour nuisance	DSD	STP	Throughout	Operational	Waste Disposal
		Treatment Facilities				construction	phase	(Chemical
						phase		Waste)
								(General)
								Regulation,
								EIAO-TM
9.8	WM2	Debris from screening process and general refuse should be stored within	To prevent odour nuisance	DSD	STP	Throughout	Operational	Waste Disposal
		the STP in sealed container and be disposed of at landfill regularly.				construction	phase	(Chemical
						phase		Waste)
								(General)
								Regulation,
								EIAO-TM
9.8	WM3	Worn filters and MBR membrane shall be stored and labelled as in	To prevent odour nuisance	DSD	STP	Throughout	Operational	Waste Disposal
		construction phase. Chemical wastes shall be treated at chemical				construction	phase	Ordinance,
		treatment facility by licensed contractor				phase		EIAO-TM
Generi	c/Standard N	Aeasures						
9.8	WM4	Allocate an area for waste sorting and storage of C&D materials	To minimize waste generation	DSD's	Whole	Throughout	Construction	Waste Disposal
		into the following categories for reuse, recycle or disposal if		Contractor	construction site	construction	Phase	Ordinance,
		possible. Remove waste from the construction site for sorting				phase		EIAO-TM
		once generated if no suitable space can be identified.						
		- excavated materials suitable for reuse						
		- inert C&D materials (or public fill) for disposal offsite						
		- non-inert C&D materials (or C&D waste) for disposal at						
		landfills						
		- chemical waste						
		- bentonite slurry for reconditioning and reuse						
		- general refuse						

000	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-13
	R	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
	······································	Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
9.8	WM5	Adopt good site practice as follows:	To proper handling of waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		- Provide training to workers on site cleanliness, waste		Contractor	construction	construction	phase	Ordinance,
		management (waste reduction, reuse and recycle) and chemical			site	phase		EIAO-TM
		handling procedures						
		- Provide sufficient waste collection points and regular removal						
		- Cover waste materials with tarpaulin or in enclosure during						
		transportation						
		- Maintain drainage systems, sumps and oil interceptors						
		- Sort out chemical waste for proper handling and treatment						
		onsite or offsite						
9.8	WM6	Adopt waste reduction measures as follows:	To minimize waste generation	DSD's	Whole	Throughout	Construction	Waste Disposal
		- Allocate area/containers for sorting, recovering and storing		Contractor	construction	construction	phase	Ordinance,
		waste for reuse, recycle or disposal (e.g. demolition debris and			site	phase		EIAO-TM
		excavated materials, general refuse like aluminium cans.)						
		Remove waste from the construction site for sorting once						
		generated if no suitable space can be identified.						
		- Allocate area for proper storage of construction materials to						
		prevent contamination						
		- Minimize wastage through careful planning and avoiding overpurchase						
		of construction materials						
9.8	WM7	Prepare and implement a site-specific Waste Management Plan (WMP) as	To provide guidance to waste	DSD's	Whole	Throughout	Construction	ETWB TCW
		part of Environmental Management Plan (EMP) in accordance with ETWB	management	Contractor	construction	construction	phase	No.
		TCW No. 19/2005. Detail waste management method in the form of			site	phase		19/2005, EIAO-
		avoidance, reuse, recovery, recycling, storage, collection, treatment and						ТМ
		disposal according to the recommendations on the EIA and EM&A Manual.						
		It should be approved by the ER and regularly reviewed.						

SGS Ref# EMA2204/03/27 Nonthly EM&A Report Rev. 01 Date Dec 23		ED 510/0010 Dert Shelter Severane Stars? Severane Works at De Tei O	Page	M-14
Monthly Ewick Report		EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
	JUJ	Monthly EM&A Report	Rev.	01
			Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
9.8	WM8	Store waste materials properly as follows:	To properly store waste	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94, EIAOTM
		- Avoid contamination by proper handling and storing waste		Contractor	construction	construction	phase	
		- Prevent erosion by covering waste			site	phase		
		- Apply water spray on excavated materials						
		- Maintain and clean storage area regularly						
		- Sort and stockpile different materials at designated location to enhance reuse						
9.8	WM9	Apply for relevant waste disposal permits in accordance with the Waste Disposal	To properly dispose waste	DSD's	Whole	Throughout	Construction	Waste Disposal Ordinance
		Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste)		Contractor	construction	construction	phase	(Cap. 354), Waste
		Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28),			site	phase		Disposal (Charges for
		Dumping at Sea Ordinance (Cap. 466).						Disposal of Construction
								Waste) Regulation (Cap.
								345) and the Land
								(Miscellaneous
								Provisions) Ordinance
								(Cap. 28), Dumping at
								Sea Ordinance (Cap.
								466), EIAO-TM
9.8	WM10	Hire licensed waste disposal contractors for waste collection and removal. Dispose waste	To properly dispose waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		at licensed waste disposal facilities		Contractor	construction	construction	phase	Ordinance, EIAO-TM
					site	phase		
9.8	WM11	Implement trip-ticket system for recording the amount of waste generated, recycled and	To monitor movement of waste	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		disposed, including chemical wastes		Contractor	construction	construction phase	phase	Waste) (General)
					site	phaoe		Regulation, Waste
								Disposal Ordinance,
								EIAO-TM
9.8	WM12	Provide wheel washing at construction site exit to clean the vehicle body and wheel	To prevent dust from being	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94, EIAOTM
			brought offsite	Contractor	construction	construction phase	phase	
					site	phace		
9.8	WM13	Reduce water content in wet spoil generated from piling work by mixing with dry	To minimize load to reception	DSD's	Whole	Throughout	Construction	Waste Disposal
		materials. Only dispose treated spoil with less than 25% dry density to Public Fill	facilities	Contractor	construction	construction phase	phase	Ordinance, EIAO-TM
		Reception Facilities			site	pilase		

SGS Ref# EMA2204/03/27 Monthly EM&A Report Rev. 01		ED 546/2046 - Dart Chalter Couverage Stars? - Couverage Works of Da Tai O	Page	M-15
Monthly EM&A Report		EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
	JUJ	Monthly EM&A Report	Rev.	01
		······································	Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
9.8	WM14	Dispose dry waste or waste with less than 70% water content by	To minimize load to reception	DSD's	Whole	Throughout	Construction	Waste Disposal
		weight to landfill	facilities	Contractor	construction	construction	phase	Ordinance, EIAO-TM
					site	phase		
9.8	WM15	Follow the Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	To avoid accident in waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		as follows:	storage and handling	Contractor	construction	construction	phase	Ordinance, EIAO-TM
		- Store chemical wastes with suitable containers. Seal and maintain the container to			site	phase		
		avoid leakage or spillage during storage, handling and transport						
		- Label chemical waste containers in both English and Chinese with instructions in						
		accordance to Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation						
		- The container capacity should be smaller than 450 litres unless agreed by the EPD						
9.8	WM16	Comply with the requirement of the chemical storage area:	To ensure proper storage of	DSD's	Whole	Throughout	Construction	Waste Disposal
		- Store only chemical waste and label clearly the chemical characters of the waste	chemical waste	Contractor	construction	construction	phase	Ordinance, EIAO-TM
		- Have at least 3 sides enclosed and protected from rainfall with cover			site	phase		
		- Provide sufficient ventilation						
		- Have impermeable floor and has bunds to contain 110% of the						
		capacity of the largest container or 20% of the total volume of						
		the stored waste in the area, whichever is larger						
		- Adequately spaced incompatible materials						
9.8	WM17	Transfer used lubricants, waste oils and other chemicals to oil recycling companies, if	To ensure proper disposal of	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		possible, and empty oil drums for reuse or refill. No direct or indirect discharge is	chemical waste	Contractor	construction	construction phase	phase	Waste) (General)
		permitted			site			Regulation, EIAO-TM
9.8	WM18	Hire licensed chemical waste disposal contractors for waste collection and removal.	To ensure proper disposal of	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		Dispose chemical waste at the approved Chemical Waste Treatment Centre at Tsing Yi	chemical waste	Contractor	construction	construction phase	phase	Waste) (General)
		or other licensed facility			site	P.1.500		Regulation, EIAO-TM
9.8	WM19	Hire reputable waste collector to separately collect and dispose general refuse from other	To ensure proper disposal of	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		wastes. Cover the waste to prevent being blown away	general refuse	Contractor	construction	construction phase	phase	Waste) (General)
					site	F.1800		Regulation, EIAO-TM

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-16
	Reference and the severage, stages - severage works at PO TOPO	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
	······································	Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant Legislation &
Ref.	Ref.		Recommended Measure	Agent	the measure	the	stages	Guidelines
			&			measure		
			Main Concerns to					
			address					
9.8	WM20	Provide recycling bins for sorting out recyclables for collection by recycling	To ensure proper recycling	DSD's	Whole	Throughout	Construction	Waste Disposal
		companies. Non-recyclables should be removed to designated landfills	and	Contractor	construction	construction	phase	Ordinance, EIAO-TM
		every day by licensed collectors to prevent environmental and health	disposal of general refuse		site	phase		
		nuisance.						
9.8	WM21	Organize training and reminders to site staff on waste minimization through	To ensure proper	DSD's	Whole	Throughout	Construction	EIAO-TM
		avoidance and reduction, reusing and recycling	management	Contractor	construction	construction	phase	
			of general refuse		site	phase		
9.8	WM22	Used bentonite shall be reconditioned onsite and reused as far as practical	To minimize wastage of	DSD's	Whole	Throughout	Construction	EIAO-TM
		to minimize wastage. If this is deemed not viable, the used bentonite shall	bentonite	Contractor	construction	construction	phase	
		be delivered offsite for reconditioning.			site	phase		
9.8	WM23	Characterize the sediment quality of the marine sediment to be dredged and	To verify the categories of	DSD's	To be	Before	Construction	ETWB TC(W) No.
		submit a Sediment Quality Report for EPD's approval. Dispose the dredged	sediment to be disposed in	Contractor	allocated	dredging works	phase	34/2002
		marine sediment in accordance with ETWB TC(W) No. 34/2002	accordance with ETWB		by CEDD	worko		
			TC(W)					
			No. 34/2002					

CCC	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page Ref#	M-17 EMA2204/03/27
363	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA Ref.	EM & A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relevant Legislation & Guidelines
Project Spe	ecific Measu	res						
Table 10-6	CM8	Protective materials to be provided to natural rocky coastline to prevent damage to existing landform from plant and machinery during temporary drilling operations. Reinstatement following removal of plant & equipment to original or improved condition shall be undertaken.	To protect landscape resources	DSD's contractor	Temporary drilling site for submarine outfall	Construction planning and during construction period	Construction phase	Particular Specification
Table 10-7	OM1	Sensitive design of sewage treatment plant in terms of scale, height and bulk (visual weight) to integrate the building into the existing topography.	To mitigate visual impacts	DSD's Design Architect/ Engineer	STP	Design Phase	Design Phase	Detailed Design Drawings and Specifications
Table 10-7	OM2	Use of appropriate building materials and colors for Sewage Treatment Plant to complement surroundings	To mitigate visual impacts	DSD's Design Architect/ Engineer DSD's contractor Building Operator/DSD	STP	Design Phase Construction Phase & first year in Operational Phase Operational phase	Design, Construction and Operational Phases	Detailed Design Drawings and Specifications
Generic/Sta	andard Mea	sures		Operator/DSD				
Table 10-6	CM1	The construction area and contractor's temporary works areas should be minimized to avoid impacts on adjacent landscape. All slope excavation shall take place from within the work boundary to minimize impacts on adjacent slopes.	To avoid impact on adjacent landscape areas	DSD's Contractor	STP, along gravity sewers and rising mains construction route and at temporary drilling site for submarine outfall	Construction planning and during construction period	Construction Phase	Detailed Design drawings and particular specifications
Table 10-6	CM2	Reduction of construction period to practical minimum	To minimize duration of impact	DSD's contractor	N/A	Construction planning and during construction period	Construction phase	N/A

SUS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page Ref#	M-18 EMA2204/03/27
343	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA Ref.	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
Table	CM3	Construction traffic (land and sea) including construction plant, construction vessels and	To minimize visual impacts to	DSD's	STP, along	Construction	Construction	As per the Particular
10-6		barges to be kept to a practical minimum.	local residents and surrounding	Contractor	gravity sewers	planning and	phase	Specification
			VSRs		and rising	during		
					mains	construction		
					construction	period		
					route at			
					temporary			
					drilling and			
					dredging sites			
					for submarine			
					outfall			
Table	CM4	Erection of decorative mesh screens or construction hoardings and/or temporary noise	To screen construction works	DSD's	STP, along	Construction	Construction	As per the Particular
10-6		barriers around works areas in visually unobtrusive colors.	from local residents and	Contractor	gravity sewers	planning and	phase	Specification
			surrounding VSRs		and rising	during		
					mains	construction		
					construction	period		
					route and at			
					temporary			
					drilling site for			
					submarine			
					outfall			
Table	CM5	Avoidance of excessive height and bulk of site buildings and structures.	To reduce visual impact	DSD's Contractor	STP, and at	Construction	Construction	As per the Particular
10-6				Contractor	temporary	planning and	phase	Specification
					drilling site for	during		
					submarine	construction		
					outfall	period		
Table	CM6	Control of night-time lighting by hooding all lights and through minimization of night	To maximize screening of the	DSD's	STP and at	Construction	Construction	As per the Particular
10-6		working periods.	works	Contractor	temporary	planning and during	phase	Specification
					drilling and	construction		
					dredging site	period		
					for submarine			
					outfall			

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-19
	Re	Ref#	EMA2204/03/27
JUD	Monthly EM&A Report		01
		Date	Dec 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant Legislation &
Ref.	A Ref.		Recommended Measure	Agent	the measure	the	stages	Guidelines
			&			measure		
			Main Concerns to					
			address					
Table	CM7	All existing trees shall be carefully protected during construction. A Detailed	To maximize protection of	DSD's	STP and all	Construction	Construction	As per Tree Protection
10-6		Tree Protection Specification shall be provided in the Contract Specification.	existing trees	Contractor	other	planning and	phase	Particular Specification,
		Under this specification, the Contractor shall be required to submit, for			construction	during		DEVB TC (W)
		approval, a detailed working method statement for the protection of trees			areas	construction		No.10/2013 and
		prior to undertaking any works adjacent to all retained trees, including trees				period		Guidelines for Tree Risk
		in contractor's works areas. Tree risk assessment shall be undertaken to all						Assessment and
		existing trees within the project site as per "Guidelines for Tree Risk						Management
		Assessment and Management Arrangement"						Arrangement
Table	OM3	Lighting units to be directional and minimize unnecessary light spill and	To mitigate visual impacts	DSD's Design	STP	Design Phase	Design,	Detailed Design
10-7		glare.		Architect/ Engineer			Construction and	Drawings
				DSD's contractor		Construction	Operational	and Specifications
						Phase & first	Phases	
						year		
						in Operational		
						Phase		
				Building		Operational		
				Operator/DSD		phase		
Table	OM4	Greening measures to reinstate the landscape which are appropriate to the	To mitigate visual impacts	DSD's Design	STP	Design Phase	Design,	Detailed Design
10-7		context, including tree and shrub planting and vertical greening, shall be		Landscape Architect			Construction and	Drawings
		implemented.		DSD's contractor		Construction	Operational	and Specifications
						Phase & first	Phases	
						year		
						in Operational		
						Phase		
				Building	1	Operational		
				Operator/DSD		phase		

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-20
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant Legislation &
Ref.	A Ref.		Recommended Measure	Agent	the measure	the	stages	Guidelines
			&			measure		
			Main Concerns to					
			address					
Table	OM5	Compensatory tree planting for all felled trees shall be provided to the	To mitigate landscape and	DSD's	STP and at	Design Phase	Design,	As per approved Tree
10-7		satisfaction of relevant Government departments. Required numbers and	visual impacts of tree loss	Landscape Architect	temporary		Construction and	Removal Application,
		locations of compensatory trees shall be determined and agreed separately		7	drilling site for		Operational	Detailed Design
		with Government during the Tree Felling Application process under the		Contractor's	submarine	Construction	Phases	Drawings, Tree
		relevant technical circulars. Tree risk assessment shall be undertaken to all		Landscape Architect	outfall	Phase & first		Protection
		existing trees within the project site as per "Guidelines for Tree Risk		, and a solution		year		Particular Specification
		Assessment and Management Arrangement"				in Operational		and Guidelines for Tree
						Phase		Risk Assessment and
				Building		Operational		Management
				Operator/DSD		phase		Arrangement

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	M-21
		Ref#	EMA2204/03/27
	Monthly EM&A Report		01
	······································	Date	Dec 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
Built H	eritage					·	•	
Project	Specific Me	asures						
11.6	BH1	Undertake condition survey by professional qualified building surveyor or	To record the condition of the	DSD's	GB01, BH02,	Before	Construction	EIAO-TM and
		engineer to record the existing condition of the built heritage resources.	built heritage resources before	Contractor	LF04	commencement	Phase	Guidelines
			the commencement of			of		for CHIA
			construction works			construction		
						works		
11.6	BH2	Carry out vibration and settlement monitoring to built heritage resources. A	To minimize the potential	DSD's	GB01, BH02,	During	Construction	EIAO-TM and
		maximum vibration level 7.5mm/s shall be adopted for the Grade 3 Hung	impact by mechanical vibration	Contractor	LF04	construction	phase	Guidelines
		Shing Temple and settlement check points in the Alert/Alarm/Action limit	and settlement of built heritage			works		for CHIA
		levels at 6mm/8mm/10mm shall be adopted.	resources					
11.6	BH3	Provision of protective covering or protective screen to built heritage	To prevent direct impact from	DSD's	GB01, BH02,	During	Construction	EIAO-TM and
		resources which are close to the works area	the machine and damages by	Contractor	LF01, LF04	construction	phase	Guidelines
			construction tools or waste			works		for CHIA
11.6	BH4	Maintain public access to the cultural landscape features as far as possible	To avoid the proposed works	DSD's	LF01, LF04,	During	Construction	EIAO-TM and
			affecting the worshippers	Contractor	LF05	construction	phase	Guidelines
						works		for CHIA
11.6	BH5	Provision of buffer zone of at least 1m from the proposed works as far as	To avoid the proposed works	DSD's	BH02, LF01,	During	Construction	EIAO-TM and
		possible	affecting the worshippers	Contractor	LF04	construction	phase	Guidelines
						works		for CHIA

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed proj



APPENDIX N - RECOMMENDED MITIGATION MEASURES AND PROACTIVE ENVIRONMENTAL PROTECTION PROFORMA

SGS	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	N-2
	EF-510/2010 - Fort Sheller Sewerage, Slages - Sewerage Works at FO TOPO	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
	······································	Date	Dec 23

Reporting Period: 2023-06-01 - 2023-06-30

Construction Works Area: PTO-SW-03, PTO-Trenchless -01& STP

Anticipated Impacts: Dust, Noise, Water Quality, Terrestrial Ecology, Marine Ecology, Fisheries, Waste Management, Landscape and Visual and Build Heritage Impact

Item	EIA Ref.	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
		Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Air	3.8	A10 -	a) Major air quality impact in construction phase	a) All construction plants / machineries will be	(a) Hoarding of not less than 2.4 m high shall be erected from	Contractor	a) 1-hour and 24-hour TSP levels will be
Quality		A25	would arise from excavation of slope at the	checked / serviced on a regular basis during the courses	ground level to surround the work area along Po Toi O Chuen		measured in accordance to the standard
Impact			proposed sewage treatment plant.	of construction to minimize the emission of noise	Road except for a site entrance or exit.		high-volume sampling method as set out in
				generation and eliminate dark smoke emission.			the Title 40 of the Code of Federal
			b) Excavation, Gas welding, slope cutting, Rock		(b) Good housekeeping to minimize dust generation, e.g. by		Regulations, Chapter 1 (Part 50), Appendix
			dowel, fencing, flexible barrier installation Loading	b) All dump trucks will be equipped with mechanical covers	properly handling and storing dusty materials.		Α.
			& Unloading Dusty Materials storage, Dusty	to prevent the dust emission during transportation when			
			Waste Sorting, Temporary Site Traffic Control	necessary.	(c) Adopt dust control measures, such as dust suppression		b) Due to objection from the residents of Po
					using water spray on exposed soil at least 4 times a day, in		Toi O village of the use of high-volume
				c) Dust control measures, such as water spraying, will be	areas with dusty construction activities and during material		sampler (HVS) in conducting 24-hours TSP
				provided during demolition works when necessary.	handling.		measurement, 24-hour TSP measures for
							impact monitoring is to be measured by
				d) Maintaining of wet surface on access road and keep	d) Minimize exposed earth after completion of work in a		portable dust meters during construction
				slow speed in the site.	certain area by hydroseeding, vegetating, soil compacting or		phase of the project. This is to be approved
					covering with bitumen.		and verified by ER and IEC.
				e) Conditions in the Environmental Permit			
				and Discharge License should be followed.	(e) Provide wheel washing at site exit to prevent carrying		c) Other than using high volume sampler, 1-
					dust outside of the site.		hour TSP levels can be measured
				f) Predict required quantity of concrete			alternatively by direct reading from portable
				accurately and collect the unused fresh	(f) Cover materials on trucks before leaving the site.		dust meters upon approval from ER. The
				concrete at designated locations in the site for			meters should be capable of producing
				subsequent disposal.	(g) Limit vehicle speed of construction trucks within the		comparable results as that by the high-
					construction site and in Po Toi O, maximum at 10km/hr, and		volume sampling method, to indicate short
				g) Provide sufficient mitigation measures as	confine vehicle movement in haul road.		event impacts.
				recommended in approved EIA Manual requirement.			
					(h) As there is limited space in Po Toi O, stockpiling should		d) -The ET shall agree with the IEC on the
					be avoided. However, if found necessary, the materials		monitoring position and the corrections
					should be covered by impervious materials such as tarpaulin.		adopted.
							e) -The agreed position shall be chosen in
							subsequent baseline and impact
							monitoring.

	ED 546/2046 - Dart Chalter Couverage Stars? - Couverage Warks at Da Tai O	Page	N-3
	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Noise	4.7	N1 -	a) The Project comprises three main	a) Conditions in the Environmental Permit and		Contractor	a) Noise measurement shall normally
Impact		N175	works including the construction of	Discharge License should be followed.			be at a point 1 m from the exterior of
Control			sewage treatment plant (STP),				the sensitive receiver building façade
			underground sewers and rising main, and	b) Provide sufficient mitigation measures as			and be at a position 1.2 m above the
			the submarine outfall.	recommended in approved EIA Manual			ground. If the normal monitoring
				requirement.			position cannot be accessed, an
			b) The major noise impact will arise from				alternative position may be chosen,
			the use of powered mechanical				and a correction to the
			equipment.				measurements shall be made. For
							reference, a correction of +3 dB(A)
			c) Excavation, Gas welding, slope cutting,				shall be made to the free field
			Rock dowel, fencing, flexible barrier				measurements.
			installation Loading & Unloading Dusty				
			Materials storage, Temporary Site Traffic				b) The ET shall agree with the IEC on
			Control.				the monitoring position and the
							corrections adopted.
							c) The agreed position shall be
							chosen in subsequent baseline and
							impact monitoring.



Monthly EM&A Report

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Water	5.8	W1-	a) Major Water quality impact will be	a) Wastewater to be treated by wastewater	a) Well manage construction materials, chemicals,	Contractor	a) Weekly site audit to monitor the
Quality		W33	originated from minor displacement of	treatment facilities before discharge.	sewage for proper storage and usage and to prevent		implementation of the proposed water
impact			suspended solids during installation,		accumulation onsite.		quality mitigation measures and
			testing pipe and extraction of cofferdam	b) Conditions in the Environmental Permit and	(b) Immediately clean up contaminated soil upon		check the Contractor's work practice
			around the proposed diffuser.	Discharge License should be followed.	chemical and oil leakage.		on water pollution prevention during
					(c) Label chemical waste containers according to the		construction phase.
					Code of Practice to notify and warn the waste		
					handlers. Store fuels, chemicals and chemical waste		b) Should water pollution is observed
					at designated area with locks and bunds.		(e.g. discharge of silty water into
					(d) Register as chemical waste producer.		storm drains), the ET should record
					(e) Set up sedimentation tank for settling suspended		the environmental deficiency for
					solids in wastewater before discharge into storm		investigation.
					drains. Sand/silt removal facilities such as sand		
					traps, silt traps and sedimentation basin should be		c) The Contractor should be notified
					provided with adequate capacity.		and responsible for carrying out
					(f) Provide sufficient number of chemical toilets if		rectification work immediately.
					necessary and employ licensed contractor for		
					regular clean-up and maintenance.		d) The ET shall re-inspect the Project
					(g) Provide wheel washing at site exit to prevent dust		Site and review the effectiveness of
					and silty water from leaving the construction site.		the remedial measure performed until
					(h) Cover slope and loose materials with tarpaulin		satisfaction.
					before rainstorm and inspect the area afterwards.		
					(i) Cover manhole to prevent silt, construction		e) The Contractor shall implement
					materials or debris and surface runoff from entering		preventive measure to avoid causing
					the foul sewer.		the same problem.
					(j) Install fully enclosed cofferdam around the		
					proposed diffuser and deploy a dredger barge		
					outside the cofferdam for dredging and filling works.		



Monthly EM&A Report

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Terrestrial	6.12	E1-E8	a) The proposed Project will cause minor	a) Conditions in the Environmental Permit and	a) Construction noise and water quality mitigation	Contractor	(a) Bright colour fencing shall be
Ecology			habitat loss of shrubland, temporary	Discharge License should be followed.	measures proposed in the previous sections will be		erected along the boundary of the
			habitat loss of woodland, developed area		applicable to terrestrial ecology.		undisturbed region of the shrubland
			and rocky shore, and removal of one	b) Provide sufficient mitigation measures as			and woodland, and around Diospyros
			individual climber species of conservation	recommended in approved EIA Manual			vaccinioides, a plant species of
			importance that is common within the	requirement.			conservation importance, near the
			Study Area and Hong Kong. Indirect				work boundary to remind workers not
			water quality impact may arise from				to trespass or occupy the area, and
			surface runoff or accidental spillage of				to be careful during operation of
			chemicals in construction Phase.				equipment.
			b) Use of powered plant equipment may				(b)Inspect the condition of Diospyros
			bring noise disturbance on wildlife				vaccinioides as part of weekly site
							audit.
							(c) Reinstate the disturbed rocky
							shore with the rocks temporarily
							removed.
							(d) Carry out compensatory tree
							planting in accordance with DEVB
							TCW No. 7/2015 to reinstate the
							affected woodland.

	ED 546/2016 Dart Sholtar Sawarana Stana2 Sawarana Warka at Da Tai O	Page	N-6
C <u>C</u> <u>C</u>	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
		Date	Dec 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Marine	7	7	a) The proposed Project will cause minor	a) Conditions in the Environmental Permit and	a) The variation in water quality at coral and	Contractor	(a) No specific monitoring and audit
Ecology			habitat loss of muddy seabed.	Discharge License should be followed	amphioxus habitats during cofferdam installation		programme is required. With proper
					and extraction works will be overseen by water		implementation of water quality
			b) Indirect water quality impact may arise		quality monitoring mentioned.		mitigation measures, residual impact
			from installation and extraction of sheet				is expected to be acceptable.
			pile of cofferdam in construction phase.				
			c) Dredging and backfilling for installation				
			of diffuser will be conducted inside fully				
			enclosed cofferdam. No marine sediment				
			loss to water column is expected.				



Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Fisheries	8	8	a) No direct encroachment on Fish Culture	a) Conditions in the Environmental Permit and	Water quality at FCZ will be monitored during	Contractor	(a) No specific monitoring and audit
			Zone and Artificial Reefs in the Study Area	Discharge License should be followed	cofferdam installation and extraction works and		programme are required. With proper
			is expected.		dredging works in the construction phase as		implementation of water quality
					proposed.		mitigation measures, residual impact
			b) About 1,920 m2 of fishing ground and				is expected to be acceptable.
			500 m2 of benthic spawning ground will be				
			affected. Except the 5 m2 benthic				
			spawning ground will be lost permanently,				
			other impacted area will only be affected in				
			construction phase temporarily (reversible				
			impact). Indirect impact on fisheries				
			resources by the water quality				
			deterioration will be insignificant with				
			proper implementation of water quality				
			mitigation measures.				




Monthly	EM&A	Report
---------	------	--------

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Waste	9.8	WM4-	a) Construction of the sewage	a) All C&D materials generated will be	(a) Reuse C&D materials onsite and dispose excess	Contractor	The Contractor should apply for relevant
Management		WM23	treatment plant, laying of gravity	transported and stored at temporary	uncontaminated ones to public fill.		licenses/permits for waste disposal under
			sewers and rising mains and	storage area. Cover will be provided			different regulations and ordinances as
			submarine outfall are expected to	during transportation of dusty materials.	(b) Provide sufficient waste collection points for general		follows:
			generate mainly inert construction	Suitable materials will be sorted for	refuse and regularly maintained to avoid accumulation.		(a) Chemical Waste Permits/licenses
			and demolition (C&D) materials	reuse on-site. Only non-inert C&D	Dispose the waste at waste transfer or disposal facilities.		under the Waste Disposal Ordinance
			(or public fill) from excavation,	material will be disposed offsite to NENT			(Cap 354);
			and unused building materials.	Landfill.	(c) Minimize wastage through careful planning and avoiding		
			Other wastes include noninert		over purchase of construction materials.		(b) Public Dumping License under the
			C&D materials (or C&D waste),	b) Conditions in the Environmental			Land Miscellaneous Provisions)
			plant materials, scaffolding,	Permit and Discharge License should be	(d) Provide training to workers on site cleanliness, waste		Ordinance (Cap 28);
			formwork and packaging,	followed	management (waste reduction, reuse and recycle) and		
			chemical waste from plant		chemical handling procedures.		(c) Marine Dumping Permit under
			maintenance, bentonite slurry	c) Fueling of equipment will be			Dumping at Sea Ordinance (Cap 466); and
			from drilling works and general	conducted carefully onsite by mobile	(e) Hire licensed waste disposal contractors for waste		
			refuse from workers.	tanker to avoid storage of fuel and oil	collection and removal. Dispose waste at licensed waste		(d) Effluent Discharge License under the
				spillage.	disposal facilities.		Water Pollution Control Ordinance (Cap
			b) Dredging at the proposed				358).
			diffuser location will generate	d) Provision of drip trays for equipment	(f) Recondition and reuse bentonite as far as practical.		
			marine sediment.	likely cause spillage of chemical / fuel			b) Reference should be made to EPD's
				and provide routine maintenance.	(g) Conduct marine sediment test and dump dredged marine		booklets on licenses/permits. The
					sediment according to ETWB TCW No. 34/2002		Contractor shall also document recycling
					Management of Dredged/Excavated Sediment and Dumping		receipts/ disposal record to keep track of
					at Sea Ordinance.		waste movement. The ET shall check with
							the Contractor that these licenses/permits
					(h) Chemical waste shall be handled, stored and disposed		have been obtained. He should also
					properly, according to the relevant guidelines.		review the above documentations
							regularly to ensure compliance with
							legislations and specifications.



Monthly EM&A Report

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Landscape	Table	CM1-	a) Minor landscape and visual	a) Conditions in the Environmental	a) The contractor shall employ a professionally qualified	Contractor	a) Tree risk assessment shall be
and Visual	10-6	CM8	impact is expected due to	Permit and Discharge License should	Registered Landscape Architect (RLA) on the Environmental		undertaken by the contractor during
impact	& 10-	&	dredging work in open sea,	be followed.	Team to supervise and monitor the implementation of		construction to all existing trees within the
	7	OM1-	construction of the STP and		construction phase landscape and visual mitigation		project site as per "Guidelines for Tree
		OM5	pipelines on land and the loss of	b) Implement the recommended	measures. This is necessary to ensure that all the		Risk Assessment and Management
			existing trees and vegetation at	mitigation proposed in EM&A manual.	recommended landscape and visual mitigation measures		Arrangement".
			the sewage treatment plant site in		under Chapter 10 of the EIA are effectively implemented		
			the construction phase.		including minimization of the works footprint, ensuring that		b) Site inspections by appointed RLA shall
					those existing trees earmarked for retention on site or		be undertaken at monthly intervals to
					transplanting are protected and planting works are correctly		closely monitor all these aspects of work.
					implemented.		Inspection findings shall be logged in a site
							monitoring report with any discrepancies
							or concerns regarding the implementation
							and effectiveness of mitigation measures
							highlighted.



Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Build	11.6	BH1 -	a) As the proposed work is close	a) Conditions in the Environmental	a) Provision of protective covering or protective screen is	Contractor	a) A maximum vibration level of 7.5mm/s
Heritage		BH5	to some of the identified built	Permit and Discharge License should	recommended to identified built heritage to prevent damages		shall be adopted for the Grade 3 Hung
			heritage resources, condition	be followed.	by construction tools or waste.		Shing Temple and settlement check points
			survey, vibration and settlement				in the Alert/Alarm/Action limit levels at
			monitoring is recommended to	b) Implement the recommended	b) Maintenance of public access is suggested for identified		6mm/8mm/10mm shall be adopted.
			identified built heritage to prevent	mitigation proposed in EM&A manual.	built heritage. Besides, buffer zone of at least 1m from the		
			indirect damage by mechanical		works boundary should be provided for identified built		
			vibration and settlement.		heritage as far as possible.		
					c) Condition survey, vibration and settlement monitoring to		
					identified built heritage.		



APPENDIX O - CUMULATIVE STATISTICS ON COMPLAINTS, NOTIFICATIONS OF SUMMONS

	ED 540/2040 Dart Chalter Coursense Stars2 Coursense Works at Da Tai O	Page	0-2
C <u>C</u> <u>C</u>	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/27
JUJ	Monthly EM&A Report	Rev.	01
	,,	Date	Dec 23

Environmental Complaints Log

Complaint	Date of	Received	Received	Nature of	Relevant to the	Investigation/	Status
Log No.	Complaint	From	Ву	Environmental	Construction Work of	Mitigation	
				Complaint	Project Site? (Y/N)	Action	
001	28	EPD	ET	Waste	N	The	Closed
	December			Management		investigation	
	2021					reports	
						was submitted	
						on 7 January	
						2022	

Remark:

* No complaints, Notifications of Summons, or Successful Prosecutions were received in the reporting period.

Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions and Public Engagement Activities

Reporting Period	Complaints	Notifications of Summons and	Public Engagement Activities		
		Prosecutions			
This Month	0	0	0		
Cumulative Project-to-Date	1	0	0		